Research Report KTC-89-28

EARTHQUAKE HAZARD MITIGATION OF TRANSPORTATION FACILITIES FOR McCRACKEN COUNTY

by

L. John Fleckenstein Engineering Geologist

David L. Allen Chief Research Engineer

and

Vincent P. Drnevich Professor of Civil Engineering

Kentucky Transportation Center College of Engineering University of Kentucky Lexington, Kentucky

in cooperation with Transportation Cabinet Commonwealth of Kentucky

and

Federal Highway Administration U.S.Department of Transportation

The contents of this report reflect the views of the authors who are responsible for the facts and accuracy of the data presented herein. The contents do not necessarily reflect the official views or policies of the University of Kentucky, the Kentucky Transportation Cabinet, nor the Federal Highway Administration. This report does not constitute a standard, specification, or regulation. The inclusion of manufacturer names and tradenames are for identification purposes and are not to be considered as endorsements.

June 1989

Technical Report Documentation Page

1. Report No. KTC-89-28	2. Government Accession	n No.	3. Recipient's Catalog N	0.
4 994 10 124	<u> </u>			
4. Title and Subtitle			5. Report Date	
			June 1989	
Earthquake Hazard Mitigation of	Iransportation			
Facilities for McCracken County			6. Performing Organizati	ion Code
			8. Performing Organizati	ion Report No.6
7. Author(s)	5 5		KTC-89-28	
L. J. Fleckenstein, David L. Allen,	Vince P. Drnevich		1000020	,
9. Performing Organization Name and Address			10. Work Unit No. (TRA	S)
Kentucky Transportation Ce	enter			
College of Engineering			11. Contract or Grant No	0.
				PR-87-116
University of Kentucky	•			1110, 110
Lexington, KY 40506-0043	3	х	13. Type of Report and	Period Covered
			lor type or mapant and	
12. Sponsoring Agency Name and Address				
Kentucky Transportation Ca	abinet			
State Office Building			14. Sponsoring Agency	Code
Frankfort, KY 40622			in opencering rigency	
15. Supplementary Notes Publication of this report was sp	oneored by the Kentuc	ky Transportation Cahir	not with the LLS Densi	rtmont of
Transportation, Federal Highway		ky mansportation Gabii	iet with the 0.5. Depai	unent or
Fransportation, 1 oderar riighway	Administration			
16. Abstract				
Concern has grown in recen	t years over the	seismic activity of	the New Madrid	seismic zone in
Western Kentucky. McCracken Co				
supply, and equipment traffic into				
Cabinet is interested in the possib				
have been investigated and reco	mmended as bein	g the routes in N	cCracken County	that should be
maintained in a passable condition				
visually surveyed and all seismic	ally significant feat	ures cataloged. The	nese features are	logged by their
location on strip maps contained in	Appendix A and a	detailed listing of	all the potentially c	ritical features is
given in Appendix B.			p	
g. o pper				
1				
47 Mar Warda		de Blatta de Co		
17. Key Words	Mitigation	18. Distribution Statemen	nl	
Earthquake Earthquake	iviiliyaliUII			
Alluvium				
Seismic Analyses				
Modified Mercalli Scale				
19. Security Classif. (of this report)	20. Security Classif. (of	this page)	21. No. of Pages	22. Price
l Ingloggisted	المالية المالية	المائد	34	
Unclassified Unclassified		SII100		

Form DOT 1700.7 (8-72)

Reproduction of completed page authorized

INTRODUCTION

An awareness of earthquakes and their possible effects upon the nation's infrastructure is critically important to the public, and in particular, to public officials. The nation's highway system is one of the most important components of the infrastructure. After the occurrence of an earthquake, the highway system is the primary mode of transporting emergency supplies and services into an affected area. Thus, it is important to catalog the important components of the highway system and attempt to anticipate the possible damage to these components from an earthquake.

Western Kentucky in general and McCracken County in particular are in a high risk earthquake zone. In 1811-1812, three of the most severe earthquakes in American history shook the country. The location of these quakes was not on the infamous San Andreas fault nor anywhere along the well-known fault laden Pacific coast but was near a small town on the Mississippi River where the states of Kentucky and Missouri share a border (Figure 1). It is this river town, New Madrid, Missouri, that is the namesake of a region now regarded by seismologists and disaster response planners as the most hazardous earthquake zone east of the Rocky Mountains -- the New Madrid seismic zone.

In addition to these three great earthquakes, there are several other well documented factors demonstrating the susceptibility of the New Madrid region to the recurrence of major earthquakes. Through a decade of extensive research, an ancient crustal rift has

been found to underlie the relatively shallow sediments comprising the region's surface. This type of geologic structure is prone to seismic activity. The New Madrid rift has been identified as being of sufficient size to generate major earthquakes. Further evidence of the area's seismicity is the record of over 2.000 earthquakes detected in the zone since 1974. Though most have been of a magnitude below the threshold of human perception, their existence clearly indicates the high level of seismic activity occurring in the zone.

Seismologists have calculated the probabilities of recurrence of sizeable earthquakes in the New Madrid rift zone. The probability of a magnitude 6.3 earthquake (Richter scale) within 50 years is from 86 to 97 percent. The probability (1) of that same earthquake occurring within the next 15 years is from 40 to 63 percent. For comparison, the 1971 San Fernando earthquake (magnitude 6.6) killed 58 people and caused \$480 million worth of damage. The 1988 Armenian earthquake of similar magnitude killed approximately 25,000 to 30,000 people.

The probability of a magnitude 7.6 earthquake occurring within 50 years is from 19 to 29 percent. The probability for this size earthquake occurring within 15 years drops to a range of 5.4 to 8.7 percent. On February 4, 1975, the Haicheng earthquake in China had a magnitude of 7.3 and destroyed or damaged about 90 percent of the structures in a city of 90.000 people.

When comparing historical earthquakes of similar magnitude, one must take into consideration

that death totals and damage estimates will vary greatly due to the geology, population density, types of building, and quality of construction.

For a given earthquake, effects at a given location are described by the Modified Mercalli Intensity (MMI) scale (2) which ranges from I (no damage and felt only by instruments) to XII (total destruction). Details of the MMI scale are given in Table 1. Values of MMI associated with the 1811-1812 earthquakes are shown in Figure 1. The potential for damage and destruction from earthquakes in the region is significant.

In 1982, the Governor's Task Force on Earthquake Hazards and Safety was created to evaluate Kentucky's earthquake risk and to make recommendations for responding to those risks. This task force recommended increased public awareness and education programs, improved emergency response planning and training, improved building codes and seismic restraint designs, evaluation of other mitigation measures, and participation in national and regional earthquake forums and funding programs.

In 1984, Governor Collins created the Governor's Earthquake Hazards and Safety Technical Advisory Panel (GEHSTAP) to analyze scientific and engineering data regarding seismic risks in Kentucky and to make specific recommendations on mitigation, public awareness, response planning, and policy development for public health and safety. The States are dependent on their highway systems for the movement of goods and services. Due

to the possible adverse effects a major earthquake could have on this system, the Earthquake Stability and Transportation Subcommittee (ESTS) of GEHSTAP was formed.

ESTS has encouraged the Kentucky Transportation Cabinet to secure funding for generating and implementing an earthquake hazard mitigation plan in an attempt to safeguard the highway system against catastrophic earthquake failure. As a result, the Cabinet commissioned the Kentucky Transportation Center at the University of Kentucky to analyze and assess the possible effects of an earthquake on highway facilities. The study area includes the 26 western-most counties in Kentucky that are adjacent to the New Madrid seismic zone (Figure 1). To date, one of the results of that study has been the recommendation that over 1.000 miles of highways in the study area be utilized as emergency or "priority" routes. These would be the primary routes used for transporting emergency supplies and personnel after an earthquake. Also, it is anticipated that these would be the first routes repaired after an earthquake.

The initial task in identifying these priority routes was to decide where they should begin; that is, in the event of a major earthquake, the point at which the transport of goods and services would originate. Ideally, the city chosen should possess the following attributes:

1. Sufficient size to contain all necessary personnel, supplies, and facilities to respond quickly to a major emergency;

- 2. Proximity to the high hazard area to speed the relief effort but not so close as to suffer the same high risk potential;
- 3. Easy access from other major cities in the State; and
- 4. Sufficient routes to provide relatively direct access to all 26 high-risk counties.

The city best fitting these criteria is Bowling Green. Located at the eastern edge of the earthquake zone in Warren County, Bowling Green meets both the size criterion (population 40,450) and the accessibility criterion (Louisville and Nashville via I 65 and Lexington via the Bluegrass Parkway). Bowling Green provides access to the 26county area via US 68/KY 80; this road was chosen as the main eastwest artery because it crosses Lake Barkley and Kentucky Lake upstream from the dams impounding those bodies of water.

As a first step towards establishing an overall policy for earthquake hazard mitigation in the highway system, these priority routes have been visually surveyed and all natural and man-made features along these routes that are considered seismically significant were cataloged. With this information, a realistic and cost-effective plan for "hardening" these routes against earthquakes can be established. Such efforts are currently under way.

PRIORITY ROUTE IN McCRACKEN COUNTY

McCracken County is located approximately 45 miles northeast of the center of the New Madrid

Seismic Zone. Figure 1 indicates that McCracken County is located in the X and the IX bands of the MMI scale. This indicates considerable damage could occur in McCracken County in the event of a major earthquake.

US 60, US 68, US 62 East, US 62 West, and US 62 have been designated as the priority routes for McCracken County. US 60 starts at the McCracken County-Ballard County line and continues east for 19.86 miles, ending at the McCracken County-Livingston County line. US 68 starts at the McCracken County-Marshall County line and continues west for 2.70 miles, ending at the junction of US 62 and US 68. US 62 starts at the McCracken County-Marshall County line and continues west for 4.15 miles, ending at the junction of US 60. (US 62 is split into US 62 East and US 62 West between milepost 14.1 and milepost 12.95).

A number of features along the priority routes could potentially hamper rescue and relief efforts. These features included bridges, soil fills, cut slopes, gas pipelines, power lines, large trees, water impoundments, faults, a radio tower, a rail tunnel, a water tower, and a gravel conveyor. These features are logged by their location on strip maps contained in Appendix A and a detailed listing of all potentially critical features is given in Appendix B.

BRIDGES

Bridges are the most significant and important features on the priority route. With few exceptions, existing highway bridges in the study area have not been designed to resist motions and forces that may be generated by earthquakes. Bridges located within the seismic zone could possibly be damaged, thus reducing their load-carrying ability. In some cases, damage could be sufficiently great to cause complete collapse. Several types of damage could occur:

- 1. A bridge could fail at the bearing which supports the main spans, causing the spans to fall from the bearings and possibly from the piers or abutments.
- 2. Failure could occur in the columns, piers, or footings which would reduce the load-carrying capacity of the bridge, if the bridge was still in place.
- 3. An abutment could tilt allowing the entire span to fall.
- 4. Soil movement or slumping could affect the bridge approach fills, damaging the abutments or piers, or making the bridge inaccessible.

There are ten bridges on US 60, four on US 62, and two on US 68 in McCracken County. The bridges are located at the following:

US 60

- 1. West Fork of Massack Creek,
- 2. West Fork of Massack Creek,
- 3. I.C.R.R.,
- 4. Massack Creek,
- 5. Two I-24 bridges cross US 60,
- 6. Perkins Creek Channel,

- 7. I.C.and G. Railroad,
- 8. US 62, and
- 9. Tennessee River.

US 62 East

- 1. I.C.R.R., and
- 2. KY 131 crosses US 62 East.

US 62 West

- 1. I.C.R.R., and
- 2. US 60 crosses over US 62 West.

US 68

1. Two I-24 bridges cross over US 68.

Research is currently under way studying the effects that an earthquake could have on these bridges and their approach fills.

FILLS

Highway fills are particularly important because of their tendency to fail from seismically induced motions. Fills fail in one of two major modes. The first is a generalized circular or wedge-shaped failure resulting in one or both traffic lanes moving down and out. If both lanes failed, this would certainly render the route impassable and immediate repairs would be necessary. The second mode of failure is a general slumping or settling of the embankment. The roadway would probably remain passable if settlement or slumping were not severe but reduced speed limits would be required for safety.

over the I.C.R.R.

US 62 East

Large fills on priority routes in McCracken County are located as follows:

US 60

- 1. 0.60 mile west of the junction of KY 1154 (north) and US 60,
- 2. Approach fills for the bridges over the West Fork of Massack Creek,
- 3. 0.05, and 0.75 mile east of Future City,
- 4. Approach fills for the bridge over the I.C.R.R.,
- 5. Approach fills for the Massack Creek bridge,
- 6. Approach fills for the Perkins Creek Channel bridge,
- 7. 0.56 mile east of the Perkins Creek Channel bridge,
- 8. Approach fills for the bridge over I.C. and G. Railroad,
- 9. Approach fills for the bridge over US 62, and
- 10. Approach fills for the bridge over the Tennessee River.

US 62

1. 0.85, 1.20, 2.25, and 2.80 miles west of the McCracken County-Marshall County line,

US 62 West

- 1. 0.795 and 0.39 mile east of the bridge over the I.C.R.R., and
- 2. Approach fills for the bridge

 Approach fills for the bridge over the I.C.R.R.
 POWER LINES

High voltage power lines also were cataloged during the route surveys. The heights of the lines above the roadway were estimated visually. Power company officials speculated that a number of breaks along each power line would occur during a major earthquake. In most cases, fallen lines would not be transmitting power because power would be automatically cut off within a few seconds in the event of a break.

Additionally, power line support towers could potentially fall across a priority route.

Power lines cross priority routes at the following locations:

US 60

- 1. 0.35 and 0.70 mile east of the junction of KY 1154 (north) and US 60,
- 2. 0.40 mile east of Future City,
- 3. 0.10 and 0.50 mile west of the Massack Creek bridge,
- 4. 0.15, 0.16, and 0.60 mile east of the Massack Creek bridge, and
- 5. 0.61 mile east of the Perkins Creek Channel bridge.

US 62 West

1. 0.39 and 0.59 mile east of the bridge over the I.C.R.R.

US 62 East

1. 0.33 and 0.57 mile west of the KY 136 bridge.

US 68

1. 0.39 mile east of I-24 bridges.

TREES

The behavior of trees during an earthquake depends upon many factors including their condition, type, height, and size. Local soil conditions, geometry of the ground surface, and characteristics of the earthquake can also be important. Violent ground motions accompanied by surface rupture and perhaps permanent displacement of the soil surface produce sudden surface accelerations of the ground which can snap and uproot large trees (3).

Trees are so numerous that, if many of them fell, the priority routes in McCracken County could effectively be blocked for several hours or days before emergency crews could clear the debris. Groups of large trees are located near the road at the following sites:

US 60

- 1. 0.0, 0.80, 1.80, and 2.30 miles east of the McCracken County-Ballard County line,
- 2. 0.34 mile west of the bridge over the I.C.R.R.,
- 3. 0.10 mile west of the junction of KY 1565 (north) and US 60,

- 4. 0.10 mile west of the Massack Creek bridge, and
- 5. 0.95 mile east of the Massack Creek bridge.

US 68

1. 1.00 and 0.50 mile west of the McCracken County-Marshall County line.

ALLUVIUM

Soil maps for McCracken County indicate that there are large amounts of alluvium present throughout the county. Alluvium is a loose, fine-grain soil which is deposited by flowing water such as creeks and rivers. Due to the nature of the alluvium, ground motions at the surface of the soil can be many times greater than those within the underlying bedrock and temporary liquefaction can occur (Figure 2). An alluvium map for McCracken County is shown in Figure 3.

CONCLUSIONS

In 1984, ESTS developed a fivefold plan of action for formulating and implementing a seismic mitigation policy for the western Kentucky seismic zone. To date, the Kentucky Transportation Center has established priority routes for all 26 counties in the western Kentucky seismic zone and developed seismic risk maps of all natural and manmade features that are susceptible to earthquake damage that could jeopardize the priority routes.

Current work is being conducted to analyze these features and make recommendations for hardening them against earthquake damage. Future work involves training key personnel in the Transportation Cabinet in hazard mitigation and seismic safety; which includes bridge inspectors, district engineers, construction inspectors, designers, and maintenance personnel.

Following the education of key personnel, the mitigation plan proposed by the Kentucky Transportation Center will be reviewed by the Kentucky Transportation Cabinet and a program will be established for implementation. The final step involves the use of relevant seismic codes for all new construction, repair, and maintenance.

REFERENCES

- 1. Johnson, Arch C., "A Brief Overview of the Geology, Seismicity and Seismic Hazard of the Central Mississippi Valley Area," Proceedings, A Regional Seminar on Earthquake Fundamentals for the Mississippi Valley, Earthquake Engineering Research Institute, Memphis, Tennessee, October 29, 1985.
- 2. Green, N. B., "Earthquake Resistant Building Design and Construction," Third Edition, Elsevier, 1987, Page No. 179-180.
- 3. Keller, Edward A., "Environmental Geology," Charles E. Merrill Publishing Company, A Bell and Howell Company, 1979, Page No. 157.

Additional Information

The Commonwealth of Kentucky has prepared a State Emergency Operations Procedures (State EOP) manual that is produced by the Division of Disaster and Emergency Services (DES), Department of Military Affairs, Frankfort, 40601. Annexes H. on Transportation and DD on Earthquakes give additional information on disaster preparedness and response.

A copy of the State EOP and information on local hazard mitigation activities and response preparedness are available from the AREA 1 Office of DES which is located in Mayfield. The phone numbers at this office are (502) 564-8601 and (502) 247-9712.

Additional information about the study discussed in this report should be directed to David L. Allen, Project Director, at the Kentucky Transportation Center, (606) 257-4513. Requests to be placed on the mailing list for updated information should be submitted on your company or agency letterhead to the Kentucky Transportation Center at the University of Kentucky, Lexington Kentucky 40506-0043.

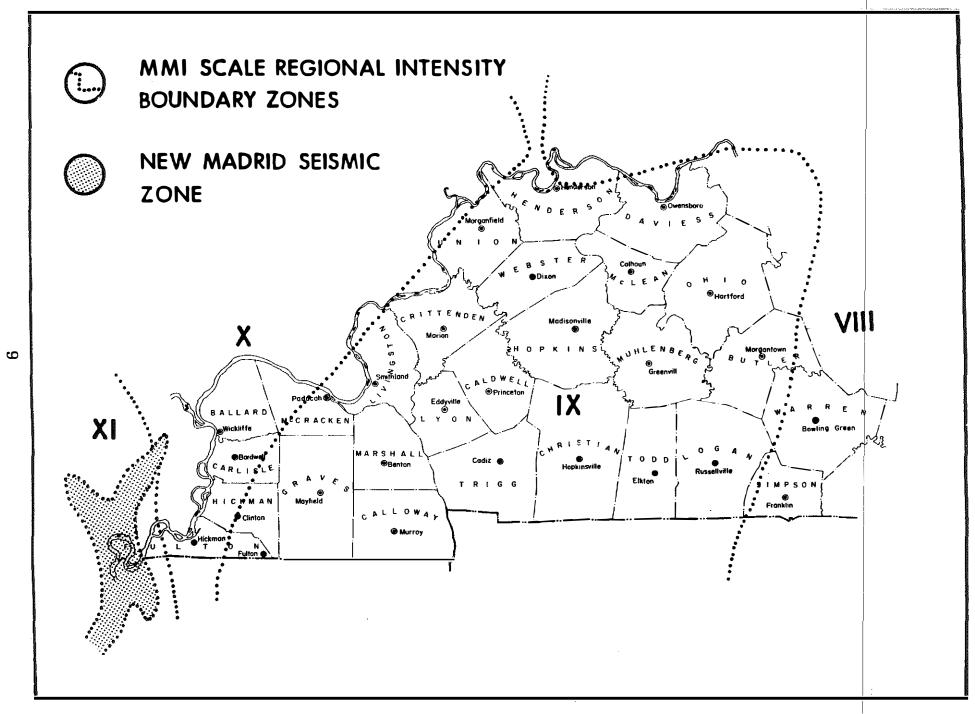


Figure 1: The twenty-six counties included in this study area.

Table 1: MODIFIED MERCALLI INTENSITY SCALE

Modified Mercalli Intensity Scale, 1956 Version

The following comments by Dr. Richter precede the published statement of the intensity scale:

...Each effect is named at the level of intensity at which it first appears frequently and characteristically. Each effect may be found less strongly, or in fewer instances, at the next lower grade of intensity; more strongly or more often at the next higher grade. A few effects are named at two successive levels to indicate a more gradual increase.

Masonry A, B, C, D. To avoid ambiguity of language, the quality of masonry, brick or otherwise, is specified by the following lettering.

Masonry A. Good workmanship, mortar, and design; reinforced, especially laterally, and bound together by using steel, concrete, etc.; designed to resist lateral forces.

Masonry B. Good workmanship and mortar, reinforced by not designed in detail to resist lateral forces.

Masonry C. Ordinary workmanship and mortar; no extreme weakness like failing to tie corners, but neither reinforced nor designed against horizontal forces.

Masonry D. Weak materials, such as adobe; poor mortar; low standards of workmanship; weak horizontally.

The following list represents the twelve grades of the scale.

- I. Not felt. Marginal and long-period effects of large earthquakes.
- II. Felt by persons at rest, on upper floors, or favorable placed.
- III. Felt indoors, Hanging objects swing. Vibration like passing of light trucks. Duration estimated. May not be recognized as an earthquake.
- IV. Hanging objects swing. Vibration like passing of heavy trucks; or sensation of a jolt like a heavy ball striking the walls. Standing motor cars rock. Windows, dishes, doors rattle. Glasses clink. Crockery clashes. In the upper range of IV wooden walls and frame creak.
- V. Felt outdoors; direction estimated. Sleepers awakened. Liquids disturbed, some spilled. Small unstable objects displaced or upset. Doors swing, close, open. Shutters, pictures move. Pendulum clocks stop, start, change rate.
- VI. Felt by all. Many frightened and run outdoors. Persons walk unsteadily. Windows, dishes, glassware broken, Knickknacks, books, etc., off shelves. Pictures off walls. Furniture moved or overturned. Weak plaster and masonry D cracked. Small bells ring (church, school). Trees, bushes shaken.
- VII. Difficult to stand. Noticed by drivers of motor cars. Hanging objects quiver. Furniture broken. Damage to masonry D, including cracks. Weak chimneys broken at roof line. Fall of plaster, loose bricks, stones, tiles, cornices. Same cracks in masonry C. Waves on ponds; water turbid with mud. Small slides and caving in along sand or gravel banks. Large bells ring. Concrete irrigation ditches damaged.
- VIII. Steering of motor cars affected. Damage to masonry C; partial collapse. Some damage to masonry B; none to masonry A. Fall of stucco and some masonry walls. Twisting, fall of chimneys, factory stacks, monuments, towers, elevated tanks. Frame houses moved on foundation if not bolted down; loose panel walls thrown out. Decayed piling broken off. Branches broken from trees. Changes in flow or temperature of springs and wells. Cracks in wet ground and on steep slopes.
- IX. General panic. Masonry D destroyed; masonry C heavily damaged, sometimes with complete collapse; masonry B seriously damaged. Frame structures, if not bolted, shifted off foundations. Frames cracked. Serious damage to reservoirs. Underground pipes broken. Conspicuous cracks in ground. In alluviated areas sand and mud ejected, earthquake fountains, sand crater.
- X. Most masonry and frame structures destroyed with their foundations. Some will-built wooden structures and bridges destroyed. Serious damage to embankments. Large land slides. Water thrown on banks of canals, river, lakes, etc. Sand and mud shifted horizontally on beaches and flat lands. Rails bent slightly.
- XI. Rails bent greatly. Underground pipelines completely out of service.
- XII. Damage nearly total. Large rock masses displaced. Lines of sight and level distorted. Objects thrown in the air.

AMPLIFICATION OF SHAKING AND DAMAGE DUE TO SHAKING

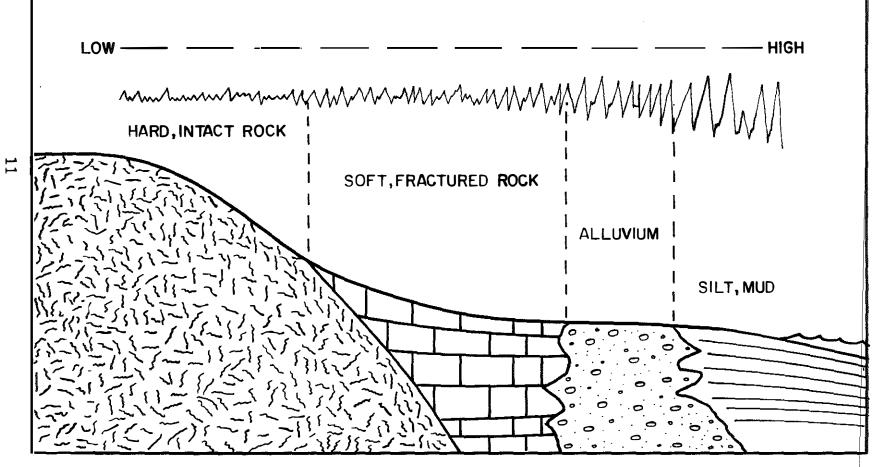


Figure 2: Amplification of shaking in softer rock 8 soil during an earthquake.


APPENDIX A

STRIP MAP FOR McCRACKEN COUNTY

US 60, US 62, US 62 West, US 62 East, AND US 68


US60


MCCRACKEN

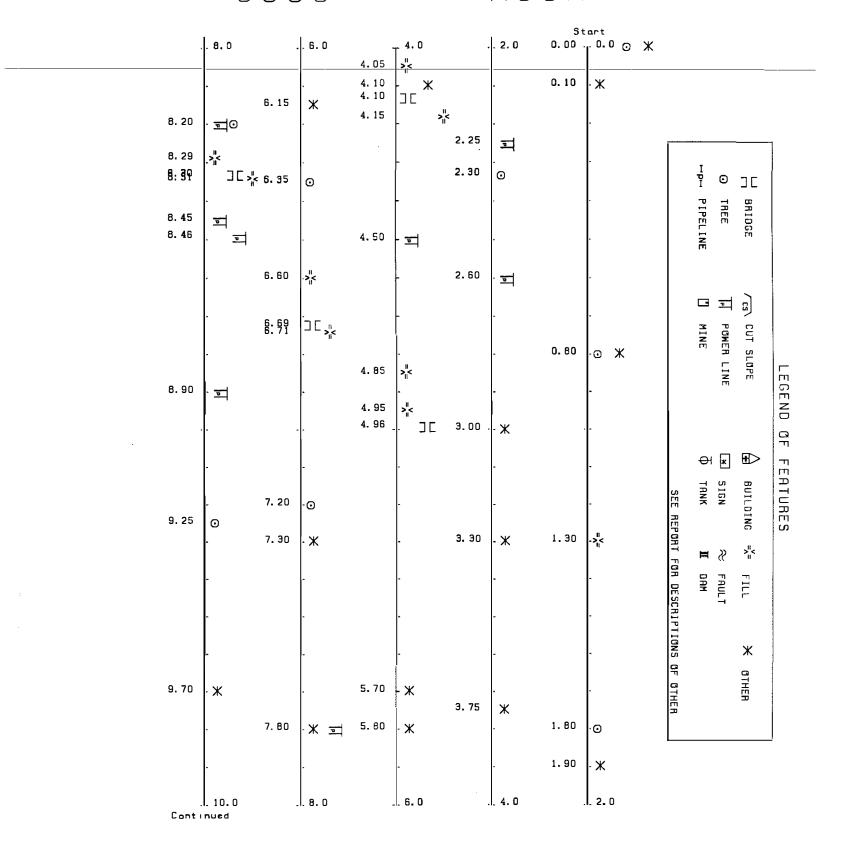





MCCRACKEN

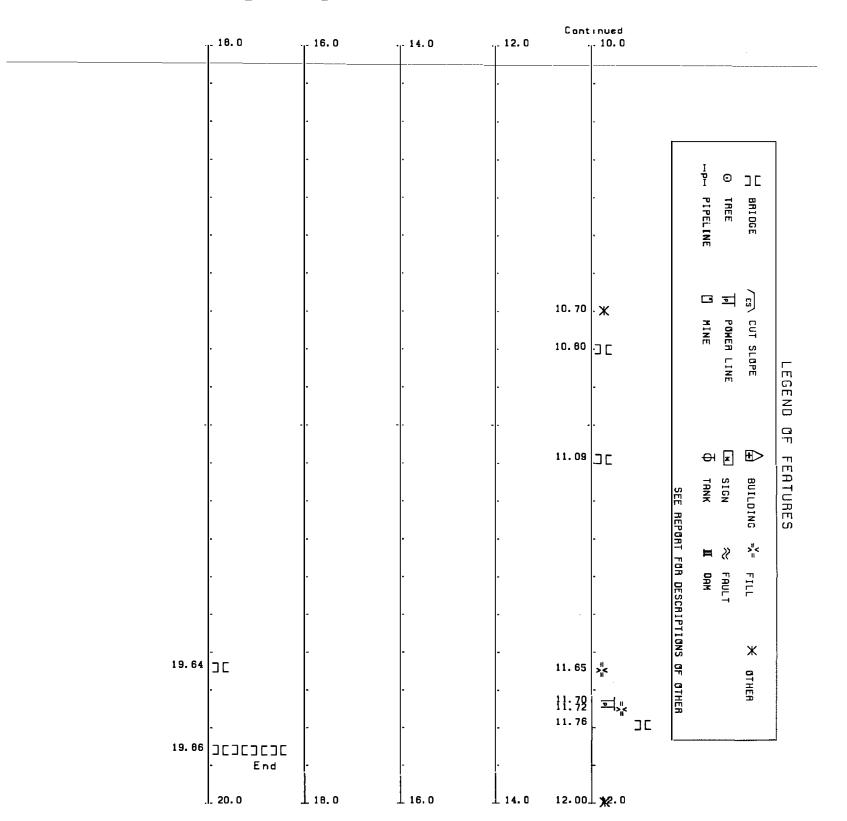

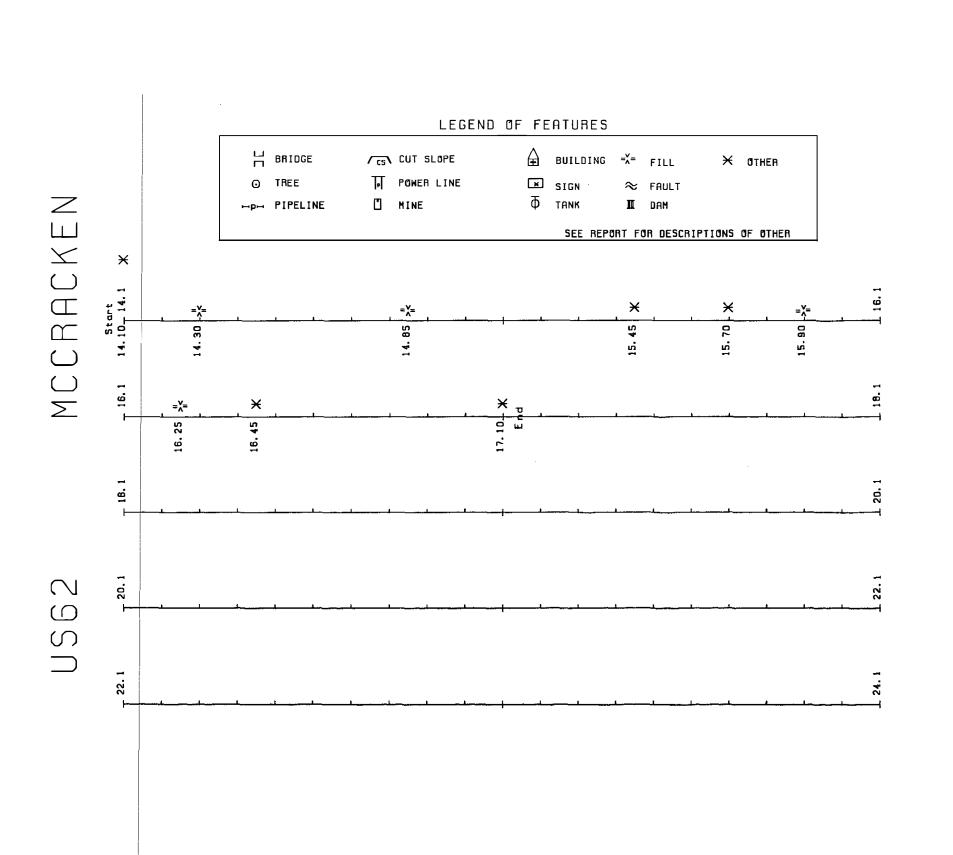

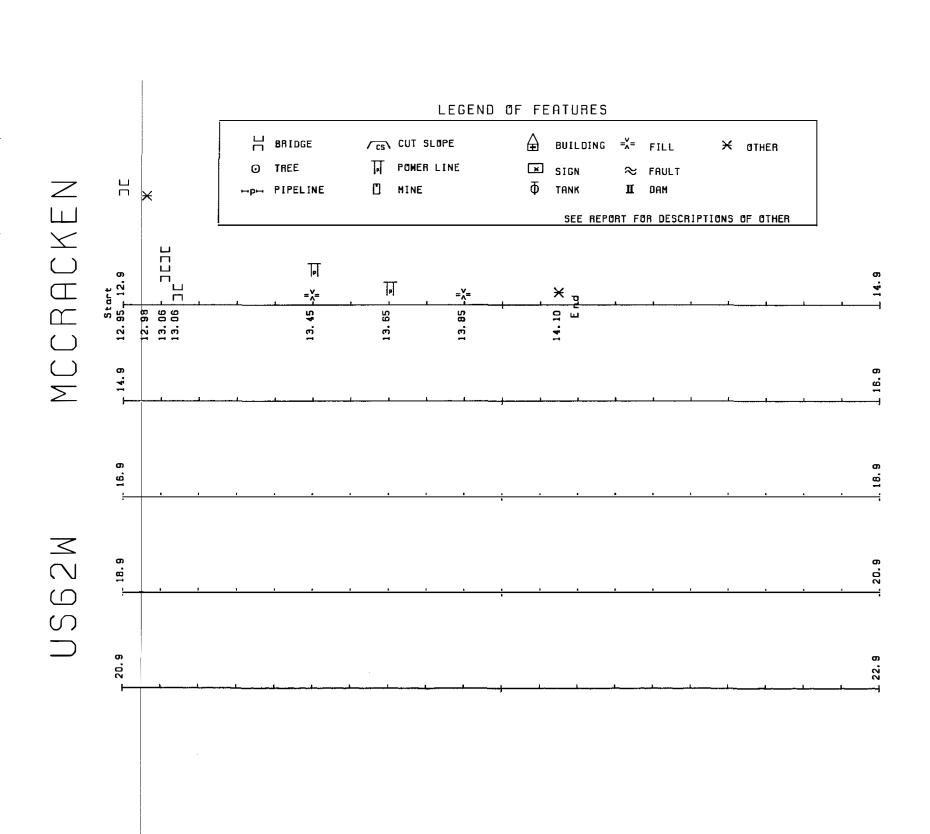

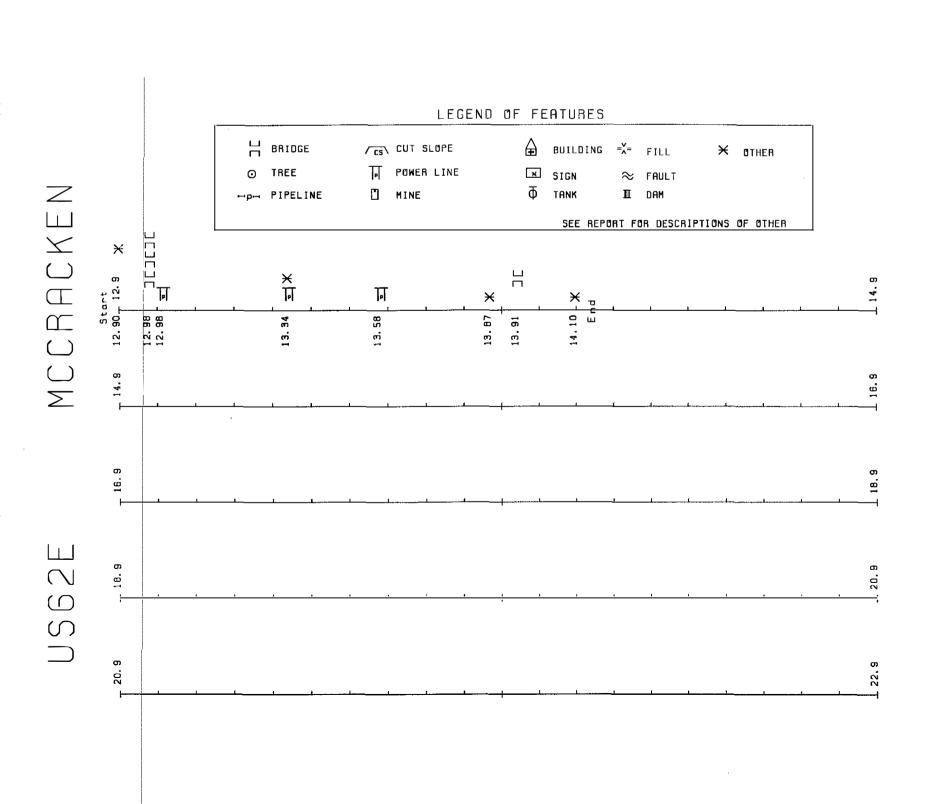

APPENDIX B
SEISMICALLY SIGNIFICANT FEATURES

Milepoint	Feature	Data
0.00	Other	McCracken Co - Ballard Co Boundary Road Surface Type - Flexible
0.00	Trees	Number of Trees 7 Height 70 feet Diameter 36 in. Ending Milepoint 0.20 Distance From Road 20 feet Road Surface Type - Flexible
0.10	Other	Junction US 62 Heading East-West Road Surface Type - Flexible
0.80	Trees	Number of Trees 20 Height 60 feet Diameter 18 in. Ending Milepoint 1.10 Distance From Road 15 feet Road Surface Type - Flexible
0.80	Other	Junction KY 995 Headed North Road Surface Type - Flexible
1.30	Fill	Material Type - Soil Height 10 feet Side slope 2:1 Length 100 feet Crest 24 feet Type Fill - Other Road Surface Type - Flexible
1.80	Trees	Number of Trees 15 Height 65 feet Diameter 20 in. Ending Milepoint 1.81 Distance From Road 15 feet Road Surface Type - Flexible
1.90	Other	Junction KY 1154 Heading North Road Surface Type - Flexible
2.25	Power Line	Electrical Power Line 3 Lines Height 35 feet Steel Support Structure Unknown Volts Road Surface Type - Flexible
2.30	Trees	Number of Trees 15 Height 65 feet Diameter 20 in. Ending Milepoint 2.40 Distance From Road 15 feet Road Surface Type - Flexible

Milepoint	Feature	Data
2.60	Power Line	Electrical Power Line 3 Lines Height 35 feet Wood Support Structure Unknown Volts Road Surface Type - Flexible
3.00	Other	Future City Road Surface Type - Flexible
3.30	Other	Junction KY 726 Heading North & South Road Surface Type - Flexible
3.75	Other	Junction KY 996 Heading North & Southeast Road Surface Type - Flexible
4.05	Fill	Material Type - Soil Height 7 feet Side slope 2:1 Length 500 feet Crest 25 feet Type Fill - Other Road Surface Type - Flexible
4.10	Bridge	Number of Spans 1 Over Stream Concrete Box Beam End 1 Fixed End 2 Fixed Deck Type - Concrete Length 50 feet Width 25 feet Pier Type - Unknown SPC Rating - C Surface Type - Flexible Expansion Type - Other End 1 Substructure - Full End 2 Substructure - Full Foundation Type - Unknown
4.10	Other	Future City Limits Road Surface Type - Flexible
4.15	Fill	Material Type - Soil Height 7 feet Side slope 2:1 Length 1,000 feet Crest 25 feet Type Fill - Other Road Surface Type - Flexible
4.50	Power Line	Electrical Power Line 3 Lines Height 35 feet Wood Support Structure Unknown Volts Road Surface Type - Flexible

Milepoint	Feature	Data
4.85	Fill	Material Type - Soil Height 5 feet Side slope 2:1 Length 100 feet Crest 25 feet Type Fill - Other Road Surface Type - Flexible
4.95	Fill	Material Type - Soil Height 5 feet Side slope 2:1 Length 100 feet Crest 25 feet Type Fill - Other Road Surface Type - Flexible
4.96	Bridge	Number of Spans 1 Over Stream Concrete Box Beam End 1 Fixed End 2 Fixed Deck Type - Concrete Length 40 feet Width 25 feet Pier Type - Unknown SPC Rating - C Surface Type - Flexible Expansion Type - Other End 1 Substructure - Full End 2 Substructure - Full Foundation Type - Unknown
5.70	Other	Junction KY 305 Headed North Road Surface Type - Flexible
5.80	Other	Civil Air Patrol Road Surface Type - Flexible
6.15	Other	Junction KY 724 Headed South Road Surface Type - Flexible
6.35	Trees	Number of Trees 40 Height 70 feet Diameter 18 in. Ending Milepoint 6.45 Distance From Road 20 feet Road Surface Type - Flexible
6.60	Fill	Material Type - Soil Height 40 feet Side slope 1:1 Length 500 feet Crest 25 feet Type Fill - Other Road Surface Type - Flexible

Milepoint	Feature	Data
6.69	Bridge	Number of Spans 3 Type Unknown Concrete Box Beam End 1 Fixed Pier 1 Fixed Pier 2 Fixed End 2 Fixed Deck Type - Concrete Length 150 feet Width 26 feet Pier Type - Solid SPC Rating - C Surface Type - Flexible Expansion Type - Other End 1 Substructure - Stub End 2 Substructure - Stub Foundation Type - Unknown
6.71	Fill	Material Type - Soil Height 40 feet Side slope 1:1 Length 500 feet Crest 25 feet Type Fill - Other Road Surface Type - Flexible
7.20	Trees	Number of Trees 20 Height 55 feet Diameter 18 in. Ending Milepoint 7.30 Distance From Road 15 feet Road Surface Type - Flexible
7.30	Other	Junction KY 1565 Heading North Road Surface Type - Flexible
7.80	Other	Junction KY 1565 Heading South Road Surface Type - Flexible
7.80	Power Line	Electrical Power Line 3 Lines Height 40 feet Wood Support Structure Unknown Volts Road Surface Type - Flexible
8.20	Power Line	Electrical Power Line 3 Lines Height 40 feet Wood Support Structure Unknown Volts Road Surface Type - Flexible
8.20	Trees	Number of Trees 75 Height 45 feet Diameter 16 in. Ending Milepoint 8.60 Distance From Road 15 feet Road Surface Type - Flexible



Milepoint	Feature	Data
8.29	Fill	Material Type - Soil Height 6 feet Side slope 2:1 Length 150 feet Crest 25 feet Type Fill - Other Road Surface Type - Flexible
8.30	Bridge	Number of Spans 5 Over Stream Concrete Box Beam End 1 Fixed Pier 1 Fixed Pier 2 Fixed Pier 3 Fixed Pier 4 Fixed End 2 Fixed Deck Type - Concrete Length 240 feet Width 25 feet Pier Type - Solid SPC Rating - C Surface Type - Flexible Expansion Type - Other End 1 Substructure - Full End 2 Substructure - Full Foundation Type - Unknown
8.31	Fill	Material Type - Soil Height 6 feet Side slope 2:1 Length 500 feet Crest 25 feet Type Fill - Other Road Surface Type - Flexible
8.45	Power Line	Electrical Power Line 3 Lines Height 40 feet Steel Support Structure Unknown Volts Road Surface Type - Flexible
8.46	Power Line	Electrical Power Line 9 Lines Height 40 feet Steel Support Structure Unknown Volts Road Surface Type - Flexible
8.90	Power Line	Electrical Power Line 3 Lines Height 35 feet Steel Support Structure Unknown Volts Road Surface Type - Flexible
9.25	Trees	Number of Trees 60 Height 70 feet Diameter 18 in. Ending Milepoint 9.50 Distance From Road 20 feet Road Surface Type - Flexible

Milepoint	Feature	Data
9.70	Other	Junction KY 998 Heading North & South Road Surface Type - Flexible
10.70	Other	Junction I24 Heading Northwest & Southeast Road Surface Type - Flexible
10.80	Bridge	Number of Spans 2 Steel Girder I-Beam Bridge Type - Overpass End 1 Rocker Pier 1 Rocker End 2 Rocker Deck Type - Concrete Length 250 feet Width 35 feet Pier Type - Unknown SPC Rating - C Surface Type - Flexible Expansion Type - Poured Compression End 1 Substructure - Stub End 2 Substructure - Stub Foundation Type - Unknown
11.09	Bridge	Number of Spans 3 Over Stream Concrete T-Beam End 1 Fixed Pier 1 Fixed Pier 2 Fixed End 2 Fixed Deck Type - Concrete Length 115 feet Width 88 feet Pier Type - Open SPC Rating - C Surface Type - Flexible Expansion Type - Sliding Plate End 1 Substructure - Stub End 2 Substructure - Stub Foundation Type - Unknown
11.65	Fill	Material Type - Soil Height 25 feet Side slope 2:1 Length 500 feet Crest 85 feet Type Fill - Other Road Surface Type - Flexible
11.70	Power Line	Electrical Power Line 6 Lines Height 20 feet Wood Support Structure Unknown Volts Road Surface Type - Flexible
11.72	Fill	Material Type - Soil Height 25 feet Side slope 2:1 Length 500 feet Crest 85 feet Type Fill - Other Road Surface Type - Flexible

Milepoint	Feature	Data
11.76	Bridge	Number of Spans 3 Type Unknown Concrete T-Beam End 1 Fixed Pier 1 Fixed Pier 2 Fixed End 2 Fixed Deck Type - Concrete Length 263 feet Width 88 feet Pier Type - Solid SPC Rating - C Surface Type - Flexible Expansion Type - Other End 1 Substructure - Full End 2 Substructure - Full Foundation Type - Unknown
12.00	Other	City of Paducah Road Surface Type - Flexible
19.64	Bridge	Number of Spans 3 Underpass Concrete T-Beam End 1 Fixed Pier 1 Fixed Pier 2 Fixed End 2 Fixed Deck Type - Concrete Length 204 feet Width 42 feet Pier Type - Open SPC Rating - C Surface Type - Flexible Expansion Type - Other End 1 Substructure - Stub End 2 Substructure - Stub Foundation Type - Unknown
19.86	Bridge	Number of Spans 24 Steel Girder I-Beam Bridge Type - Overpass Bridge Bearing Type Unknown Deck Type - Concrete Length 1,200 feet Width 20 feet Pier Type - Solid SPC Rating - C Surface Type - Flexible Expansion Type - Other End 1 Substructure - Stub End 2 Substructure - Stub Foundation Type - Unknown

Milepoint	Feature	Data
19.86	Bridge	Number of Spans 3 Overpass Steel Truss Truss Type - Through Through Type - Camel Back End 1 Rocker Pier 1 Rocker Pier 2 Rocker END 2 Rocker Deck Type - Concrete Length 1,200 feet Width 25 feet Pier Type - Open SPC Rating - C Surface Type - Flexible Expansion Type - Other End 1 Substructure - Open Abutment End 2 Substructure - Open Abutment Foundation Type - Unknown
19.86	Bridge	Number of Spans 3 Steel Girder I-Beam Bridge Type - Overpass End 1 Rocker Pier 1 Rocker Pier 2 Rocker END 2 Rocker Deck Type - Concrete Length 636 feet Width 25 feet Pier Type - Open SPC Rating - C Surface Type - Flexible Expansion Type - Other End 1 Substructure - Open Abutment End 2 Substructure - Open Abutment Foundation Type - Unknown
19.86	Bridge	Number of Spans 3 Type Unknown Steel Truss Truss Type - Through Through Type - K-truss End 1 Fixed Pier 1 Fixed Pier 2 Fixed End 2 Fixed Deck Type - Concrete Length 3,036 feet Width 24 feet Pier Type - Solid SPC Rating - C Surface Type - Flexible Expansion Type - Other End 1 Substructure - Full End 2 Substructure - Full Foundation Type - Unknown

Milepoint	Feature	Data
14.10	Other	US 62 Splits into East and Westbound Lanes Road Surface Type - Flexible
14.30	Fill	Material Type - Soil Height 20 feet Side slope 2:1 Length 150 feet Crest 70 feet Type Fill - Other Road Surface Type - Flexible
14.85	Fill	Material Type - Soil Height 25 feet Side slope 2:1 Length 200 feet Crest 70 feet Type Fill - Other Road Surface Type - Flexible
15.45	Other	Junction US 68 Heading East Road Surface Type - Flexible
15.70	Other	Junction KY 787 Heading South Road Surface Type - Flexible
15.90	Fill	Material Type - Soil Height 25 feet Side slope 2:1 Length 300 feet Crest 70 feet Type Fill - Other Road Surface Type - Flexible
16.25	Fill	Material Type - Soil Height 45 feet Side slope 2:1 Length 175 feet Crest 36 feet Type Fill - Other Road Surface Type - Flexible
16.45	Other	Junction CO 1201 Heading North Road Surface Type - Flexible
17.10	Other	McCracken Co - Marshall Co Boundary Road Surface Type - Flexible

3.611		.
Milepoint	Feature	Data
13.34	Power Line	Electrical Power Line 6 Lines Height 40 feet Steel Support Structure Unknown Volts Road Surface Type - Flexible
13.34	Other	Steel Tower, 100 feet high, 25 feet from Road Road Surface Type - Flexible
13.58	Power Line	Electrical Power Line 3 Lines Height 35 feet Wood Support Structure Unknown Volts Road Surface Type - Flexible
13.87	Other	Junction KY 131 Heading South Road Surface Type - Flexible
13.91	Bridge	Number of Spans 3 Type Unknown Concrete T-Beam End 1 Rocker Pier 1 Rocker Pier 2 Rocker END 2 Rocker Deck Type - Concrete Length 125 feet Width 25 feet Pier Type - Open SPC Rating - C Surface Type - Flexible Expansion Type - Poured Compression End 1 Substructure - Stub End 2 Substructure - Stub Foundation Type - Unknown
14.10	Other	US 62 East and US 62 West Converge Road Surface Type - Flexible

Milepoint	Feature	Data
12.90	Other	Junction US 60 Heading East Road Surface Type - Flexible
12.98	Power Line	Electrical Power Line 3 Lines Height 40 feet Wood Support Structure Unknown Volts Road Surface Type - Flexible
12.98	Bridge	Number of Spans 2 Type Unknown Concrete T-Beam End 1 Fixed Pier 1 Fixed End 2 Fixed Deck Type - Concrete Length 76 feet Width 30 feet Pier Type - Open SPC Rating - C Surface Type - Flexible Expansion Type - Other End 1 Substructure - Stub End 2 Substructure - Stub Foundation Type - Unknown
12.98	Bridge	Number of Spans 1 Steel Girder I-Beam Bridge Type Unknown End 1 Fixed End 2 Fixed Deck Type - Concrete Length 70 feet Width 30 feet Pier Type - Open SPC Rating - C Surface Type - Flexible Expansion Type - Other End 1 Substructure - Stub End 2 Substructure - Stub Foundation Type - Unknown
12.98	Bridge	Number of Spans 2 Type Unknown Concrete T-Beam End 1 Fixed Pier 1 Fixed End 2 Fixed Deck Type - Concrete Length 76 feet Width 30 feet Pier Type - Open SPC Rating - C Surface Type - Flexible Expansion Type - Other End 1 Substructure - Stub End 2 Substructure - Stub Foundation Type - Unknown

Milepoint	Feature	Data
12.95	Bridge	Number of Spans 4 Overpass Concrete T-Beam End 1 Fixed Pier 1 Fixed Pier 2 Fixed Pier 3 Fixed End 2 Fixed Deck Type - Concrete Length 204 feet Width 42 feet Pier Type - Open SPC Rating - C Surface Type - Flexible Expansion Type - Other End 1 Substructure - Full End 2 Substructure - Full Foundation Type - Unknown
12.98	Other	Junction US 60 Heading East Road Surface Type - Flexible
13.06	Bridge	Number of Spans 2 Type Unknown Concrete T-Beam End 1 Fixed Pier 1 Fixed End 2 Fixed Deck Type - Concrete Length 76 feet Width 30 feet Pier Type - Open SPC Rating - C Surface Type - Flexible Expansion Type - Other End 1 Substructure - Stub End 2 Substructure - Stub Foundation Type - Unknown
13.06	Bridge	Number of Spans 1 Steel Girder I-Beam Bridge Type Unknown End 1 Fixed End 2 Fixed Deck Type - Concrete Length 53 feet Width 30 feet Pier Type - Open SPC Rating - C Surface Type - Flexible Expansion Type - Other End 1 Substructure - Stub End 2 Substructure - Stub Foundation Type - Unknown

Milepoint	Feature	Data
13.06	Bridge	Number of Spans 2 Type Unknown Concrete T-Beam End 1 Fixed Pier 1 Fixed End 2 Fixed Deck Type - Concrete Length 76 feet Width 30 feet Pier Type - Open SPC Rating - C Surface Type - Flexible Expansion Type - Other End 1 Substructure - Stub End 2 Substructure - Stub Foundation Type - Unknown
13.45	Fill	Material Type - Soil Height 25 feet Side slope 2:1 Length 150 feet Crest 30 feet Type Fill - Other Road Surface Type - Flexible
13.45	Power Line	Electrical Power Line 6 Lines Height 40 feet Steel Support Structure Unknown Volts Road Surface Type - Flexible
13.65	Power Line	Electrical Power Line 3 Lines Height 45 feet Wood Support Structure Unknown Volts Road Surface Type - Flexible
13.85	Fill	Material Type - Soil Height 20 feet Side slope 2:1 Length 200 feet Crest 30 feet Type Fill - Other Road Surface Type - Flexible
14.10	Other	US 62 East and US 62 West Converge Road Surface Type - Flexible

Milepoint	Feature	Data
1.01	Other	East and Westbound Bridges over Interstate 24 Road Surface Type - Flexible
1.01	Bridge	Number of Spans 2 Steel Girder I-Beam Bridge Type - Overpass End 1 Neoprene Pier 1 Neoprene End 2 Neoprene Deck Type - Concrete Length 233 feet Width 39 feet Pier Type - Open SPC Rating - C Surface Type - Composite Expansion Type - Sliding Plate End 1 Substructure - Full End 2 Substructure - Full Foundation Type - Unknown
1.35	Other	Junction KY 284 Road Surface Type - Flexible
1.40	Power Line	Electrical Power Line 3 Lines Height 60 feet Steel Support Structure Unknown Volts Road Surface Type - Composite
1.70	Trees	Number of Trees 1 Height 50 feet Diameter 18 in. Ending Milepoint 1.70 Distance From Road 20 feet Road Surface Type - Flexible
2.20	Trees	Number of Trees 1 Height 50 feet Diameter 18 in. Ending Milepoint 2.20 Distance From Road 20 feet Road Surface Type - Flexible
2.20	Other	Junction KY 787 Road Surface Type - Flexible
2.70	Other	McCracken Co - Marshall Co Boundary Road Surface Type - Flexible

