

Publication Year	2020
Acceptance in OA@INAF	2023-02-15T14:59:52Z
Title	DPU_ASW Configuration Control Issues
Authors	MEDINACELI VILLEGAS, Eduardo; BALESTRA, Andrea; FARINELLI, Ruben
Handle	http://hdl.handle.net/20.500.12386/33485



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 1/188

TITLE:	DPU ASW Configuration Control - Issues		
Date:	25/03/2020 Issue: 2.0		
Reference:	EUCL-OPD-CS-7-001		
Custodian:	Eduardo Medinaceli		

Contributors:	Function:	Date:	Signature:
Andrea Balestra	DPU-ASW Developer		
Eduardo Medinaceli	DPU-ASW Manager / Developer		
Ruben Farinelli	DPU-ASW Developer		
Approved by:	Function:	Date:	Signature:
L. Valenziano	Local NISP PM		
F. Sortino	Local NISP PC		
Authorized by:	Function:	Date:	Signature:
L. Valenziano	Local NISP PM		



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 2/188

Change Log

Issue	Date	Page	Description Of Change
1.0	07/01/2019	all	First issue
1.0	29/02/2019		Added ASW Version v.1.2.1
1.0	26/03/2019		Added ASW Version v.1.2.2
2.0	25/03/2020		Added ASW version v1.2.3 ASW version v1.2.4 ASW version v1.2.4.1 ASW version v1.2.5 ASW version v1.2.5.1 ASW version v1.3 ASW version v1.3.1 ASW version v1.3.2 ASW version v1.3.3 ASW version v1.3.3 ASW version v1.3.4 ASW version v1.3.5
2.0	28/04/2020	Reference Documents	Added RD8



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 3/188

Table of Contents

1.	Documents	8
	Applicable documents	8
	Reference documents	8
2.	Acronyms	8
3.	Configuration Control	8
4.	Affect version DPU_ASW_v0.0, fixed version DPU_ASW_v1.0 change log:	9
	[EUNIDPUASW-72] ICU counter test	9
	[EUNIDPUASW-79] serial access to DCU and SCE	10
	[EUNIDPUASW-78] DCUTHSET hardware test	10
	[EUNIDPUASW-77] retrieve DCU telemetry when LCL 28V is trigger	11
	[EUNIDPUASW-74] transition to SAFE STATE macro	12
	[EUNIDPUASW-71] telemetry tables initialization at ASW start-up	12
	[EUNIDPUASW-69] command ID written in command verification telemetry	13
	[EUNIDPUASW-51] prototypes changed for all exposure types	15
5.	Affect version DPU_ASW_v1.0, fixed version DPU_ASW_v1.1 change log:	16
	[EUNIDPUASW-25] configuration tables at SA = 18	16
	[EUNIDPUASW-57] new error handling strategy	19
	[EUNIDPUASW-33] counter reset	21
	[EUNIDPUASW-80] memory leak in scientific telemetry	22
	[EUNIDPUASW-76] wrong flag for the SpW link in telemetry	23
	[EUNIDPUASW-75] memory load/dump	24
	[EUNIDPUASW-73] raw lines to be send in scientific telemetry	25
	[EUNIDPUASW-70] acceptance status updated	26
	[EUNIDPUASW-46] KTC_exp	27
	[EUNIDPUASW-56] bugfixing sizechi2 = 0 for RAW and LINEAR_CALIB modes and in Fawler	30
	[EUNIDPUASW-55] upgrades to processing algorithm: new quality factor implemented, defensive programming	31
	[EUNIDPUASW-53] CPUMBE in DPU Initialization	33
	[EUNIDPUASW-52] added reset of the transmission flag when end of exposure watch-dog is trigger	.35
	[EUNIDPUASW-50] changed SetChi2Mode switch (insSubMode)	36



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 4/188

[EUNIDPUASW-49] changed types in tag_ins_mode and tag_ins_sub_mode33
[EUNIDPUASW-48] serialization of DCU-SCE access, in TurnOffFocalPlane function38
[EUNIDPUASW-47] CPU_RST command removed39
[EUNIDPUASW-45] limitation of raw mode (engineering mode), enhanced to groups number > 1339
[EUNIDPUASW-44] uniform codes of command verification for commanding tables40
[EUNIDPUASW-43] scientific data-pack digital telemetry
[EUNIDPUASW-36] DBB FPGA Temperature FDIR
[EUNIDPUASW-42] sizechi2 in processing
[EUNIDPUASW-41] retrieve HSK of DCU when DCU LCL 28V (SCE thresholds) has been triggered44
[EUNIDPUASW-40] CPUMBE45
[EUNIDPUASW-39] enable sync on DRB slave
[EUNIDPUASW-38] power on cycle
[EUNIDPUASW-37] added FDIR to DCU 5V
[EUNIDPUASW-35] DRB_SHSK49
[EUNIDPUASW-34] transmission flag
[EUNIDPUASW-32] clear of DRB multiple EDAC error
[EUNIDPUASW-31] CPUDABT command
[EUNIDPUASW-30] DCU_RST53
[EUNIDPUASW-29] acceptancy status for SCE_SOFTBOOT53
[EUNIDPUASW-28] default for GTAB54
[EUNIDPUASW-26] acceptancy status DCU_THSET55
[EUNIDPUASW-27] acceptancy status SCE_BOOT55
[EUNIDPUASW-24] handshake test with ICU
[EUNIDPUASW-23] asynchronous GTAB
[EUNIDPUASW-22] chi2size
[EUNIDPUASW-21] acceptancy parameter limits command SCEFMODE60
[EUNIDPUASW-17] serialization of DCU-SCE access
[EUNIDPUASW-20] telemetry DPU_STATUS_TAB scrubFlag62
[EUNIDPUASW-19] consistency check processing algorithm
[FUNIDPUASW-18] change of status after CPUDART 63



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 5/188

	[EUNIDPUASW-16] code semantics	64
	[EUNIDPUASW-15] DCU_SHSK function for ANALOG telemetry	65
6.	Affect version DPU_ASW_v1.1, fixed version DPU_ASW_v1.2 change log:	66
	[EUNIDPUASW-61] enhanced functionality of the DEATH REPORT	66
	[EUNIDPUASW-62] static analysis issues	68
	[EUNIDPUASW-60] included exposure using a single detector with complete focal plane	70
	[EUNIDPUASW-59] set scientific telemetry chi2 threshold	71
	[EUNIDPUASW-58] expo counter	72
	[EUNIDPUASW-54] History parameter in scientific telemetry	73
7.	Affect version DPU_ASW_v1.2, fixed version DPU_ASW_v1.2.1 change log	75
	[EUNIDPUASW-81] Error Handling failure for fast repeating errors of the same priority	75
8.	Affect version DPU_ASW_v1.2.1, fixed version DPU_ASW_v1.2.2 change log	78
	[EUNIDPUASW-82] added error signaling for "Error DBB interrupt lost on spw device" SPV_EDBBINTLOST	78
	[EUNIDPUASW-93] gain factor in processing	80
	[EUNIDPUASW-92] Death Report time tag	81
	[EUNIDPUASW-91] CPU DBAT Dither Abort Command	82
	[EUNIDPUASW-90] DITHER_FLAG OFF when WD_EXP expires	88
	[EUNIDPUASW-89] HskScan added defensive programming	89
	[EUNIDPUASW-88] CPU Load task spawn	90
	[EUNIDPUASW-87] acceptance status for SCE_BOOT	91
	[EUNIDPUASW-86] CPU watchdog	92
	[EUNIDPUASW-85] default value for PROC_PARAM_TAB parameter "detector to be send"	93
	[EUNIDPUASW-84] wrong error codes	94
	[EUNIDPUASW-83] GTAB used to works only for first detector	95
9.	Affect version DPU_ASW_v1.2.2 fixed version DPU_ASW_v1.2.3 change log	96
	[EUNIDPUASW-94] limits of parameter in acceptancy of command SCE_CONFIG	96
	[EUNIDPUASW-95] RAW mode, data size greater than 127 Mb	98
	[EUNIDPUASW-96] 1553 interface change DRB_SHSK	102
	[EUNIDPUASW-97] change of format MONITOR_TAB	104
	[EUNIDPUASW-99] NISP-FDIR	106



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 6/188

	[EUNIDPUASW-100] SYS CONFIG elapsed time 1553 initialization	115
	[EUNIDPUASW-104] Error Handling Strategy: Death Report errors at initialization phase	
	[EUNIDPUASW-105] Error Handling Strategy: new level of criticality	
	[EUNIDPUASW-106] Optimization tables for 16 DCUs	120
	[EUNIDPUASW-107] Initialization error injection at DPU_START	123
	[EUNIDPUASW-108] Processing m chi2 rounding	127
	[EUNIDPUASW-101] CPU_WDG added limits for parameter: cpu scrubbing period, command acceptance. Changed DPU_STATUS_TAB format	131
	[EUNIDPUASW-102] added error in Death Report at ASW initialization performing CPU_MBE	133
	[EUNIDPUASW-103] added GainFactor and ReadOutNoise in digital telemetry	135
	[EUNIDPUASW-109] Toogle_ASW_STATUS_CPU_PARKED instead of Set in both WD	136
	[EUNIDPUASW-110] NISP-FDIR-217	137
	[EUNIDPUASW-111] change of status after DCUDABT	138
	[EUNIDPUASW-112] DCU Error Flag in digital telemetry	139
10	O. Affect version DPU_ASW_v1.2.3 fixed version DPU_ASW_v1.2.4 change log	141
	[EUNIDPUASW-113] ResetDcuAndDbb producing a change of status	141
	[EUNIDPUASW-115] acceptance status for CPU_SST	143
	[EUNIDPUASW-118] DCUDABT removed change of status	144
1:	1. Affect version DPU_ASW_v1.2.4 fixed version DPU_ASW_v1.2.4.1 change log	146
	[EUNIDPUASW-120] new SCE/SCA configuration for room temperature operations	146
	[EUNIDPUASW-116] multiple RT actions	148
	[EUNIDPUASW-119] Synchronization mechanism modified	150
	[EUNIDPUASW-117] added global variables for fixed time delays	153
12	2. Affect version DPU_ASW_v1.2.4.1 fixed version DPU_ASW_v1.2.5 change log	155
	[EUNIDPUASW-114] strategy for NISP-FDIR of EoE_WD and EoD_WD	155
	[EUNIDPUASW-121] dump of SCE microcode in CPU_MDMUP	157
13	3. Affect version DPU_ASW_v1.2.5 fixed version DPU_ASW_v1.2.5.1 change log	158
	[EUNIDPUASW-122] History telemetry (scientific file)	158
	[EUNIDPUASW-124] DARK modes	161
	[EUNIDPUASW-125] silent action of failure of ICU_CMD_COUNTER check	163
	[EUNIDPUASW-127] enqueue for simulated DCU exposure	165



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 7/188

[E	EUNIDPUASW-123] acceptance range for device ID for CPU_DUMP	166
[E	EUNIDPUASW-126] added error code for DBB buffer selection	167
14.	Affect version DPU_ASW_v1.2.5.1 fixed version DPU_ASW_v1.3 change log	168
[E	EUNIDPUASW-129] Personality files for Focal Plane	168
[E	EUNIDPUASW-128] fake error injection	169
[E	EUNIDPUASW-131] added initialization error	170
[E	EUNIDPUASW-130] removed TBD, and Dead code	172
15.	Affect version DPU_ASW_v1.3 fixed version DPU_ASW_v1.3.1 change log	173
[E	EUNIDPUASW-134] DCU simulated exposure	173
[E	EUNIDPUASW-132] acceptance parameters	175
[E	EUNIDPUASW-133] added semaphores to change of status in ResetDcuAndDbb function	177
16.	Affect version DPU_ASW_v1.3.1 fixed version DPU_ASW_v1.3.2 change log	178
[E	EUNIDPUASW-136] changed maximum value in the allowance range for parameter	178
17.	Affect version DPU_ASW_v1.3.2 fixed version DPU_ASW_v1.3.3 change log	179
[E	EUNIDPUASW-137] corrected upper limit of expoconfing and droplines2	179
[E	EUNIDPUASW-138] rollback DCU exposure simulated	180
18.	Affect version DPU_ASW_v1.3.3 fixed version DPU_ASW_v1.3.4 change log	
[E	EUNIDPUASW-142] false positive error injection	181
[E	EUNIDPUASW-143] New Baseline optimization results loaded by default	183
[E	EUNIDPUASW-140] Static Tests input	184
[E	EUNIDPUASW-139] disclaimer added CFITSIO code	186
[E	EUNIDPUASW-141] Static test - CLANG format	187
19.	Affect version DPU_ASW_v1.3.4 fixed version DPU_ASW_v1.3.5 (Flight) change log	188
ſΕ	EUNIDPUASW-144] default value for PROC_PARAM_TAB parameter "broadcast device"	188



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 8/188

1. Documents

Applicable documents

AD	Title / Author	Document Reference	Issue	Date
0	EUCLID EID-A	SRE-PA/2010-026	2.0	20/04/2011
1	NI Warm Electronics to Focal Plane ICD	EUCL-OPD-ICD-7-001	4.8	06/04/2018
2	Euclid SIDECAR ASIC Firmware - ICD	MARKURY SCIENTIFIC	3.1	09/03/2017
3	Teledyne: SCS ICD	EUCL-TIS-TN-7007	3.1	12/02/016
4	NI-DPU ASW Interface Control Document	EUCL-OPD-ICD-7-003	3.1	04/05/2020
5	DPU ASW User Manual	EUCL-OPD-MA-7-001	2.0	04/05/2020

Reference documents

RD	Title / Author	Document Reference	Issue	Date
0	NISP Acronyms List	EUCL-IAP-LI-1-001	2.0	04/05/2013
1	Teledyne: SIDECAR ASIC Technical Manual	MAN-0013	1.0	20/07/2009
2	Teledyne: SIDECAR ASIC-kit start-up Manual	MAN-0007	1	31/03/2009
3	Teledyne: HAWAII-H2RG Technical Manual	MAN-0001	3	25/09/2007
4	Teledyne: Teledyne Feedback on Euclid NISP SCS Procurement Specifications			7/06/2011
5	Maxwell: SCS750 flight module	Doc. # 1004741	7.0	
6	Teledyne: SIDECAR ASIC Technical Manual	MAN-0003	3	31/03/2009
7	Data Processing Definition and Justification File	EUCL-OPD-RP-7-003	2.3	06/04/2018
8	SW Product Assurance Management Report	EUCL-OPD-RP-7-15	2.0	28/04/2020

2. Acronyms

See RD 0

3. Configuration Control

This document is a printed version of the configuration control (CC) of the DPU_ASW. For CC the Jira tool was used, with a repository provided by INFN. The tool provides a web interface at the following link: https://issues.infn.it/jira/browse/EUNIDPUASW/?selectedTab=com.atlassian.jira.jira-projects-plugin:summary-panel, to access INFN credential are need. The webpage as well as this document are organized by sections, corresponding to each release of the DPU_ASW versions. Starting in section 4 are listed the differences with respect to the previous release. The first release under CC is DPU-ASW version v0.0 (delta-CDR).



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 9/188

For each CC entry, an identification code is automatically generated, and a title is assigned e.g. [EUNIDPUASW-72] ICU counter test. Here the entry title (listed in the table of contents) is a hyperlink to the webpage of the corresponding entry in at Jira on-line documentation. Each entry is classified according to its type: New Feature or Bug, and a priority is assigned: Trivial, Minor or Major. The status is specified in the field Resolution: all Done. In the on-line version of the documentation, entries can be sort according any of these criteria; and ancillary attached files quoted in the entries can be downloaded from the on-line version of the document (here are included only plots and pictures).

DPU-ASW versioning is fully documented in RD-8.

4. Affect version DPU ASW v0.0, fixed version DPU ASW v1.0 change log:

[EUNIDPUASW-72] ICU counter test Created: 17/Dec/18 Updated: 29/Dec/18 Resolved: 17/Dec/18	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>1553</u>
Affects Version/s:	DPU ASW v0.0
Fix Version/s:	DPU ASW v1.0

Туре:	New Feature	Priority:	Trivial
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

in case of failure it is not communicated as error, neither executed

Comments

Comment by Eduardo Medinaceli Villegas [29/Dec/18]

```
uint16_t checklCUcounter(uint16_t icu_counter) /* use this, used in 1553 interface */
{
    uint16_t result;
    if (lastlCUcounter_Global != icu_counter)
{ lastlCUcounter_Global = icu_counter; result = res_ok; }
    else
{/* no "error" reported */ rejCMDCounter_Global++; result = res_notok; }
```



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 10/188

return result;		
}		

-	[EUNIDPUASW-79] serial access to DCU and SCE Created: 17/Dec/18 Updated: 17/Dec/18 Resolved: 17/Dec/18	
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	Commands, System	
Affects Version/s:	DPU_ASW_v0.0	
Fix Version/s:	DPU ASW v1.0	

Туре:	New Feature	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

usage of a single semaphore for DCUs and SCEs

Comments

Comment by Eduardo Medinaceli Villegas [17/Dec/18]

using for both type of devices: SEM_ID semLockDcu;

[EUNIDPUASW-78] DCUTHSET hardware test Created: 17/Dec/18 Updated: 17/Dec/18 Resolved: 17/Dec/18	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>Commands</u>



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 11/188

Affects Version/s:	DPU ASW v0.0
Fix Version/s:	DPU_ASW_v1.0

Туре:	Bug	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

in DCUTHSET wrong hardware test (TestHardwareAvailable) changed with TestDCUAvailable

•	[EUNIDPUASW-77] retrieve DCU telemetry when LCL 28V is trigger Created: 17/Dec/18 Updated: 17/Dec/18 Resolved: 17/Dec/18	
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	<u>System</u>	
Affects Version/s:	DPU ASW v0.0	
Fix Version/s:	DPU_ASW_v1.0	

Туре:	New Feature	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 12/188

Description

in order to get all the necessary info, the complete DCU telemetry has to be collected during these cycle, even if SCE all DCU will be turned off

	[EUNIDPUASW-74] transition to SAFE STATE macro Created: 17/Dec/18 Updated: 17/Dec/18 Resolved: 17/Dec/18	
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	<u>System</u>	
Affects Version/s:	DPU_ASW_v0.0	
Fix Version/s:	DPU ASW v1.0	

Туре:	New Feature	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

added a task delay of 0.5s among commands CPUDABT e TurnOffFocalPlane required by DPU-EM unit

[EUNIDPUASW-71] telemetry tables initialization at ASW start-up Created: 17/Dec/18 Updated: 17/Dec/18 Resolved: 17/Dec/18	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>1553</u>
Affects Version/s:	DPU ASW v0.0
Fix Version/s:	DPU ASW v1.0



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 13/188

Туре:	New Feature	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

added function void InitTelemetry1553Buff(void) called by DPU_1553 function ASW1553.c::ASW1553(void) at MILBUS initialization

-	[EUNIDPUASW-69] command ID written in command verification telemetry Created: 17/Dec/18 Updated: 17/Dec/18 Resolved: 17/Dec/18	
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	Commands, telemetry	
Affects Version/s:	DPU ASW v0.0	
Fix Version/s:	DPU_ASW_v1.0	

Туре:	Bug	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

using cmd.ID only, was complete word (cmd.ID + device)

Comments

The presented document is Proprietary information of the Euclid Consortium.



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 14/188

Comment by Eduardo Medinaceli Villegas [17/Dec/18]

using recv_data[SubAddr][0]>>8 in function calls: SendCMDVerTab2(ICU_REQUEST_COUNTER_Global, error, ver, recv_data[SubAddr][0]>>8, obt1, obt2, obt3);



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 15/188

-	[EUNIDPUASW-51] prototypes changed for all exposure types Created: 07/Dec/18 Updated: 17/Dec/18 Resolved: 07/Dec/18	
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	Commands	
Affects Version/s:	DPU ASW v0.0	
Fix Version/s:	DPU_ASW_v1.0	

Туре:	New Feature	Priority:	Trivial
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	0 minutes		
Time Spent:	Not Specified		
Original Estimate:	1 hour		

Description

SCE_exp, SCE_KTCEXP and SCE_IPCEXP function prototypes changed with SCEEXP, SCEKtcExp and SCEIPCExp



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 16/188

5. Affect version DPU ASW v1.0, fixed version DPU ASW v1.1 change log:

•	[EUNIDPUASW-25] configuration tables at SA = 18 Created: 09/Nov/18 Updated: 03/Jan/19 Resolved: 09/Nov/18	
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	1553, Commands	
Affects Version/s:	DPU ASW v1.0	
Fix Version/s:	DPU_ASW_v1.1	

Туре:	New Feature	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	0 minutes		
Time Spent:	Not Specified		
Original Estimate:	1 day		

Description

configuration tables behaves as commands, therefore arrives to SA = 18 and the same test on the ICU_COUNTER is performed

Comments

Comment by Eduardo Medinaceli Villegas [28/Dec/18]

In file ASW1553.c the following initialization of SA 19, 20, and 21 where removed. Leaved only for SA=18 $^{\prime}$ commands SA=18 * /

if ((ms1553_rt_tr_data(RT_RX, sa_cmd, 0, (uword *)NULL, &gstatrx, FALSE, 0)) != RT_NO_ERROR)
{ ERRORLOG(BUS1553_EENRXSADCMD); }

Comment by Eduardo Medinaceli Villegas [28/Dec/18]

legalization of SA 19, 20, and 21 were also removed, leaving only the one for SA=18 /* legalize commands */

if ((ms1553_getSALegal(BUS_BRC_RCV, &ill_mask1)) != RT_NO_ERROR)

{ ERRORLOG(BUS1553_ELEGSACOMMD); }



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 17/188

```
ill_mask1 &= ^(1 << sa\_cmd);
if ((ms1553 setSALegal(BUS BRC RCV, ill mask1)) != RT NO ERROR)
{ ERRORLOG(BUS1553 ELEGSACOMMD); }
Comment by Eduardo Medinaceli Villegas [ 28/Dec/18 ]
In Command_Handler.c added
else if(devType > CMDID SCE && devType <= CMDID CONF) /* CONFIG TABLES */
{ /* each table has his own semaphore */ CONF_TABS_Handler(msgBuf.pars[0], devType); }
a handler for configuration tables
Comment by Eduardo Medinaceli Villegas [ 28/Dec/18 ]
configuration tables handler:
int16_t CONF_TABS_Handler(uint32_t SubAddr, uint16_t cmd ID)
STATUS res;
uint16_t ver;
uint16_t error;
uint16 t obt1;
uint16 t obt2;
uint16_t obt3;
obt1 = 0U;
obt2 = 0U;
obt3 = 0U;
switch (cmd ID)
case 150: /* DITHER_TAB */
dpu_MonitorTabGlobal.CMDBUSYFLAG = 1U;
getDITHER();
break;
case 151: /* SYS CONFIG TAB */
dpu_MonitorTabGlobal.CMDBUSYFLAG = 1U;
getSYSCONFIG();
break;
case 152: /* PROC_PARAM_TAB */
dpu MonitorTabGlobal.CMDBUSYFLAG = 1U;
getPROCPARAM();
break;
default:
res = TimeTagLOBT(&obt1, &obt2, &obt3);
if (res != OK)
{ ERRORLOG(errno); ERRORLOG(OBTASW EACC); ASWFullErrorLog(errno, IDtask2EntryID(taskIdSelf()),
taskIdSelf(), ASW FUNC TimeTagLOBT, ASW ETIMEHAND, crit low); }
rejCMDCounter Global++;
error = param_flag;
ver = res_notok;
SendCMDVerTab2(ICU REQUEST COUNTER Global, error, ver,
recv data[SubAddr][0]>>8, obt1, obt2, obt3);
break;
```



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 18/188

```
dpu MonitorTabGlobal.CMDBUSYFLAG = 0U;
return 0;
Comment by Eduardo Medinaceli Villegas [03/Jan/19]
In file MChandler.c: incoming directives are retrieved only for SA sa cmd =18
Old implementation:
else if (currentMCdataword_Global == frame_id[RTid_Global - 1][MC_GETCMD_TABS])
ms1553 getDataTrans(&recv data[sa cmd][0], LENGTHCMD, sa cmd, &recv wrd);
ms1553_getDataTrans(&recv_data[sa_prc][0], LENGTHDITH, sa_prc, &recv_wrd);
ms1553_getDataTrans(&recv_data[sa_sys][0], LENGTHDITH, sa_sys, &recv_wrd);
ms1553 getDataTrans(&recv data[sa dit][0], LENGTHDITH, sa dit, &recv wrd);
New implementation:
else if (currentMCdataword_Global == frame_id[RTid_Global - 1][MC_GETCMD_TABS])
 ms1553 getDataTrans(&recv data[sa cmd][0], LENGTHCMD, sa cmd, &recv wrd);
}
Comment by Eduardo Medinaceli Villegas [03/Jan/19]
Then, only function getCommand is called, functions getDITHER, getPROCPARAM and getSYSCONFIG were
removed:
else if (currentMCdataword_Global == frame_id[RTid_Global - 1][MC_GETTABS1])
 getCommand(recv_data[sa_cmd][1]);
```




Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 19/188

[EUNIDPUASW	[EUNIDPUASW-57] new error handling strategy Created: 11/Dec/18 Updated: 03/Jan/19	
Status:	In Progress	
Project:	Application software for the Euclid NISP DPU	
Component/s:	<u>System</u>	
Affects Version/s:	DPU ASW v1.0	
Fix Version/s:	DPU ASW v1.1	

Туре:	New Feature	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Unresolved	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

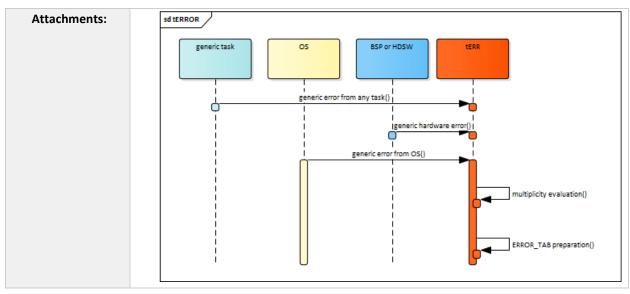

The presented document is Proprietary information of the Euclid Consortium.

This document shall be used and disclosed by the receiving Party and its related entities (e.g. contractors and subcontractors) only for the purposes of fulfilling the receiving Party's responsibilities under the Euclid Project and that the identified and marked technical data shall not be disclosed or retransferred to any other entity without prior written permission of the document preparer.



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 20/188

Description

Old error strategy was improved taken into account several new features of the error handling. All the new features are described in document EUCL-OPD-TN-7-010 DPU ASW error handling strategy

Comments

Comment by Eduardo Medinaceli Villegas [11/Dec/18]

A new package was included (replacing the old one):

task_ret_t ASWErrorHandlingTask(void)

a series of internal function were added to handle the error the new logic:

static void SetLocalError(uint16_t sub, uint32_t errnotag, uint32_t aswerr, uint16_t cmdid, uint16_t critic, uint16_t task);

static void InitErrorQueues(void);

static void FillErrorTLMTable(complessive error t errorarray, uint16 t errors1553);

static void EraseError(uint16_t critic, uint16_t errorentry);

global functions were also added to be used at error signaling in the ASW:

void ASWErrnoLog(int32_t err, uint16_t dev, int32_t IDtask); /* low level error */

void ASWErrorCmdLog(char_t task_name, uint16_t cmd, int32_t errasw, uint16_t crit); / task catching
exception */

void ASWFullErrorLog(int32_t err, uint16_t dev, int32_t IDtask, uint16_t cmd, int32_t errasw, uint16_t crit);
/* for tCMD */

void InitErrorTab(void);

uint16_t IDtask2EntryID(int32_t IDtask);

Comment by Eduardo Medinaceli Villegas [11/Dec/18]

a change in the interface was implemented, the new error table has the following structure struct ERROR_TAB

{ uint16_t ID; uint16_t ASW_Counter; uint16_t error_counter; uint16_t obt1; uint16_t obt2; uint16_t obt3; uint16_t error_tag; /* driver or vxworks error code */ uint16_t subsystem; /* hardware devID (sce/dcu/dpu) or taskID */ uint16_t cmdID; /* command ID or software functionID */ uint16_t asw_err; /* generic aswerror */ criticity t criticity; uint16_t multiplicity; }

which is translated in a 1553 table: ERROR_TAB

Comment by Eduardo Medinaceli Villegas [03/Jan/19]

for all tasks the taskSpawn procedure was done using DEFINES for the task name, and the task ID was saved in the global array task_id considering typedef enum task_seq

for example:

OLD:

tid_MC_Global = taskSpawn("tMC", TASK_INT_PRIORITY, VX_FP_TASK, 5000,

(FUNCPTR)MChandler, 0, 0, 0, 0, 0, 0, 0, 0, 0, 0);

NEW:

tid MC Global = taskSpawn(TASKMC, TASK INT PRIORITY, VX FP TASK, 5000,

(FUNCPTR)MChandler, 0, 0, 0, 0, 0, 0, 0, 0, 0, 0);

if taskSpawn is successfully executed then:

task id[TASK MC] = tid MC Global;

enum task_seq

The presented document is Proprietary information of the Euclid Consortium.



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 21/188

{ TASK_ISRH = 0, TASK_SLCT = 1, TASK_MC = 2, TASK_CMD = 3, TASK_WD = 4, TASK_ERR = 5, TASK_PROC = 6, TASK_SCAN = 7, TASK_CPUL = 8 }

[EUNIDPUASW	/-33] counter reset Created: 16/Nov/18 Updated: 29/Dec/18 Resolved: 19/Nov/18
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>1553</u>
Affects Version/s:	DPU_ASW_v1.0
Fix Version/s:	DPU ASW v1.1

Туре:	New Feature	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	0 minutes		
Time Spent:	Not Specified		
Original Estimate:	1 week		

Description

counter reset is not longer performed by a dedicated command. ICU requested to uniform this command with the one implemented by the BootSW.

To do this, CPU_RBT was removed and the counter reset is performed directly by the 1553 interface. Because the new cmdID is not coherent with the DPU-ASW convention for this parameter.

Comments

Comment by Eduardo Medinaceli Villegas [16/Nov/18]

A test on the new ID is performed by the 1553 without passing through the tCMD

A protection flag was added to disable the aplication of the reset each second, because there is no any kind of test for this directive.

```
if( recv_data[sa_cmd][0] == 903U ) /* using same reset command ID as boot software */
{
   if( reset_flag_Global == 0 )
{        ICU_REQUEST_COUNTER_Global = 0U;        lastICUcounter_Global = 0U;        ASW_Counter_Global = 0U;        reset_flag_Global = 1U;   }
}
```

Comment by Eduardo Medinaceli Villegas [16/Nov/18]

The presented document is Proprietary information of the Euclid Consortium.



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 22/188

The protection flag do not reduce the ICU need of counter reset in case of a double bootstrap. Because at the first reset all counters are reset, and at the second reset which is not applied in any case the ICU_COUNTER has already being clear. Therefore commanding can re start at any moment.

Comment by Eduardo Medinaceli Villegas [16/Nov/18]

The reset performs the ICU COUNTER and ASW COUNTER resets to zero

Comment by Eduardo Medinaceli Villegas [16/Nov/18]

CPU RST dead code was removed

[EUNIDPUASW-80] memory leak in scientific telemetry Created: 17/Dec/18 Updated: 17/Dec/18 Resolved: 17/Dec/18	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	Processing, telemetry
Affects Version/s:	DPU_ASW_v0.0
Fix Version/s:	DPU ASW v1.1

Туре:	Bug	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

fixed 32bit mem leak in scientific telemetry (finalDataPack.cmpErrors), found during Static Analysis/Unit tests

Comments

Comment by Eduardo Medinaceli Villegas [17/Dec/18]

memcopy jumping after DP_ERR_TAB_SIZE tmpError = 15(MAX GROUPS added) x 1024



Ref: EUCL-OPD-CS-7-001

Issue:

25/03/2020 Date: 23/188 Page:

[EUNIDPUASW-76] wrong flag for the SpW link in telemetry Created: 17/Dec/18 Updated: 17/Dec/18 Resolved: 17/Dec/18	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	telemetry
Affects Version/s:	DPU ASW v0.0
Fix Version/s:	DPU_ASW_v1.1

Туре:	Bug	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

when switched from nominal to redundant and vice versa

```
Comment by Eduardo Medinaceli Villegas [ 17/Dec/18 ]
if (DRBSPWSTATUS(drb_spw1, &dpu_StatusTabGlobal.DRBSPW1STAT) != OK)
 ERRORLOG(DRBASW_EACC);
if (DRBSPWSTATUS(drb_spw2, &dpu_StatusTabGlobal.DRBSPW2STAT) != OK)
```

The presented document is Proprietary information of the Euclid Consortium.



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 24/188

```
{
    ERRORLOG(DRBASW_EACC);
}
```

[EUNIDPUASW 17/Dec/18	/-75] memory load/dump Created: 17/Dec/18 Updated: 17/Dec/18 Resolved:
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	Commands, telemetry
Affects Version/s:	DPU ASW v0.0
Fix Version/s:	DPU ASW v1.1

Туре:	Bug	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

1553 buffer size array underestimated by one, changed in recv_data[32][32] only first sub-address was used in the DUMP of the configuration tables (DITHER_CONFIG, and PROC_PARAM)



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 25/188

-	[EUNIDPUASW-73] raw lines to be send in scientific telemetry Created: 17/Dec/18 Updated: 17/Dec/18 Resolved: 17/Dec/18	
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	Processing, telemetry	
Affects Version/s:	DPU ASW v0.0	
Fix Version/s:	DPU_ASW_v1.1	

Туре:	New Feature	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	<u>Carlotta Bonoli</u>
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

rawDataLinesSizeGroupMMU were hardcoded to 5; now is customized through configuration table

Comments

Comment by Eduardo Medinaceli Villegas [17/Dec/18]

added in DPU_Process function Process.c::void SetRawDataLinesSize(void)

/*

Compute data and raw lines size in bytes per group for current exposure (same for each detector) as delivered to the MMU: they depend

on the value given in the procParam table.

*/

rawDataLinesSizeGroupMMU = (uint32_t)DP_RAW_LINES_SIZE * (uint32_t)procParamTabLocal.Raw_Lines * (uint32_t)dithConfTabLocal.Exposures[nExp].Frames;

/* Compute data and raw lines in bytes for current exposure (same for each detector, see above) */
rawDataLinesSizeMMU = rawDataLinesSizeGroupMMU *
(uint32_t)dithConfTabLocal.Exposures[nExp].Groups;



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 26/188

	[EUNIDPUASW-70] acceptance status updated Created: 17/Dec/18 Updated: 17/Dec/18 Resolved: 17/Dec/18	
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	<u>Commands</u>	
Affects Version/s:	DPU ASW v0.0	
Fix Version/s:	DPU ASW v1.1	

Туре:	Bug	Priority:	Trivial
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

FDIR enable/disable through DRB_SHSK command, included ASW_STATUS_PARKED DCU_THSET, included ASW_STATUS_PARKED uniformed statuses for DCU/SCE_SHSK commands (ASW_STATUS_SCE_INIT | ASW_STATUS_MANUAL | ASW_STATUS_OBS_WAIT | ASW_STATUS_OBS_PROC

SCE_EEF_STATUS_IDLE SCE_EEF_STATUS_EXPOSING)

automatic set-up of internal status, added an exception for command CPUDABT when executed in MANUAL status $\,$

at ASW_STATUS_CPU_INIT bug inserted during Static Analysis (logic

and bit-wise and operator exchanged)

initial status of SCE after boot was SCE_EXP, corrected to SCE_IDLE



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 27/188

[EUNIDPUASW	[EUNIDPUASW-46] KTC_exp Created: 07/Dec/18 Updated: 11/Dec/18 Resolved: 11/Dec/18	
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	<u>Documentation</u>	
Affects Version/s:	DPU ASW v1.0	
Fix Version/s:	DPU ASW v1.1	

Type:	New Feature	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	0 minutes		
Time Spent:	Not Specified		
Original Estimate:	1 week		




Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 28/188

Attachments:

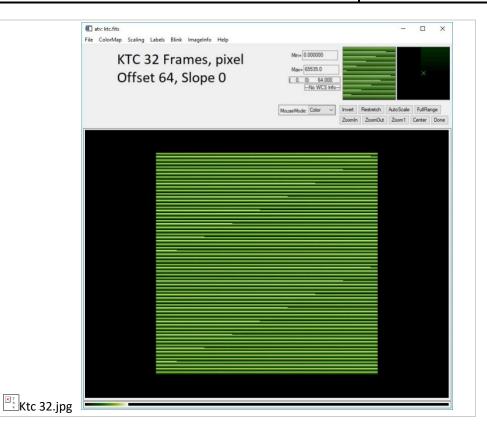

Description

added consistency tests in the command

Comments

Comment by Eduardo Medinaceli Villegas [07/Dec/18]

```
inside the KTC loops added checks on paramaters:

command register SCE_CMDREG; to check that the command was accepted
exposure status, register EXP_SCE_STATUS; to check if the exposure has finished
if both are OK, after a series of tests cknum, then continue with the next ktc-cycle (next exposure)
cknum = 64U; // Number of verifications for exposure termination, hardcoded
the time gap between exposures (ktc-cycles) is 100 ms
for (ii = 0; ii < cknum; ii++)
{
    taskDelay(sysClkRateGet() / 10); // Wait (200/10)*5 = 100 mSec
    ReadSCE(dcu_id, SCE_CMDREG, 1);
    temp_data1 = *aux_pnt; // Get current SCE CMDREG contents
    ReadSCE(dcu_id, EXP_SCE_STATUS, 1);
    temp_data2 = *aux_pnt;
    temp_data2 = temp_data2 & ST_MSK;
if ( (temp_data1 == 0) && (temp_data2 == 0) )
{
        break; // The current KTC exp is terminated go ahead with next ktc interaction }
```

The presented document is Proprietary information of the Euclid Consortium.

This document shall be used and disclosed by the receiving Party and its related entities (e.g. contractors and subcontractors) only for the purposes of fulfilling the receiving Party's responsibilities under the Euclid Project and that the identified and marked technical data shall not be disclosed or retransferred to any other entity without prior written permission of the document preparer.



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 29/188

the exposure is done with fixed parameters (as in the previous implementation) static const int32_t ktc_grp_const = 1; // For KTCEXP only one group per exposure is foreseen static const int32_t ktc_frm_const = 1; // For KTCEXP only one frame per exposure/group is foreseen static const int32_t ktc_drp2_const = 0x0; //For KTCEXP no drop2 are foreseen, if a single group (this case) is not useful

static const int32_t ktc_drp3_const = 0x0; // For KTCEXP no drop3 are foreseen

Comment by Eduardo Medinaceli Villegas [07/Dec/18]

changed in the documentation foreseen, and also in operations:

for the KTC_EXP caliration, in the DITHER_CONFIG_TAB the number of frames should be equal to the number of KTC-cycles. Otherwise there will be an error in the enqueue/dequeue phase because there the total number of raw lines (for each exposure=ktc-cycle) have to be considered



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 30/188

[EUNIDPUASW-56] bugfixing sizechi2 = 0 for RAW and LINEAR_CALIB modes and in Fawler Created: 11/Dec/18 Updated: 11/Dec/18 Resolved: 11/Dec/18	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	Processing, telemetry
Affects Version/s:	DPU ASW v1.0
Fix Version/s:	DPU ASW v1.1

Туре:	Bug	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	0 minutes		
Time Spent:	Not Specified		
Original Estimate:	1 week		

Description

in RAW and LINEAR CALIB modes the chi2 frame should not be included in the scientific data-pack

Comments

Comment by Eduardo Medinaceli Villegas [11/Dec/18]

added chi2size test in:

/* If required compress chi2 */

if (procParamTabLocal.Cmp_Flag == ASW_TRUE && (finalDataPack.uncHeader.cmpChi2Size != 0))

Comment by Eduardo Medinaceli Villegas [11/Dec/18]

/* Set engineering data size (if any) */

if (insMode == ENG RAW || insMode == CALIB LIN)

{ finalDataPack.uncHeader.engDataSize = dithConfTabLocal.Exposures[nExp].Groups * TSIZE_MAX * sizeof(uint16_t); }

Comment by Eduardo Medinaceli Villegas [11/Dec/18]

finalDataPack.uncHeader.cmpChi2Size = 0 in CALIB_LIN and fowler

if (dithConfTabLocal.Exposures[nExp].Groups <= 2) /* Fowler or pass through */

{ finalDataPack.uncHeader.cmpChi2Size = 0; /* No chi2 data to be sent */ }

Comment by Eduardo Medinaceli Villegas [11/Dec/18]

Fixed bug with CALIB_LIN mode: chi2 was not taken int account. Note that in CALIB_LIN mode no processing is done and no chi2 is computed



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 31/188

/* If required, compress processed data. Of course skip if processing not done as in linear calibration mode */ if (insMode == CALIB_LIN)

{ finalDataPack.uncHeader.cmpDataSize = 0; finalDataPack.uncHeader.cmpChi2Size = 0; }

-	/-55] upgrades to processing algorithm: new quality factor defensive programming Created: 11/Dec/18 Updated: 11/Dec/18 Resolved:
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	Processing
Affects Version/s:	DPU_ASW_v1.0
Fix Version/s:	DPU ASW v1.1

Туре:	New Feature	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	0 minutes		
Time Spent:	Not Specified		
Original Estimate:	1 week		

Description

The formula for the determination of the Quality Factor has been changed according to equation (19) of Kubik et al. 2016, but dropping the gain factor in the same equation

Comments

Comment by Eduardo Medinaceli Villegas [11/Dec/18]

added

chi2Temp = abs(chi2Temp)

Comment by Eduardo Medinaceli Villegas [11/Dec/18]

added:

if (alfa != -1.)

{ beta = sigma / (alfa + 1.0F); }

Comment by Eduardo Medinaceli Villegas [11/Dec/18]

The presented document is Proprietary information of the Euclid Consortium.

This document shall be used and disclosed by the receiving Party and its related entities (e.g. contractors and subcontractors) only for the purposes of fulfilling the receiving Party's responsibilities under the Euclid Project and that the identified and marked technical data shall not be disclosed or retransferred to any other entity without prior written permission of the document preparer.



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 32/188

```
slope of the ramp and QF evaluation updated
fact = 0.0F;
for (j = 0; j < nGroupsMin1; j++)
{ diff[j] = ramp[j + 1] - ramp[j]; /* Take advantage of the loop for chi2 computation */ fact += (diff[j] + beta) *
fact /= (float32 t)nGroupsMin1;
/* nGroupsMin1 cannot be 0 because we are in the if section where nGroups > 2 */
if (fact \geq 0.0F)
{ fact = (float32_t)sqrt((float64_t)fact) - beta; }
{ ERRORLOG(PRC_ESQPAR); }
/* compute the slope of the fit */
if (alfa != -1.) /* Defensive: to avoid dividing by zero */
{ slope = gamma * (float32 t) ( sqrt( 1.+ ((4.0F * (fact + beta) * (fact + beta)) / ((alfa + 1.) * (alfa + 1.))) ) -1. ) -
beta; }
else
{ ERRORLOG(PRC ESQPAR); }
/* Compute chi square */
if (alfa != -1.) /* Defensive: to avoid dividing by zero */
{ chi2Temp = ( 2.0F / (alfa + 1.0F) ) * ((float32_t)nGroupsMin1 * fact - (ramp[nGroupsMin1] - ramp[0])); }
```




Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 33/188

[EUNIDPUASW-53] CPUMBE in DPU Initialization Created: 07/Dec/18 Updated: 07/Dec/18 Resolved: 07/Dec/18		
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	<u>System</u>	
Affects Version/s:	DPU ASW v1.0	
Fix Version/s:	DPU_ASW_v1.1	

Туре:	New Feature	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	0 minutes		
Time Spent:	Not Specified		
Original Estimate:	1 week		

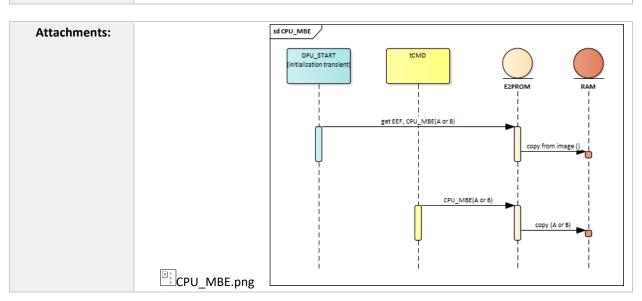

Description

The ASW when initialized, has a copy of the EEF in RAM. In order to have the exactly same copy written in E2PROM also in RAM, the CPU_MBE command is executed by the ASW in the DPU_Init phase.



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 34/188

Comments

Comment by Eduardo Medinaceli Villegas [07/Dec/18] added to Supervisor.c in DPU_Init() /* copy EEF from E2PROM (N or R) to RAM (to prevent misalignment), if fails keep RAM version */ res = CPUMBE(EEF_SEG_TYPEA); if (res != OK) ERRORLOG(CPUASW_ESEGTYPE); res = CPUMBE(EEF_SEG_TYPEB); if(res != OK) { ERRORLOG(CPUASW_ESEGTYPE); #ifdef ASW_DEBUG printf("CPUMBE: using EEF_boot_tab from RAM \n"); else { #ifdef ASW_DEBUG printf("CPUMBE: Copy EEF_boot_tab from EEF_SEG_TYPE = (CPUMBE) %d \n", EEF_SEG_TYPEB); #endif } } else { #ifdef ASW_DEBUG printf("CPUMBE: Copy EEF_boot_tab from EEF_SEG_TYPE = (CPUMBE) %d \n", EEF_SEG_TYPEA); #endif }



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 35/188

_	[EUNIDPUASW-52] added reset of the transmission flag when end of exposure watch-dog is trigger Created: 07/Dec/18 Updated: 07/Dec/18 Resolved: 07/Dec/18		
Status:	Done		
Project:	Application software for the Euclid NISP DPU		
Component/s:	<u>System</u>		
Affects Version/s:	DPU ASW v1.0		
Fix Version/s:	DPU ASW v1.1		

Туре:	New Feature	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

transmission flag was not reset when the WD_EOE was triggered

Comments

Comment by Eduardo Medinaceli Villegas [07/Dec/18]

/* Transmission bit set: finished transmission; in order to close the SpW file in the MMU with the received data */

dpu_MonitorTabGlobal.DPUTOMMU &= 0xFF00U;

added to WdExpHandler when is triggered



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 36/188

•	[EUNIDPUASW-50] changed SetChi2Mode switch (insSubMode) Created: 07/Dec/18 Updated: 07/Dec/18 Resolved: 07/Dec/18	
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	Processing	
Affects Version/s:	DPU ASW v1.0	
Fix Version/s:	DPU_ASW_v1.1	

Туре:	New Feature	Priority:	Trivial
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	0 minutes		
Time Spent:	Not Specified		
Original Estimate:	1 day		

Description

case MODE_VOID: chi2Mode = CHI2SPECTRO; chi2Size = TSIZE_MAX; (spectro)

Comments

```
comment by Eduardo Medinaceli Villegas [07/Dec/18]

static void

SetChi2Mode(void)
{

/* Set chi2 array according to exposure sub-type */
switch (insSubMode)
{

/* Spectro cases */ case MODE_VOID: case SPECTRO_GRISM_R_0: case SPECTRO_GRISM_R_270: case
SPECTRO_GRISM_R_180: case SPECTRO_GRISM_B_0: chi2Mode = CHI2SPECTRO; chi2Size = TSIZE_MAX;
break; /* Photo cases */ case PHOTO_FILTER_Y: case PHOTO_FILTER_J: case PHOTO_FILTER_H: chi2Mode =
CHI2PHOTO; chi2Size = TSIZE_MAX / 8U; break; }
}
```



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 37/188

[EUNIDPUASW-49] changed types in tag_ins_mode and tag_ins_sub_mode Created: 07/Dec/18 Updated: 07/Dec/18 Resolved: 07/Dec/18	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	Processing
Affects Version/s:	DPU ASW v1.0
Fix Version/s:	DPU_ASW_v1.1

Туре:	New Feature	Priority:	Trivial
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	0 minutes		
Time Spent:	Not Specified		
Original Estimate:	1 day		

Description

types changed, for the tag_ins_sub_mode to be coherent with nominal filter and grism naming convention

Comments

Comment by Eduardo Medinaceli Villegas [07/Dec/18]

typedef enum tag_ins_mode

{ SCIENCE = 0U, ENG_RAW, // engsize det2send no raw lines ENG_DEBUG, // engsize (threshold) all no raw lines COMP_VERIFICATION, // chi2 spectro // engsize det2send no raw lines NUM_SIM_SCE_PIX, // chi2 spectro no raw lines NUM_SIM_SCE_FRM, // chi2 spectro no raw lines CALIB_LIN, // no processing // engsize det2send no raw lines CALIB_IPC, // chi2 spectro no raw lines CALIB_KTC_BIAS, // chi2 spectro no raw lines DCU_SIMUL_IMAGE, // chi2 spectro no raw lines ENG_DARK_SPECTRO, ENG_DARK_PHOTO } ins mode t;

/* Instrument sub modes */

typedef enum tag ins sub mode

{ MODE_VOID = 0U, SPECTRO_GRISM_R_0, // science SPECTRO_GRISM_R_270, // science SPECTRO_GRISM_R_180, // science SPECTRO_GRISM_B_0, // science PHOTO_FILTER_Y, // science PHOTO_FILTER_J, // science PHOTO_FILTER_H // science }

ins_sub_mode_t;



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 38/188

[EUNIDPUASW-48] serialization of DCU-SCE access, in TurnOffFocalPlane function Created: 07/Dec/18 Updated: 07/Dec/18 Resolved: 07/Dec/18	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	Commands
Affects Version/s:	DPU ASW v1.0
Fix Version/s:	DPU_ASW_v1.1

Туре:	Bug	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	0 minutes		
Time Spent:	Not Specified		
Original Estimate:	1 day		

Description

TurnOffFocalPlane is a called by the transition to SAFE status; which, when commanded, is a CPU command that was not protected with the DCU-SCE semaphore.

The semaphore was included to guarranty the serial access

Comments

Comment by Eduardo Medinaceli Villegas [07/Dec/18]

semaphore semTake(semLockDcu, WAIT_FOREVER); added in the DCU power-off cycle



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 39/188

[EUNIDPUASW-47] CPU_RST command removed Created: 07/Dec/18 Updated: 07/Dec/18 Resolved: 07/Dec/18	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>Commands</u>
Affects Version/s:	DPU ASW v1.0
Fix Version/s:	DPU ASW v1.1

Туре:	Bug	Priority:	Trivial
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	0 minutes		
Time Spent:	Not Specified		
Original Estimate:	1 day		

Description

death code

-	[EUNIDPUASW-45] limitation of raw mode (engineering mode), enhanced to groups number > 13 Created: 07/Dec/18 Updated: 07/Dec/18 Resolved: 07/Dec/18	
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	Processing	
Affects Version/s:	DPU ASW v1.0	
Fix Version/s:	DPU ASW v1.1	

Туре:	New Feature	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 40/188

Remaining Estimate:	Not Specified
Time Spent:	Not Specified
Original Estimate:	Not Specified

Description

during Raw Mode acquisition, the data produced could be greather than 128 MByte (greather than 13 groups). Therefore transmission to MMU has to be done by steps

Comments

Comment by Eduardo Medinaceli Villegas [07/Dec/18]

changed function WriteDataRaw in Process package.

In the function, inside the groups loop, added the test

if(sumBytes > MAXDRBSPWSIZE) where MAXDRBSPWSIZE = 127MByte which is a conservative choice (<128MByte)

then a WriteToMMU and a memcpyDMA are performed the number of times needed.

Comment by Eduardo Medinaceli Villegas [07/Dec/18]

function WriteDataRaw is used in engineering modes RAW and CALIB_LIN Linear calibration CALIB_LIN mode is a raw mode without processing if (insMode == ENG_RAW || insMode == CALIB_LIN)

{ WriteDataRaw(data2Pack, dithConfTabLocal.Exposures[nExp].Groups); }

[EUNIDPUASW-44] uniform codes of command verification for commanding tables Created: 06/Dec/18 Updated: 06/Dec/18 Resolved: 06/Dec/18	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>1553</u>
Affects Version/s:	DPU_ASW_v1.0
Fix Version/s:	DPU ASW v1.1

Type:	Bug	Priority:	Trivial
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 41/188

Time Spent:	Not Specified
Original Estimate:	Not Specified

Description

uniform DITH, PROC and SYS_CONFIG with new id-codes in CDM_VER_TAB

Comments

Comment by Eduardo Medinaceli Villegas [06/Dec/18]

using recv_data[sa_cmd][0]>>8 in

 $SendCMDVerTab2 (ICU_REQUEST_COUNTER_Global, error, ver, recv_data[sa_cmd][0] >> 8, obt1, obt2, obt3);$

for: PROC_PARAM_TAB and SYS_CONFIG_TAB (DITH_CONFIG_TAB was OK)

[EUNIDPUASW-43] scientific data-pack digital telemetry Created: 06/Dec/18 Updated: 06/Dec/18 Resolved: 06/Dec/18		
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	Processing	
Affects Version/s:	DPU_ASW_v1.0	
Fix Version/s:	DPU ASW v1.1	

Туре:	Bug	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	<u>Carlotta Bonoli</u>
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	0 minutes		
Time Spent:	Not Specified		
Original Estimate:	1 week		

Description

number of raw lines (param 43)

deleted last synchr time (param 48 to 49)

deleted last synchr time (param 47 Delay Time before synchr. = 500 ms harcoded



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 42/188

position of raw lines (parameters 58 to 62): all were set to zero, corrected history parameter index (parameter 63)

Comments

Comment by Eduardo Medinaceli Villegas [06/Dec/18]

finalDataPack.uncHeader.telemetryDigital[47] = 500U;

finalDataPack.uncHeader.telemetryDigital[50] = dithConfTabGlobal.Exposures[nExp].Frames;

finalDataPack.uncHeader.telemetryDigital[58] = macc Global.raw row.raw row idx 1;

finalDataPack.uncHeader.telemetryDigital[59] = macc_Global.raw_row.raw_row_idx_2;

finalDataPack.uncHeader.telemetryDigital[60] = macc_Global.raw_row.raw_row_idx_3;

finalDataPack.uncHeader.telemetryDigital[61] = macc_Global.raw_row.raw_row_idx_4;

finalDataPack.uncHeader.telemetryDigital[62] = macc_Global.raw_row.raw_row_idx_5;

finalDataPack.uncHeader.telemetryDigital[63] = macc_Global.TLM_history_sel;

[EUNIDPUASW-36] DBB FPGA Temperature FDIR Created: 19/Nov/18 Updated: 05/Dec/18 Resolved: 05/Dec/18		
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	<u>System</u>	
Affects Version/s:	DPU ASW v1.0	
Fix Version/s:	DPU ASW v1.1	

Туре:	New Feature	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

added FDIR procedure for the DBB's FPGA temperature in DRB_hsk



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 43/188

Comments

```
Comment by Eduardo Medinaceli Villegas [ 19/Nov/18 ]

alrm = TempLimCheck(curTemp, dbbHTThTemp, dbbLTThTemp, limCnt, &dbbHTC, &dbbLTC);

if (alrm == ALARMTEMP) /* Signal DBB exceeded temperature */

{
    /* Signal temperature problem on DBB */

ERRORLOG(ALARM_DBBTEMP);

if(dbbFDIR_FPGATemp == ASW_TRUE)

{ Set_ASW_STATUS_CPU_PARKED(); /* to prevent generation of new data */ }

}

The FDIR if enable and triggered put the focal plane in PARKED

Comment by Eduardo Medinaceli Villegas [ 05/Dec/18 ]

tested at INFN using new threshold for DBB using SYS_CONFIG_TAB
```

[EUNIDPUASW-42] sizechi2 in processing Created: 05/Dec/18 Updated: 05/Dec/18 Resolved: 05/Dec/18		
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	<u>Processing</u>	
Affects Version/s:	DPU ASW v1.0	
Fix Version/s:	DPU_ASW_v1.1	

Туре:	Bug	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	0 minutes		
Time Spent:	Not Specified		
Original Estimate:	1 week		

Description

sizechi2 = 0 for Fowler or pass trhough, LINEAR_CALIB engineering size was not set, bug in DEBUG_MODE (loop on frames)



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 44/188

Comments

Comment by Eduardo Medinaceli Villegas [05/Dec/18]

Fawler and Passthrough

if (dithConfTabLocal.Exposures[nExp].Groups <= 2)

{ finalDataPack.uncHeader.cmpChi2Size = 0; // No chi2 data to be sent isFowler = ASW_TRUE; }

Comment by Eduardo Medinaceli Villegas [05/Dec/18]

LINEAR CALIB

if (insMode == CALIB_LIN)

{ finalDataPack.uncHeader.cmpDataSize = 0; // No processed data

finalDataPack.uncHeader.cmpChi2Size = 0; // set also chi2size to zero }

[EUNIDPUASW-41] retrieve HSK of DCU when DCU LCL 28V (SCE thresholds) has been triggered Created: 05/Dec/18 Updated: 05/Dec/18 Resolved: 05/Dec/18

00	80		
Status:	Done		
Project:	Application software for the Euclid NISP DPU		
Component/s:	<u>telemetry</u>		
Affects Version/s:	DPU ASW v1.0		
Fix Version/s:	DPU_ASW_v1.1		

Туре:	New Feature	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

```
In function DCU_hsk when FDIR 28V is active and triggered, all DCU registers are retrieved before performing the FDIR if ( dcuFDIR_28V & (0x0001 << dcu_id) ) /* POWER OFF DCU dcu_id */ { error dcu off = 1; }
```



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 45/188

```
if (error_dcu_off == 1)
{
    DCUPowerOff(dcu_id);
    SetDCUPowerOFF(dcu_id);
    SetSCEBootOFF(dcu_id);
}
...
}
```

[EUNIDPUASW-40] CPUMBE Created: 04/Dec/18 Updated: 04/Dec/18 Resolved: 04/Dec/18		
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	<u>System</u>	
Affects Version/s:	DPU ASW v1.0	
Fix Version/s:	DPU_ASW_v1.1	

Туре:	New Feature	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

CPUMBE read EEF recursively in E2PROM 1st and last pages and all segments. New prototype: CPUMBE(uint16_t firmwareIm)

Comments

Comment by Eduardo Medinaceli Villegas [04/Dec/18]

Changed to loop over first and last pages, by checking crc16, to look for segment type. Then loops over all the segments until finds the requested segment type, checking crc32. If it not found, uses the copy in RAM. pRomHeader = (EEPROM_HEADER_data *)HW_EEPROM_START; // first page if crc16 test fails, then



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 46/188

pRomHeader = (EEPROM_HEADER_data *) TC_EEPROM_BACKUP_TABLE_ADDR; // backup page then inside a loop of all segments j, seg_type = pRomHeader->segmentInfo[j].segmentType; // get segment type if crc32 test is ok, copy to RAM p = (uint16_t *)EEF_tab; // Get pointer to short p[i] = pSourceAddr[i];

[EUNIDPUASW-39] enable sync on DRB slave Created: 19/Nov/18 Updated: 19/Nov/18		
Status:	In Progress	
Project:	Application software for the Euclid NISP DPU	
Component/s:	<u>System</u>	
Affects Version/s:	DPU ASW v1.0	
Fix Version/s:	DPU ASW v1.1	

Туре:	New Feature	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Unresolved	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

DRB sync ioctl missing in Slave. This action was not documented on OHB driver documentation. And was added before after OHB suggestion

Comments

Comment by Eduardo Medinaceli Villegas [19/Nov/18]

DONE at DPU_Start::Supervisor at initialization phase of the ASW added:



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 47/188

/* enable sync in DRBs */
res = ioctl(drb_sync, IOC_DRB_ENABLE_SYNCH, 0);
in DPU_Init()

[EUNIDPUASW-38] power on cycle Created: 19/Nov/18 Updated: 19/Nov/18 Resolved: 19/Nov/18		
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	<u>Commands</u>	
Affects Version/s:	DPU ASW v1.0	
Fix Version/s:	DPU ASW v1.1	

Туре:	New Feature	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	0 minutes		
Time Spent:	Not Specified		
Original Estimate:	1 day		

Description

due to an OHB NCR seen as a HW criticity seen at TV test: concerning DCU power-on cycle, function DCUPowerOn5V is suggested to perform a Turn-off cycle before.

Comments

Comment by Eduardo Medinaceli Villegas [19/Nov/18]



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 48/188

in function DCUPowerOn5V added:

/* needed due to OHB requirement to asses nominal condition after thermal and vacuum tests */
res = ioctl(asw_dcu[dcu_id], IOC_DCU_IF_POWER_ON, FALSE);
before:

/* Turn ON 5V supply on DCU_ID FPGA */

res = ioctl(asw_dcu[dcu_id], IOC_DCU_IF_POWER_ON, TRUE);

[EUNIDPUASW 19/Nov/18	V-37] added FDIR to DCU 5V Created: 19/Nov/18 Updated: 19/Nov/18 Resolved:
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>System</u>
Affects Version/s:	DPU_ASW_v1.0
Fix Version/s:	DPU ASW v1.1

Туре:	New Feature	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

added FDIR to 5V line of the DCU in DRB_hsk

Comments



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 49/188

```
Comment by Eduardo Medinaceli Villegas [ 19/Nov/18 ]

if( dcuFDIR_5V & (0x0001 << i) ) /** TODO test */
{
    res = ioctl(asw_dcu[j], IOC_DCU_IF_POWER_ON, FALSE); /* Turn OFF DCU j */
    if (res != OK)
    { ERRORLOG(errno); ERRORLOGID(DRBASW_EACC, j); }
    SetDCUPowerOFF(j);
    SetSCEBootOFF(j);
}
added status DCU power off and SCE boot off if IOC_DCU_IF_POWER_ON is FALSE
```

[EUNIDPUASW-35] DRB_SHSK Created: 19/Nov/18 Updated: 19/Nov/18 Resolved: 19/Nov/18		
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	<u>Commands</u>	
Affects Version/s:	DPU ASW v1.0	
Fix Version/s:	DPU_ASW_v1.1	

Туре:	New Feature	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

FDIR DBB change in interface DRB_SHSK (Updated interface with enable/disable). Enable FDIRs: DCU 5V

DBB FPGA



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 50/188

Comments

Comment by Eduardo Medinaceli Villegas [19/Nov/18]

new interface:

STATUS DRB_shsk(int32_t onoff, uint32_t period, uint16_t spare, uint16_t tempfdir, uint16_t dcdcfdir, uint16_t dcufdir5v)

[EUNIDPUASW 16/Nov/18	/-34] transmission flag Created: 16/Nov/18 Updated: 16/Nov/18 Resolved:
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>System</u>
Affects Version/s:	DPU ASW v1.0
Fix Version/s:	DPU ASW v1.1

Туре:	Bug	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 51/188

end of transmission flag, it was set to zero by the arrival of the new Dither (wrong), should be done by processing. The problem happens in overlapping dithers.

MMU need a flag to close file.

Comments

Comment by Eduardo Medinaceli Villegas [16/Nov/18]

exposure watchdog reset the transmission flag

Comment by Eduardo Medinaceli Villegas [16/Nov/18]

ransmission flag is reset after the test over the function that write the data res = WriteDataEnd(&finalDataPack);

if (res == OK)

{ dpu_MonitorTabGlobal.DPUTOMMU = (((curDet+1) << 8) | 0x1U); /* detector index expected from 1 to 8 */ }

[EUNIDPUASW-32] clear of DRB multiple EDAC error Created: 16/Nov/18 Updated: 16/Nov/18 Resolved: 16/Nov/18		
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	<u>System</u>	
Affects Version/s:	DPU ASW v1.0	
Fix Version/s:	DPU ASW v1.1	

Туре:	New Feature	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 52/188

Description

Multiple non correctable errors in EDAC were already considered and counted with the variable drbEdacMultErr_Global++ in the IsrHandler.c inside the diagnostic of the DRB (dev_drb_diagnostic). But the error register was not cleared

Comments

Comment by Eduardo Medinaceli Villegas [16/Nov/18]

the clear of the error was implemented

ioctl(drb_ddiag, IOC_DRB_DIAG_GET_ERROR, (int)&tmp); /* tmp last fail address 0x%x, tmp */

and the error was signaled with crit_medium

ASWErrnoLog(0, IDtask2EntryID(taskIdSelf()), taskIdSelf());

ASWErrorCmdLog(TASKISR, (uint16_t)0, (int32_t)DRBASW_EEDACMULT, crit_medium);

the procedure was decided with the support of OHB (Alessandro)

Comment by Eduardo Medinaceli Villegas [16/Nov/18]

the type of error that causes this procedure is:

EDAC error in amba bus error 100 (drb.h)

[EUNIDPUASW-31] CPUDABT command Created: 14/Nov/18 Updated: 14/Nov/18 Resolved: 14/Nov/18	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>Commands</u>
Affects Version/s:	DPU_ASW_v1.0
Fix Version/s:	DPU ASW v1.1

Туре:	Bug	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	0 minutes		
Time Spent:	Not Specified		
Original Estimate:	1 hour		

Description

added dpu_MonitorTabGlobal.DITHSTATUS = ASW_FALSE in command CPUDABT



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 53/188

[EUNIDPUASW	[EUNIDPUASW-30] DCU_RST Created: 09/Nov/18 Updated: 09/Nov/18 Resolved: 09/Nov/18	
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	<u>Commands</u>	
Affects Version/s:	DPU ASW v1.0	
Fix Version/s:	DPU ASW v1.1	

Туре:	Bug	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

after DCU_RST counter reset, do NOT flag "not booted SCE"

[EUNIDPUASW-29] acceptancy status for SCE_SOFTBOOT Created: 09/Nov/18 Updated: 09/Nov/18 Resolved: 09/Nov/18	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>1553</u>
Affects Version/s:	DPU_ASW_v1.0
Fix Version/s:	DPU ASW v1.1

Type:	Bug	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 54/188

Remaining Estimate:	Not Specified
Time Spent:	Not Specified
Original Estimate:	Not Specified

Description

added SCE_INT acceptancy status for SCE_SOFTBOOT as for SCE_HRDBOOT

[EUNIDPUASW-28] default for GTAB Created: 09/Nov/18 Updated: 09/Nov/18 Resolved: 09/Nov/18	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>Commands</u>
Affects Version/s:	DPU ASW v1.0
Fix Version/s:	DPU_ASW_v1.1

Туре:	Bug	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

set GTAB = 1 as default



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 55/188

[EUNIDPUASW 09/Nov/18 Resolv	/-26] acceptancy status DCU_THSET Created: 09/Nov/18 Updated: red: 09/Nov/18
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>Commands</u>
Affects Version/s:	DPU_ASW_v1.0
Fix Version/s:	DPU ASW v1.1

Туре:	Bug	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

check status DCU_THSET (tested if MANUAL only), should be accepted also in PARKED | SAFE . These two states were added in the internal DB

[EUNIDPUASW-27] acceptancy status SCE_BOOT Created: 09/Nov/18 Updated: 09/Nov/18 Resolved: 09/Nov/18	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>Commands</u>
Affects Version/s:	DPU ASW v1.0
Fix Version/s:	DPU_ASW_v1.1

Type:	Bug	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 56/188

Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

SCE_BOOT command should be accepted in PARKED state



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 57/188

[EUNIDPUASW 09/Nov/18	V-24] handshake test with ICU Created: 09/Nov/18 Updated: 09/Nov/18 Resolved:
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>1553</u>
Affects Version/s:	DPU ASW v1.0
Fix Version/s:	DPU_ASW_v1.1

Type:	New Feature	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	0 minutes		
Time Spent:	Not Specified		
Original Estimate:	1 day		

Description

the test performed to check new commands send from ICU is done checking the ICU_COUNTER. The test is done using != from previous counter.

The old one was greater than



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 58/188

[EUNIDPUASW 09/Nov/18	V-23] asynchronous GTAB Created: 09/Nov/18 Updated: 09/Nov/18 Resolved:
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	Commands
Affects Version/s:	DPU ASW v1.0
Fix Version/s:	DPU_ASW_v1.1

Туре:	Bug	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

GTAB one shot telemetry retrieval (not periodical) decided with ICU-team



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 59/188

[EUNIDPUASW	[EUNIDPUASW-22] chi2size Created: 09/Nov/18 Updated: 09/Nov/18 Resolved: 09/Nov/18		
Status:	Done		
Project:	Application software for the Euclid NISP DPU		
Component/s:	<u>Processing</u>		
Affects Version/s:	DPU_ASW_v1.0		
Fix Version/s:	DPU ASW v1.1		

Туре:	Bug	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

set chi2size = 0 for engineering mode: LINEAR_CALIB,

because only raw data is send in the scientific package. No need to send the chi2 frame filled with zeros. Therefore the size of the scientific package was reduced.



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 60/188

_	[EUNIDPUASW-21] acceptancy parameter limits command SCEFMODE Created: 09/Nov/18 Updated: 09/Nov/18 Resolved: 09/Nov/18		
Status:	Done		
Project:	Application software for the Euclid NISP DPU		
Component/s:	Commands		
Affects Version/s:	DPU ASW v1.0		
Fix Version/s:	DPU_ASW_v1.1		

Туре:	Bug	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	0 minutes		
Time Spent:	Not Specified		
Original Estimate:	1 day		

Description

added in CommandInit SCEFMODE 1 param for acceptancy, and changed range for first param to (0,0,1024)



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 61/188

-	[EUNIDPUASW-17] serialization of DCU-SCE access Created: 09/Nov/18 Updated: 09/Nov/18 Due: 09/Nov/18 Resolved: 09/Nov/18		
Status:	Done		
Project:	Application software for the Euclid NISP DPU		
Component/s:	<u>System</u>		
Affects Version/s:	DPU ASW v1.0		
Fix Version/s:	DPU_ASW_v1.1		

Туре:	Bug	Priority:	Major	
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas	
Resolution:	Done	Votes:	0	
Labels:	serialization	serialization		
Remaining Estimate:	1 day			
Time Spent:	Not Specified			
Original Estimate:	1 day			

Description

enhanced serialization of the DCU-SCE access adding mutual exclusion semaphores semLockDCU to CPU functions accessign the DCUs (the semaphore was alredy used for serialized DCU and SCE access). In functions: command CPU_DABT (calling internally DCU_dabt)

Comments

Comment by Eduardo Medinaceli Villegas [09/Nov/18]

added to the processing task that could performs the ResetDcuAndDbb function in case of processing abort

Comment by Eduardo Medinaceli Villegas [09/Nov/18]

added semaphore to the TurnOffFocalPlane function associated to the transition to DPU SAFE status.

Comment by Eduardo Medinaceli Villegas [09/Nov/18]

mutual exclusion DCU semaphore added to DUMP/LOAD DCU



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 62/188

[EUNIDPUASW-20] telemetry DPU_STATUS_TAB scrubFlag Created: 09/Nov/18 Updated: 09/Nov/18 Due: 09/Nov/18 Resolved: 09/Nov/18	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	telemetry
Affects Version/s:	DPU ASW v1.0
Fix Version/s:	DPU_ASW_v1.1

Туре:	Bug	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

flag changed

dpu_StatusTabGlobal.ASWWDGREG2 = scrubFlag | (cpuTRC << 8);</pre>

before the shift was << 16, but the var is 16bit.

[EUNIDPUASW-19] consistency check processing algorithm Created: 09/Nov/18 Updated: 09/Nov/18 Resolved: 09/Nov/18	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	Processing
Affects Version/s:	DPU ASW v1.0
Fix Version/s:	DPU_ASW_v1.1

Туре:	Bug	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	algorithm, processing		



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 63/188

Remaining Estimate:	0 minutes
Time Spent:	Not Specified
Original Estimate:	1 day

Description

added consistency check chi2Temp = abs(chi2Temp) in processingAlgorithm.c to prevent negative values

[EUNIDPUASW-18] change of status after CPUDABT Created: 09/Nov/18 Updated: 09/Nov/18 Resolved: 09/Nov/18	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	Processing
Affects Version/s:	DPU_ASW_v1.0
Fix Version/s:	DPU ASW v1.1

Туре:	Bug	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	status		
Remaining Estimate:	0 minutes		
Time Spent:	Not Specified		
Original Estimate:	1 day		

Description

added dpu_MonitorTabGlobal.DITHSTATUS = ASW_FALSE after execution of CPUDABT command



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 64/188

[EUNIDPUASW-16] code semantics Created: 09/Nov/18 Updated: 09/Nov/18 Due: 09/Nov/18 Resolved: 09/Nov/18	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>Commands</u>
Affects Version/s:	DPU ASW v1.0
Fix Version/s:	DPU_ASW_v1.1

Туре:	Bug	Priority:	Trivial
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	analysis, static		
Remaining Estimate:	0 minutes		
Time Spent:	Not Specified		
Original Estimate:	1 hour		
Environment:	Static Analysis/Unit tests		

Description

code semantics issue (if statement with not needed == 1) to enable DCU FPGA FDIR, found during Static Analysis/Unit tests



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 65/188

[EUNIDPUASW-15] DCU_SHSK function for ANALOG telemetry Created: 09/Nov/18 Updated: 09/Nov/18 Resolved: 09/Nov/18	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	Commands
Affects Version/s:	DPU ASW v1.0
Fix Version/s:	DPU_ASW_v1.1

Туре:	Bug	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	0 minutes		
Time Spent:	Not Specified		
Original Estimate:	1 day		

Description

in command DCU_SHSK there was a loop on the acces to the ANALOG telemetry. The loop was removed



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 66/188

6. Affect version DPU ASW v1.1, fixed version DPU ASW v1.2 change log:

[EUNIDPUASW-61] enhanced functionality of the DEATH REPORT Created: 11/Dec/18 Updated: 12/Dec/18	
Status:	In Progress
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>System</u>
Affects Version/s:	DPU ASW v1.1
Fix Version/s:	DPU ASW v1.2

Type:	New Feature	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Unresolved	Votes:	0
Labels:	None		
Remaining Estimate:	3 weeks		
Time Spent:	Not Specified		
Original Estimate:	3 weeks		





Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 67/188

Description

the old implementation of the Death Report was updated including much more information of the system

Comments

```
Comment by Eduardo Medinaceli Villegas [11/Dec/18]
in DPU ASW types.h two ned structures were defined:
typedef struct TaskInfo_t /* TaskInfo - information structure */
{ int32_t td_id; /* task id */ char td_name[10]; /* name of task */ int32_t td_priority; /* task priority */
int32 t td status; /* task status */ int32 t td options; /* task option bits (see below) */ FUNCPTR td entry;
/* original entry point of task */ char * td_sp; /* saved stack pointer */ char * td_pStackBase; /* the bottom
of the stack */ char * td pStackLimit; /* the effective end of the stack */ char * td pStackEnd; /* the actual
end of the stack */ int32 t td stackSize; /* size of stack in bytes */ int32 t td stackCurrent; /* current stack
usage in bytes */int32_t td_errorStatus; /* most recent task error status */int32_t td_delay; /*
delay/timeout ticks */ }
TaskInfo;
and
struct deathRep s /* Structure to map the death report memory area */
{ int32_t deathSize; /* Size of death report memory area */ char aswVersion[DEATH_VERS_MAX_SIZE]; /*
Version of running ASW */t obt time; /* Time of last exception */ int32 t vecNum; /* Vector number that
caused last exception */ char taskName[32]; /* Task name (ASCII) of the task that caused the last exception
*/ ESFPPC esfRegs; /* Exception registers */ REG_SET regs; /* Registers of offending task */ TaskInfo
myTaskInfoData; char *myTaskInfoStack[10000]; TaskInfo AswTasks[TASK_N]; /* Written periodically, not
written by exception handler *//* global error */}
Comment by Eduardo Medinaceli Villegas [11/Dec/18]
two global functions were defined:
struct deathRep s deathRep; / pointer to structure to map the death report memory area */
int32_t myTaskInfo(int32_t tld, TaskInfo* pTaskInfo);
```

Comment by Eduardo Medinaceli Villegas [11/Dec/18]

```
defined functions:

void DeathHandler(int32_t tld, /* ID of offending task */
int32_t vecNum, /* exception vector number */
ESFPPC pEsf / pointer to exception stack frame */
);

void DeathReportInit();

void DeathHandler(int32_t tld, int32_t vecNum, ESFPPC *pEsf);

void DeathHandlerMCI(int32_t val); /* already present in previous implementation */
and
```

int32_t myTaskInfo(int32_t tld, TaskInfo* pTaskInfo); Comment by Eduardo Medinaceli Villegas [11/Dec/18]

The new DEATH REPORT include a header with general information (DPU-ASW version, size of the death report), a section for the offending tas info, including registers and stack plus information of the ASW task wich are periodically updated

Comment by Eduardo Medinaceli Villegas [11/Dec/18]



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 68/188

in hsk scan in the loop of the CPU periodically actions was included for(i = 0; i < TASK N; j++)

{ myTaskInfo(task_id[j], &taskDesc); /* task_id is the ID of tasks assigned during task spawn */ memcpy(&deathRep->AswTasks[j], &taskDesc, sizeof(TaskInfo)); }

to update the status of the task each cpuPeriod. The number of tasks TASK_N is equal to 9

[EUNIDPUASW-62] static analysis issues Created: 11/Dec/18 Updated: 11/Dec/18 Resolved: 11/Dec/18		
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	<u>System</u>	
Affects Version/s:	DPU ASW v1.1	
Fix Version/s:	DPU ASW v1.2	

Type:	Bug	Priority:	Trivial
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Attachments:	JENKINS_DPU_ASWv1.2.txt

Description

static analysis was performed using the semi-automatic procedure implemented in Jenkins at builder.oapd.inaf.it

Comments

Comment by Eduardo Medinaceli Villegas [11/Dec/18]

All the following were corrected:

Read_dither_tab.c:51:3: warning: Value stored to 'ver' is never read REMOVED

16:07:22 ver = 0U;

16:07:22 Read_dither_tab.c:52:3: warning: Value stored to 'error' is never read REMOVED

16:07:22 error = 0U;

16:07:22 ASW1553.c:779:3: warning: Value stored to 'droplines' is never read

16:07:22 droplines = 0U;

16:07:25 ReadSysConfigTab.c:51:3: warning: Value stored to 'ver' is never read REMOVED

16:07:25 ver = 0U;



16:07:37 ii = 0U;

ASW_DEBUG_1

16:07:40 Process.c: In function 'Process':

16:07:40 int32 t j; /* Generic index */

DPU_ASW Configuration Control Issues

Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 69/188

```
16:07:25 ReadSysConfigTab.c:52:3: warning: Value stored to 'error' is never read REMOVED
16:07:25 error = 0U;
16:07:25 Read proc param tab.c:53:3: warning: Value stored to 'ver' is never read REMOVED
16:07:25 ver = 0U;
16:07:25 Read proc param tab.c:54:3: warning: Value stored to 'error' is never read REMOVED
16:07:25 error = 0U;
6:07:32 SCE Commands.c:323:3: warning: Value stored to 'res' is never read ADDED TEST, PLUS RETURN IF
ERROR
16:07:32 res = DCU_exp(dcu_id, ktc_grp_const, ktc_exp);
16:07:32 SCE Commands.c:407:3: warning: Value stored to 'res' is never read ADDED TEST, PLUS RETURN IF
ERROR
16:07:32 \text{ res} = DCU \exp(dcu \text{ id, grp, frm});
16:07:35 CONF TABS Handler.c:30:3: warning: Value stored to 'ver' is never read REMOVED
16:07:35 ver = 0U;
16:07:35 CONF TABS Handler.c:31:3: warning: Value stored to 'error' is never read REMOVED
16:07:35 error = 0U;
16:07:36 ASWErrorHandling.c:81:10: warning: variable 'res' set but not used [-Wunused-but-set-variable]
16:07:36 STATUS res;
16:07:37 ASWErrorHandling.c:100:3: warning: Value stored to 'res' is never read REMOVED
16:07:37 res = msgQSend(err_msg, (char_t *)&data, sizeof(data), NO_WAIT,
16:07:37 ASWErrorHandling.c:202:3: warning: Value stored to 'crit index' is never read REMOVED
16:07:37 \text{ crit index} = 0;
16:07:37 ASWErrorHandling.c:204:3: warning: Value stored to 'exitflag' is never read REMOVED
16:07:37 \text{ exitflag} = 0U;
16:07:37 ASWErrorHandling.c:207:3: warning: Value stored to 'j' is never read REMOVED
16:07:37 i = 0;
16:07:37 ASWErrorHandling.c:208:3: warning: Value stored to 'i' is never read REMOVED
16:07:37 i = 0U;
16:07:37 ASWErrorHandling.c:209:3: warning: Value stored to 'ii' is never read REMOVED
```

16:07:40 Process.c:72:11: warning: unused variable 'j' [-Wunused-variable] PROTECTED WITH IFDEF



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 70/188

[EUNIDPUASW-60] included exposure using a single detector with complete focal plane Created: 11/Dec/18 Updated: 11/Dec/18 Resolved: 11/Dec/18		
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	<u>System</u>	
Affects Version/s:	DPU ASW v1.1	
Fix Version/s:	DPU_ASW_v1.2	

Type:	New Feature	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	0 minutes		
Time Spent:	Not Specified		
Original Estimate:	1 week		

Description

an exposure using a single detector when the focal plane is all turned on (or at least a second detector) was implemented.

three packages were updated to this scope:

- included single detector case in dequeue function, in DPU_1553
- included single detector case in IsrHandler to disable WdEOE in DPU_Start
- included single detector case in Processing to retreive the number of activeSCEs in DPU_Processing

Comments

Comment by Eduardo Medinaceli Villegas [11/Dec/18]

in DPU_1553 function Read_dither_tab.c::enqueue(), added test on number of detectors to handle a single detector case.

```
for (nDet = 0; nDet < DETECTORS; nDet++)
{</pre>
```

if((procParamTabGlobal.det2Send != DPU_BRD_DEV) && (procParamTabGlobal.det2Send != nDet))

/* to perform enqueue for a single detector */

{ continue; }



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 71/188

```
... hardware availability ...

...
}

Comment by Eduardo Medinaceli Villegas [ 11/Dec/18 ]

in DPU_Start, function IsrHandler.c::select_handler() added test on non broadcast device (!= DPU_BRD_DEV) to handle a single detector case

if ( ((procParamTabGlobal.det2Send == DPU_BRD_DEV) && (dcuReadyCounter_Global == GetNActiveSCE()))

(or)
    (procParamTabGlobal.det2Send != DPU_BRD_DEV) ) /* Last interrupt of exposure, for a single detector */

Comment by Eduardo Medinaceli Villegas [ 11/Dec/18 ]

in DPU_Process in function Process.c::Process() added inside the exposure loop ...

if (procParamTabGlobal.det2Send != DPU_BRD_DEV) /* single detector case */ { activeSCE = 1; det2SendFlag = ASW_TRUE; }

to handle the single detector case
```

[EUNIDPUASW-59] set scientific telemetry chi2 threshold Created: 11/Dec/18 Updated: 11/Dec/18 Resolved: 11/Dec/18		
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	telemetry	
Affects Version/s:	DPU ASW v1.1	
Fix Version/s:	DPU_ASW_v1.2	

Туре:	Bug	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	0 minutes		
Time Spent:	Not Specified		
Original Estimate:	1 week		

Description



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 72/188

set scientific telemetry parameter 50 (chi2 threshold) from DITH_CONFIG_TAB finalDataPack.uncHeader.telemetryDigital[50] = dithConfTabGlobal.Exposures[nExp].Frames; /* same for all detectors */

[EUNIDPUASW	/-58] expo counter Created: 11/Dec/18 Updated: 11/Dec/18 Resolved: 11/Dec/18
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>telemetry</u>
Affects Version/s:	DPU_ASW_v1.1
Fix Version/s:	DPU ASW v1.2

Туре:	Bug	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

exposure counter function was changed

Comments

Comment by Eduardo Medinaceli Villegas [11/Dec/18]

void

AddExpoCounter(void)

{ uint8_t expNum; uint8_t mem; expNum = (dpu_MonitorTabGlobal.EXPOCOUNT & 0xff); /* exposure counter */ mem = (dpu_MonitorTabGlobal.EXPOCOUNT >> 8); /* dither.membank */ expNum++; /* increase counter */ dpu_MonitorTabGlobal.EXPOCOUNT = ((expNum & 0xff) | (mem << 8)); return; }

Comment by Eduardo Medinaceli Villegas [11/Dec/18]

AddExpoCounter used in all exposure commands (SCE_EXP, SCE_KTC_EXP, SCE_IPC_EXP and SCETESTEXP)



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 73/188

[EUNIDPUASW 11/Dec/18 Resolv	V-54] History parameter in scientific telemetry Created: 10/Dec/18 Updated: ved: 10/Dec/18
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	telemetry
Affects Version/s:	DPU ASW v1.1
Fix Version/s:	DPU ASW v1.2


Туре:	New Feature	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 74/188

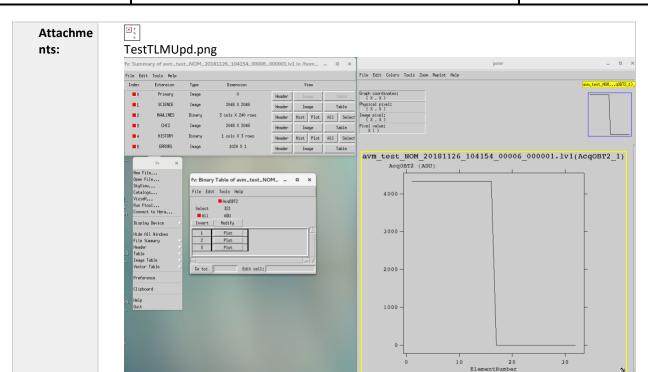

Description

corrected parameters saved in the History Telemetry buffer of the scientific data.

Comments

Comment by Eduardo Medinaceli Villegas [10/Dec/18]

in Process.c array added to store telemetry

static uint16_t tmpHistoryBuffer[NGROUP_MAX * DP_HIST_SIZE]; /** Temporary array to store history buffer */

copy in scientific data-pack

memcpy(finalDataPack.cmpHistoryBuffer, (char_t *)tmpHistoryBuffer,

finalDataPack.uncHeader.cmpHistSize);

Comment by Eduardo Medinaceli Villegas [11/Dec/18]

default value for history telemetry set:

macc_Global.TLM_history_sel = 88L; Temperature!



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 75/188

7. Affect version DPU_ASW_v1.2, fixed version DPU_ASW_v1.2.1 change log

_	[EUNIDPUASW-81] Error Handling failure for fast repeating errors of the same priority Created: 19/Feb/19 Updated: 19/Feb/19 Resolved: 19/Feb/19	
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	1553, error handling	
Affects Version/s:	DPU ASW v1.2	
Fix Version/s:	DPU ASW v1.2.1	

Туре:	Bug	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		

The presented document is Proprietary information of the Euclid Consortium.




Ref: EUCL-OPD-CS-7-001

Issue:

25/03/2020 Date: 76/188 Page:

Original Not Specified Estimate: **Environment:** The powering down of a single DCU takes about 5 seconds; and only at the end of the whole procedure, the DCU is flag as power off in the internal registers of the DPU. Then there is no access by the housekeeping scanner to that unit; but, during these 5 seconds, there is a beating effect with the software housekeeping scanner. It also has a default period of 5 seconds, and tries to access to units that are not working nominally producing "fake" errors (due to only to access at the wrong time). That access occurs very fast because not only the DCUs are enquired but also all the SCEs. We found that those errors were not correctly handled by the ET.



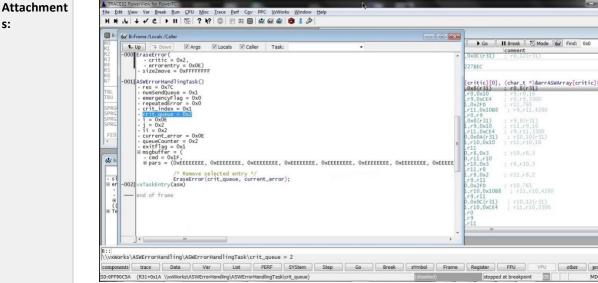

The ET uses 3 queues for the errors (each one of type tag t ErrorStruct) according to their criticality, and each second, after evaluating the multiplicity, 1 error (if any) is embedded in a bigger structure (type tag t ASW Complessive Error) and made available through the 1553 interface. Then its related queue was reshuffled.

We saw an error in this operation provoking a memory leak. The cause was that the size of a memory reallocation inside this function was evaluated using the wrong type structure (tag_t_ASW_Complessive_Error instead of tag_t_ErrorStruct). The effect was enhanced when several error entries of the same criticality were the trigger. The issue became critical when multiple errors of criticality 1 (medium) appear, corrupting the memory area outside the statically allocated space for the events in the error queues. When this happens, the RTOS find the memory corrupted and reboots the CPU.



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 77/188

Comment

exitflag = FALSE;

Comment by Eduardo Medinaceli Villegas [19/Feb/19]

We corrected the function static void EraseError(uint16_t critic) of the ASW Error Handling task, refactoring the function that performs the shuffling inside the corresponding criticality queue. The design of the function was not changed, only the bug was correct. Therefore, the associated documentation EUCL-OPD-TN-7-010 remains valid.

Unit testing was performed for the patched ASW Error Handling task, successfully.

In the attached image can be seen that the size of the array used by the EraseError was wrong. The image is a screenshot of the memory allocation management performed by the JTag debugger. It was connected to the DPU-EQM unit for debugging purposes.

Comment by Eduardo Medinaceli Villegas [19/Feb/19]

```
EreaseError function was refactored and the correct size was included.
uint32 ti;
  for(i = 1U; i < MAXERRORSPERQUEUE; i++) /* queue entries */
       /* for each entry, shuffle */
    memcpy (&errASWArray[critic][i-1], &errASWArray[critic][i],
             sizeof(error_struct_t));
  /* last entry is set (forced) to zero */
  memset((char *)&errASWArray[critic][MAXERRORSPERQUEUE-1],
  (uint32 t)NULL, sizeof(error struct t));
  /* decrement global pointer of last entry (defensive check to avoid rollover) */
  if (counterQueue[critic] > 0)
   counterQueue[critic]--;
 }
 return;
   Comment by Eduardo Medinaceli Villegas [ 19/Feb/19 ]
In ISR task_ret_t ASWErrorHandlingTask(void) the mechanism to resuffle the queues was
refactored:
res = msgQReceive(err1553_msg, (char_t *)&msgbuffer, sizeof(msgbuffer), NO_WAIT);
if (res != ERROR) {
if ((msgbuffer.cmd == CMD ERR SEND))
 /* Send ERRORS2SEND errors to 1553 and shuffle down array */
       /* Send message*/
```



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 78/188

8. Affect version DPU ASW v1.2.1, fixed version DPU ASW v1.2.2 change log

[EUNIDPUASW-82] added error signaling for "Error DBB interrupt lost on spw device"

SPV_EDBBINTLOST Created: 25/Mar/19 Updated: 25/Mar/19 Resolved: 25/Mar/19

Status: Done

Project: Application software for the Euclid NISP DPU

Component/s: error handling

Affects DPU ASW v1.2

Version/s: DPU ASW v1.2.2

Туре:	New Feature	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	1 day		
Time Spent:	Not Specified		
Original Estimate:	1 day		

Description



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 79/188

errors "DBB interrupt lost on spw device" in file Supervisor.c function IsrSelect (module DPU_Start) are not injected using SPV_EDBBINTLOST

```
comment by Eduardo Medinaceli Villegas [25/Mar/19]

added:
if (dbbpen.ilost != 0)
{
    ERRORLOGID(SPV_EDBBINTLOST, asw_dbb_spw[i]);
    ASWErrnoLog(errno, 0, taskIdSelf());
    ASWErrorCmdLog(TASKSLCT, (uint16_t)0, (int32_t)SPV_EDBBINTLOST, crit_medium);
}
```



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 80/188

[EUNIDPUASW 25/Mar/19	V-93] gain factor in processing Created: 25/Mar/19 Updated: 25/Mar/19 Resolved:
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	Processing
Affects Version/s:	DPU ASW v1.2
Fix Version/s:	DPU_ASW_v1.2.2

Туре:	Bug	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	1 day		
Time Spent:	Not Specified		
Original Estimate:	1 day		

Description

The conversion factor from e/ADU, was incorrectly set to 1. This value is programmable using the PROC_PARAM_TAB with parameter Gain_Det[currentDetector].

```
Comment by Eduardo Medinaceli Villegas [25/Mar/19]

gain = (float32_t)(p_procParam->Gain_Det[curDet_const]) / 100.0F;

then:

beta = (sigma*gain) / (alfa + 1.0F);

and

/* compute the slope of the fit */

slope = (gamma/gain) *

(float32_t) ( sqrt( 1.+ ((4.0F * gain * gain * (fact + beta) * (fact + beta)) / ((alfa + 1.) * (alfa + 1.))) ) -1. ) - beta;

/* Compute chi square */

chi2Temp = ((2.0F*gain) / (alfa + 1.0F) ) * ((float32_t)nGroupsMin1 * fact - (ramp[nGroupsMin1] - ramp[0]));
```



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 81/188

[EUNIDPUASW 25/Mar/19	/-92] Death Report time tag Created: 25/Mar/19 Updated: 25/Mar/19 Resolved:
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>Testing</u>
Affects Version/s:	DPU_ASW_v1.2
Fix Version/s:	DPU ASW v1.2.2

Туре:	Bug	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

added in DeathReport function DR_timetag() to Time Tag the DR

```
Comment by Eduardo Medinaceli Villegas [25/Mar/19]

void DR_timetag(void)
{
    TimeTagTOBT(&deathRep->time);
    return;
}
```



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 82/188

[EUNIDPUASW 25/Mar/19 Resolv	/-91] CPU DBAT Dither Abort Command Created: 25/Mar/19 Updated: ved: 25/Mar/19
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	Commands, System
Affects Version/s:	DPU ASW v1.2
Fix Version/s:	DPU_ASW_v1.2.2


Туре:	Bug	Priority:	Major	
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas	
Resolution:	Done	Votes:	0	
Labels:	None			
Remaining Estimate:	0 minutes			
Time Spent:	Not Specified	Not Specified		
Original Estimate:	1 week			
Environment:	During tests with a multiplicity command CPU_DABT.	ty of DCU/SCE > 4	4 problems arose triggered	



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 83/188

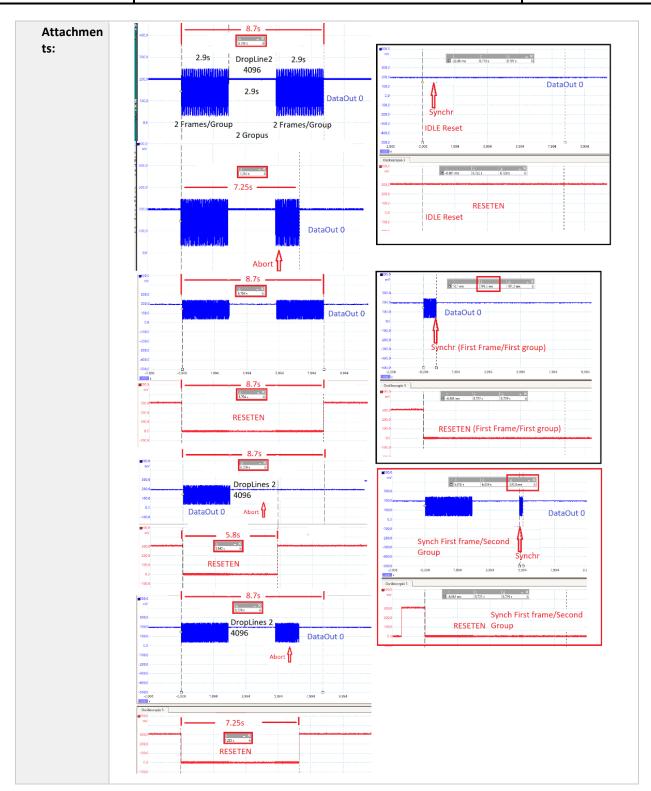

The presented document is Proprietary information of the Euclid Consortium.

This document shall be used and disclosed by the receiving Party and its related entities (e.g. contractors and subcontractors) only for the purposes of fulfilling the receiving Party's responsibilities under the Euclid Project and that the identified and marked technical data shall not be disclosed or retransferred to any other entity without prior written permission of the document preparer.



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 84/188

Description

The procedure used to trigger the errors was the following (using 6 DCU/SCE):

- DITHER(NOMINAL)
- SCE_EXP(1st MACCC)
- delta t = 10 s
- CPU DABT
- DITHER(1xMACC(2,2,2))
- $SCE_EXP(MACC(2,2,2))$

Was observed a malfunctioning in the successive Dither acquisition; several types of errors were observed, among them:

PRC_ECRC (050c000a) /* Error checking crc32DCU with crc of downloaded data */ ASW_EENQUEUE (0a5703f1) /* Error enqueue */

Using the serial interface of the Maxwell board with Tornado (development ambient), was found that the main issue (not seen by the error handling) was that interrupts from the data transfer from the DCU to the DBB do not arrive for all detectors. Producing a high-level error:

WCD_WD_EXP_EXPIRED /* Error: exposure watchdog expiration, crit_high FDIR related */

of the expiration of the Exposure watchdog.

Command CPU_DABT perform the following operations:

- Force DCU mated SCE internal microcode to abort current exposure at next frame boundary (using a write function of the SCE)
 - Wait the equivalent of a single frame time (1.5s) to abort DCU operations
 - Clear all current enqueued exposures for dcu id (running a dedicated ioctl)
 - Force dcu id to idle state and clear registers (running a dedicated ioctl)
 - Reset dcu id presently active SPW channels to DBB (running a dedicated ioctl)

Comments

Comment by Eduardo Medinaceli Villegas [25/Mar/19]

The reset of the SCE is performed on a frame basis, therefore in the worst case it is performed at the beginning. The reset of the SCE is performed on a frame basis, therefore in the worst case, it is performed at the beginning of a frame, with a consequent delay of 1.45s. The delay of 1.5s was optimized using 3 DCU/SCEs. Each single operation (write and ioctls) are tested after the execution, and no error of this type was ever recorded; in case of malfunctioning error



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 85/188

DCUASW EACC = 0xDC001 (error accessing DCU) is expected.

The change of the command, consists on increasing the delay to allow the reset of the SCE, and data arrival to the DCU before the reset operations. The hypothesis is that data could arrive to the DCU during of after the reset of the DCU; causing non-nominal operations of the DCU. The time delay was set to 3s (double time).

Comment by Eduardo Medinaceli Villegas [25/Mar/19]

Figure attached (Abort vs synchr.png) shows the different time basis for the abort and reset operations of the SCE.

- abort is performed in a frame basis
- reset is performed in a line basis

Comment by Eduardo Medinaceli Villegas [25/Mar/19]

Changing the timing of the SCE abort (probably related to data written on the DCU while performing

the reset operation), clearly changes the nominal behavior of the DCU.

And problems related to the DBB memory, as the enqueue, or in the DCU SpW interface of the DCU are related to the SCE reset; this kind of behavior cannot be recovery just by acting on the affected DCU, also the DBB memory has to be completely clear (ASW reboot) in order to have a full recovery of the nominal functionality.

The timing of the SCE abort, performed on a frame based is different to the nominal one in case of multiplicity greater and equal than four, this has to be investigated. It should be important to estimate the time lapse between the execution of the abort (commanded by the DCU) of the SCE and the end of the data transmission of the current frame.

Comment by Eduardo Medinaceli Villegas [25/Mar/19]

Time delay between SCE and DCU reset, set to 3s, was extensively verified using the full detector load (8xDCU/SCE); repeating several times the test sequence.

Comment by Eduardo Medinaceli Villegas [25/Mar/19]

In module Commands, in file DCU_Commands.c, in function DCUDABT the total delay time after SCE abort (write) and before the DCU reset operations, was set to:

taskDelay(3xsysCloRateGet()) = 3s

CPU_DABT is a macro that executes internally DCUDABT

Comment by Eduardo Medinaceli Villegas [25/Mar/19]

```
static STATUS DCU_dabt(int32_t dcu_id, uint32_t spw_link)
```

STATUS res;

/* Force mated SCE internal microcode to abort current exposure at next frame boundary */
res = WriteSCE(dcu_id, (uint32_t)SCE_CMDREG, (uint32_t)SCE_CMDABT);



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 86/188

```
if (res != OK)
    ERRORLOG(errno);
    ERRORLOGID(DCUASW_EACC, dcu_id);
 /* Wait the equivalent of a single frame time (1.5 Sec) to abort DCU operations
 taskDelay(3*sysClkRateGet());
 /* Clear all current enqueued exposures for dcu id */
 res = ioctl(asw_dbb_spw[dcu_id], IOC_DBB_SPW_RESET, 0);
 if (res != OK)
    ERRORLOG(errno);
    ERRORLOGID(DCUASW EACC, dcu id);
  } /* Force dcu id to idle state and clear registers */
 res = ioctl(asw_dcu[dcu_id], IOC_DCU_IF_COMMAND, DCU_CMD_ABORT_CMD);
 if (res != OK)
    ERRORLOG(errno);
    ERRORLOGID(DCUASW_EACC, dcu_id);
 }
 /* Reset dcu id presently active SPW channels to DBB */
 res = ioctl(asw_dcu[dcu_id], IOC_DCU_IF_ENABLE_SPW, spw_link);
 if (res != OK)
 {
    ERRORLOG(errno);
    ERRORLOGID(DCUASW EACC, dcu id);
  return (res);
   Comment by Eduardo Medinaceli Villegas [ 25/Mar/19 ]
removed loop on CPU Commands.c, function CPU DABT loop of DCUDABT + flag Dither
Now performed by processing in function ResetDcuAndDbb to be uniform with WD EOD
operations
CPU_DABT performs:
data.cmd = CMD PRC ABORT;
res = msgQSend(proc_msg, (char *)&data, sizeof(data), NO_WAIT, MSG_PRI_NORMAL);
```



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 87/188



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 88/188

	[EUNIDPUASW-90] DITHER_FLAG OFF when WD_EXP expires Created: 25/Mar/19 Updated: 25/Mar/19 Resolved: 25/Mar/19	
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	<u>System</u>	
Affects Version/s:	DPU ASW v1.2	
Fix Version/s:	DPU_ASW_v1.2.2	

Туре:	New Feature	Priority:	Minor	
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas	
Resolution:	Done	Votes:	0	
Labels:	None	None		
Remaining Estimate:	Not Specified			
Time Spent:	Not Specified			
Original Estimate:	Not Specified			

Description

done by DCUDABT called by WD_EXP



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 89/188

[EUNIDPUASW-89] HskScan added defensive programming Created: 25/Mar/19 Updated: 25/Mar/19 Resolved: 25/Mar/19	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	telemetry
Affects Version/s:	DPU ASW v1.2
Fix Version/s:	DPU_ASW_v1.2.2

Туре:	New Feature	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	1 day		
Time Spent:	Not Specified		
Original Estimate:	1 day		

Description

added test to func myTaskInfo before memcpy



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 90/188

[EUNIDPUASW 25/Mar/19	V-88] CPU Load task spawn Created: 25/Mar/19 Updated: 25/Mar/19 Resolved:
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	CPU Load
Affects Version/s:	DPU ASW v1.2
Fix Version/s:	DPU ASW v1.2.2

Туре:	Bug	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	1 day		
Time Spent:	Not Specified		
Original Estimate:	1 day		

Description

- added name for task GetCpuLoad define TASKGLOAD "tGETCPULOAD"
- changed taskSpawn name for function GetCpuLoad
- added error case injection for taskSpawn of function GetCpuLoad
- reset of oldTaskId = 0 if errors in taskSpawn GetCpuLoad
- delete else for if(oldTaskId == ERROR)

```
Comment by Eduardo Medinaceli Villegas [25/Mar/19]

void GetCpuLoadS(void)void GetCpuLoadS(void)
{
    if (oldTaskId > 0)
    {
        taskDelete(oldTaskId);
    }
```



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 91/188

•	[EUNIDPUASW-87] acceptance status for SCE_BOOT Created: 25/Mar/19 Updated: 25/Mar/19 Resolved: 25/Mar/19	
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	Commands	
Affects Version/s:	DPU ASW v1.2	
Fix Version/s:	DPU ASW v1.2.2	

Туре:	Bug	Priority:	Trivial
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	0 minutes		
Time Spent:	Not Specified		
Original Estimate:	1 day		

Description

remove PARKED from acceptancy state for SCE_BOOT SOFT and HARD



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 92/188

[EUNIDPUASW	[EUNIDPUASW-86] CPU watchdog Created: 25/Mar/19 Updated: 25/Mar/19 Resolved: 25/Mar/19	
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	<u>System</u>	
Affects Version/s:	DPU_ASW_v1.2	
Fix Version/s:	DPU ASW v1.2.2	

Туре:	New Feature	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

CPUWDG change acceptance status and added a customizable timeout

Comments

Comment by Eduardo Medinaceli Villegas [25/Mar/19]

CPUWDG change acceptancy status: add MANUAL and PARKED and range of parameter Scrubbing time [0, min:max], no default for scrubFlag, should be = 25749 (once a day)

Comment by Eduardo Medinaceli Villegas [25/Mar/19]

defined a static varible in Supervisor.c to set the default value for the timeout of the CPU hardware watchdog (time disarm of the WD).

In this way by checking the assembler map the address of the variable can be identified and the value changed. Not is assigned to a value equal to 1300 ms (WD_SCS_TIMEOUT)

static uint32_t defaultCPUWDtime = WD_SCS_TIMEOUT;

scsWatchdogTimerSet(defaultCPUWDtime);



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 93/188

[EUNIDPUASW-85] default value for PROC_PARAM_TAB parameter "detector to be send" Created: 25/Mar/19 Updated: 25/Mar/19 Resolved: 25/Mar/19	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	Processing
Affects Version/s:	DPU ASW v1.2
Fix Version/s:	DPU ASW v1.2.2

Туре:	Bug	Priority:	Trivial
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

default proc_param should have BROADCAST device = 9 as default.

In module DPUStart, function LoadDefaults added default proParamTabGlobal.det2Send = 9



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 94/188

[EUNIDPUASW 25/Mar/19	/-84] wrong error codes Created: 25/Mar/19 Updated: 25/Mar/19 Resolved:
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	error_handling
Affects Version/s:	DPU ASW v1.2
Fix Version/s:	DPU_ASW_v1.2.2

Туре:	Bug	Priority:	Trivial
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	1 minute		
Time Spent:	Not Specified		
Original Estimate:	1 minute		

Description

some error codes were wrong due to repeated flag and due to a typo

Comments

Comment by Eduardo Medinaceli Villegas [25/Mar/19]

wrong codes (duplicated) wrong codes (duplicated)

WCD_ESTARTEXP (WCD_OK + 0x03U) /* Error starting exposure watchdog */

WCD_ESTARTPRC (WCD_OK + 0x04U) /* Error starting Dither processing watchdog */

Comment by Eduardo Medinaceli Villegas [25/Mar/19]

check error codes ASW_CONFTAB ASW_OK + 0x3EF changed to:

#define ASW_CONFTAB (ASW_OK + 0x3FU) /* Error accepting configuration table */

#define ASW_ETIMEHAND (ASW_OK + 0x4AU) /* Error handling time */

Comment by Eduardo Medinaceli Villegas [25/Mar/19]

added error codes for SCE, CPU, DBB, DRB commands, replaced generic ones



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 95/188

•	[EUNIDPUASW-83] GTAB used to works only for first detector Created: 25/Mar/19 Updated: 25/Mar/19 Resolved: 25/Mar/19	
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	telemetry	
Affects Version/s:	DPU ASW v1.2	
Fix Version/s:	DPU_ASW_v1.2.2	

Туре:	Bug	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	1 day		
Time Spent:	Not Specified		
Original Estimate:	1 day		

Description

the retrieval of HSK2 and HSK3 for SCE only works for the SCEID=0. The default value was set inside the detector loop, therefore the rest of the detectors were skipped

Comments

Comment by Eduardo Medinaceli Villegas [25/Mar/19]

SCEHSKFlag_Global = 1; set outside the DETECTORS loop

Generated at Mon Mar 25 15:31:25 CET 2019 by Eduardo Medinaceli Villegas using Jira 7.13.1#713001-sha1:5e06076c2d215a6f699b7e5c90ab2fae7ba5a1ce.



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 96/188

9. Affect version DPU ASW v1.2.2 fixed version DPU ASW v1.2.3 change log

[EUNIDPUASW-94] limits of parameter in acceptancy of command SCE_CONFIG Created: 09/May/19 Updated: 02/Jul/19 Resolved: 24/May/19	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>Commands</u>
Affects Version/s:	DPU ASW v1.2.2
Fix Version/s:	DPU_ASW_v1.2.3

Туре:	Bug	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Attachments:	SCE_FMODE.pdf
--------------	---------------

Description

the internal database containing limits for each parameter was not updated for this command.

The values are:

```
COMMAND_t sceFMODE_cmd = { {104, 50, 0}, { {0, 0, 1024}, {0, 0, 0xFFFF}}, {0, 0, 0xFFFF}}, {0, 0, 0xFFFF}}, {0, 0, 0xFFFF}}, 8, (ASW_STATUS_MANUAL | ASW_STATUS_SCE_INIT | SCE_EEF_STATUS_IDLE)};
```

the non updated limit was the upper limit for the first parameter = 1024

Comments

Comment by Eduardo Medinaceli Villegas [24/May/19]



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 97/188

the limit for the first parameter was set to 0xFFF as for the other parameters

Comment by Eduardo Medinaceli Villegas [24/May/19]

COMMAND_t sceFMODE_cmd = {\{104, 50, 0\}, \{\{0, 0, 0xFFFF\}\}, \{0, 0, 0xFFFF\}, \{0, 0, 0xFFF\}, \{0, 0xFFF\},

Comment by Eduardo Medinaceli Villegas [02/Jul/19]

TEST see attached docuent SCE_FMODE.pdf

At the TV tests were found that the first parameter (frame readout configuration mode) of this command had an incorrect range at in the internal database used to perform the command verification procedure. And it was not possible to configure the IP mode with the buffered SCA readout mode buffered. The acceptance range was corrected, and the command tested.

- The test procedure used was the SFT08_01_IPCExposure.
- With this procedure, the readout configuration mode was programmed to 1028 (equal to IPC mode + SCA Buffered output)



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 98/188

[EUNIDPUASW-95] RAW mode, data size greater than 127 Mb Created: 09/May/19 Updated: 02/Jul/19 Resolved: 24/May/19	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	Processing
Affects Version/s:	DPU ASW v1.2.2
Fix Version/s:	DPU_ASW_v1.2.3

Туре:	Bug	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Attachments:	RAWmode.pdf

Description

```
Function WriteDataRaw of module DPU_Process (file WriteData.c) in the case

if(sumBytes > MAXDRBSPWSIZE)
{
    save = sumBytes;
    sumBytes = MAXDRBSPWSIZE;
    res = WriteToMMU();
    if (res != OK){ return(res); }
    sumBytes = save - MAXDRBSPWSIZE;
    p2DrbMem -= MAXDRBSPWSIZE;
}

evaluate the new size, but the pointer is shifted to a wrong address: p2DrbMem -=
    MAXDRBSPWSIZE;

Therefore,
```



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 99/188

res = memcpyDMA((uint32_t)p_dataPack[i].data, p2DrbMem, size);

the copy has a correct size, but the data inside is corrupted. Because the first chunk of data is ok, but the second one is repeated with a part of the first chunk.

During tests most probably only the size was tested.

Comments

Comment by Eduardo Medinaceli Villegas [09/May/19]

email of 20-4-19 during EM-TV tests at LAM:

Dear Thierry,

today we further analyzed the problem of the RAW data with 15 groups. We confirm that the issue is not depending on the LED (neither the SpW), and that it is only related to the software. But by the outcome of the analysis of the IWS file, we clearly understand that the problem is always present for 15 groups! compressed or uncompressed; within the conditions discussed yesterday (well identified the function not working properly).

It was already decided that the DPU team will open an NCR for this case; and together with CSS and IWS experts we double cross-checked that RAW data for 14 groups that is OK.

But the data taken in the flat-field procedure of this morning was making a RAW data with 15 groups acquisition; William tell us that raw data in that case was only for a complementary check. I suggested him to run the procedure again (re-scheduling it), even if the data is not used; I will prefer that the data is correct even if not used. But the final decision is up to Thierry/William/Stefano. The duration of the test is about 1 hour, so it is feasible to re-schedule it.

Concerning already programmed test to come using RAW mode (non linearity), it should be done using 14 groups. Therefore, the test procedure has to be modified accordingly. Regards,

eduardo

Comment by Eduardo Medinaceli Villegas [24/May/19]

Function

STATUS WriteDataRaw(struct Data2Pack_t p_dataPack[], int32_t nGroups) was refactored and the bug was corrected.

When data size (sumBytes) exceeds MAXDRBSPWSIZE (inside the groups loop) the function calls the routine WriteToMMU() to write data in the MMU, then the data size is reset to zero and the pointer is placed at the base memory address.



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 100/188

```
To be conservative the size MAXDRBSPWSIZE was reduced to 
#define MAXDRBSPWSIZE

(DRB_SDRAM_MEM_SIZE - DRB_SDRAM_MEM_RESERVED_SIZE - (TSIZE_MAX* sizeof(uint16_t)))

/** Max usable size of the DRB mem including safety margin of 1 group */

to avoid having a chunk that exceeds the allowed memory size in the DRB buffer
```

```
Comment by Eduardo Medinaceli Villegas [ 24/May/19 ]
```

```
STATUS
WriteDataRaw(struct Data2Pack t p dataPack[], int32 t nGroups)
 STATUS res;
 const int32 t size = TSIZE MAX * sizeof(uint16 t); /* total bytes x Frame */
 int32 ti;
 res = OK:
 for (i = 0; i < nGroups; i++)
  if(sumBytes > MAXDRBSPWSIZE)
   res = WriteToMMU();
   if (res != OK)
         return(res);
                       }
  sumBytes = 0;
  p2DrbMem = DRB_BASE_MEM_ADDR;
 res = memcpyDMA((uint32_t)p_dataPack[i].data, p2DrbMem, size);
 if (res != OK)
    ERRORLOG(errno); /* error moved to function call on test on res */ }
{
else
     sumBytes += size; }
p2DrbMem += size;
return (res);
   Comment by Eduardo Medinaceli Villegas [ 02/Jul/19 ]
```



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 101/188

TEST: see attached document RAWmode.pdf

Engineering RAW mode calibration was performed to check the consistency of raw data produced for all groups as well as the processed frame.

Sequence SFT08_04 was used for the test (with a dedicated initialization file with a MACC(15, 16, 7))

The successful criteria were, to check for the correct generation (size and format) of a file containing the raw data of 15 groups, and correctness of the frame produced by the processing, in the scientific package. The file produced was:

nisp em test NOM 20190620 RAW 073445 00001 000001.lv1



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 102/188

	[EUNIDPUASW-96] 1553 interface change DRB_SHSK_Created: 17/Jun/19 Updated: 02/Jul/19 Resolved: 25/Jun/19	
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	1553, Commands	
Affects Version/s:	DPU ASW v1.2.2	
Fix Version/s:	DPU_ASW_v1.2.3	

Туре:	New Feature	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		
Environment:	Due to NISP-FDIR requirements, some new FDIRs were implemented. As a requeriment, all of those FDIR should have a switch to enable/disable them. Four new ones where implemented in table DRB_SHSK		

Attachments:	DRB_SHSK.pdf
--------------	--------------

Comments

Comment by Eduardo Medinaceli Villegas [25/Jun/19]

parameters added to the command, new prototype is: static STATUS

DRB_shsk(int32_t onoff, uint32_t period, uint16_t dbbTfdir, uint16_t tempfdir, uint16_t dcdcfdir, uint16_t dcufdir5v, uint16_t sceupsetfdir, uint16_t EOEfdir, uint16_t EOTfdir, uint16_t EOTfdir);

Comment by Eduardo Medinaceli Villegas [25/Jun/19]

successfully test performed at LAM with NISP-EM-TV setup, report attached DRB_SHSK.pdf

Comment by Eduardo Medinaceli Villegas [02/Jul/19]

Redmine entry:



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 103/188

https://www.ict.inaf.it/redmine/issues/1833

Due to the new requirements of the FDIRs of NISP (final version of the document under preparation), the DPU interface with ICU is changed to allow the enable and disable of each new FDIR (being this a requirement of the DPU-ASW).

The added FDIRs are the following:

- SCE double memory upset
- End of Exposure WatchDog FDIR
- End of Processing Watchdog
- End of Transmission to MMU Watchdog

Therefore in command **DRB_SHSK** were added:

- word 8 for FDIR SCE double upset (item7),
- word 9 for FDIR WEOE (item8).
- word 10 for FDIR WEOD (item9),
- and word11 for FDIR WEOT2MMU (item10).

Another requirement of the DPU-ASW states that programmable settings of the DPU have to be echoed in telemetry tables;

this implies that the **MONITOR_TABLE** was modified to allow the copy of the set registers through the DRB SHSK command.

The MONITOR_TABLE was modified in the following way:

- changed name and bit-field format of word19: DRB HSK Register 1, added Table 15-3 with description
- changed name and bit-field format of word20: DCUHSK Register 1, added Table 15-2 with description
- changed word 23: removed Repeated Error 1 (already send in Error_Tab); Added DRB HSK Register 2, added also Table 15-3-1 with the description of the bit-field
- changed word 24: removed Repeated Error 2 (already send in Error_Tab); Added DCU HSK Register 2, added also Table 15-2-1 with the description of the bit-field

*references of tables are to document EUCL-OPD-TN-7-004 (attached)

This Issue will be completed with a link to the DPU-ASW configuration control documentation of the changes (as soon as they'll be available); describing all the new features introduced in the DPU-ASW. This entry considers the 1553 interface with ICU only



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 104/188

[EUNIDPUASW 02/Jul/19 Resolve	V-97] change of format MONITOR_TAB Created: 25/Jun/19 Updated: ed: 25/Jun/19
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	1553, telemetry
Affects Version/s:	DPU ASW v1.2.2
Fix Version/s:	DPU_ASW_v1.2.3

Туре:	New Feature	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		
Environment:	because there were new NISP-FDIR switches activated through the DRB_SHSK that has to be echoed in telemetry, the format of the table has to be updated		

Attachments:	DRB_SHSK.pdf	MONITOR_TAB.pdf	
--------------	--------------	-----------------	--

Comments

Comment by Eduardo Medinaceli Villegas [25/Jun/19]

the table was updated, the two words dedicated for the error counter were deleted (because already in the ERROR_TAB), and used for two new registers: DRBHSKMONITOR1 (word19), DRBHSKMONITOR2 (word21).

Also MONITOR_TAB.pdfpDCUHSKReg1 (word20) and DCUHSKReg2 (word22) were reformated

registers format:

dpu_MonitorTabGlobal.DRBHSKMONITOR1 = ((period << 8) | (EOTfdir << 6) | (EODfdir << 5) | (EOEfdir << 4) | (dcdcfdir << 3) | (tempfdir << 2) | (dbbTfdir << 1) | onoff); dpu_MonitorTabGlobal.DRBHSKMONITOR2 = ((sceupsetfdir << 8) | dcufdir5v);

Comment by Eduardo Medinaceli Villegas [25/Jun/19]

tests were performed successfully at LAM with the NISP-EM-TV setup (room temperature). See more details in Issue DRB_SHSK



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 105/188



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 106/188

[EUNIDPUASW-99] NISP-FDIR Created: 02/Jul/19 Updated: 17/Jul/19 Resolved: 04/Jul/19	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>System</u>
Affects Version/s:	DPU_ASW_v1.2.2
Fix Version/s:	DPU ASW v1.2.3

Туре:	New Feature	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		
Environment:	Document Euclid NISP Autonomy and FDIR Concept Document EUCL-OTO-TN-7-002 (Veuillez_signer_avec_DocuSign _EUCL-OTO-TN-7.pdf) define new FDIRs at NISP level to be implemented in the DPU.		

Attachments:	DPU-ASW_v1.2.3_test_2ndPart.pdf
	draft3SL_EM.xlsx IIINISP-FDIR_tests_part1.pdf III
	Veuillez_signer_avec_DocuSign _EUCL-OTO-TN-7.pdf

Comments

Comment by Eduardo Medinaceli Villegas [02/Jul/19]

complete list of NISP-FDIRs:

NISP-FDIR-201 DCU temperature over lower threshold

NISP-FDIR-202 DCU temperature over higher threshold

NISP-FDIR-203 DCU over current threshold

NISP-FDIR-205 SCE over current threshold

NISP-FDIR-207 DBB operation fails

NISP-FDIR-209 large number if failed DCU/SCE accumulated in a single DPU

NISP-FDIR-210 internal DPU temperature - CPU board over lower threshold

NISP-FDIR-211 internal DPU temperature - CPU board over higher threshold

NISP-FDIR-212 internal DPU temperature - Main Power supply over lower threshold

NISP-FDIR-213 internal DPU temperature - Main Power supply over higher threshold



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 107/188

NISP-FDIR-214 internal DPU temperature – DBB board over threshold 1

NISP-FDIR-215 internal DPU temperature – DBB board over threshold 2

NISP-FDIR-216 CPU watchdog End of Exposure

NISP-FDIR-217 CPU watchdog End of Dither

NISP-FDIR-218 CPU watchdog End of Transmission

NISP-FDIR-220 SCE double upset

NISP-FDIR-221 DCU 28V

NISP-FDIR-222 DCU 5V

EUCL-OTO-TN-7-002_V3_4_NISP_FDIR - draft3SL_EM.xlsxn

new implemented are:

NISP-FDIR-207 DBB operation fails

NISP-FDIR-216 CPU watchdog End of Exposure

NISP-FDIR-217 CPU watchdog End of Dither

NISP-FDIR-218 CPU watchdog End of Transmission

NISP-FDIR-220 SCE double upset

NISP-FDIR-209 large number if failed DCU/SCE accumulated in a single DPU

NISP-FDIR-210 internal DPU temperature - CPU board over lower threshold

NISP-FDIR-211 internal DPU temperature - CPU board over higher threshold

NISP-FDIR-212 internal DPU temperature - Main Power supply over lower threshold

NISP-FDIR-213 internal DPU temperature - Main Power supply over higher threshold

NISP-FDIR-214 internal DPU temperature – DBB board over threshold 1

NISP-FDIR-215 internal DPU temperature – DBB board over threshold 2

Comment by Eduardo Medinaceli Villegas [02/Jul/19]

Test of the NISP-FDIR requirements

Not all the DPU FDIRs have to be tested, because only for some of them there was a new procedure required.

NISP-FDIR that were already tested in previous campaigns are:

NISP-FDIR-201 DCU temperature over lower threshold

NISP-FDIR-202 DCU temperature over higher threshold

NISP-FDIR-203 DCU over current threshold

NISP-FDIR-204 (deleted)

NISP-FDIR-205 SCE over current threshold

NISP-FDIR-206 (deleted)

NISP-FDIR-208 (deleted)

NISP-FDIR-219 (deleted)

NISP-FDIR-221 DCU 28V

NISP-FDIR-222 DCU 5V



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 108/188

list of NISP-FDIR not possible to trigger with current configuration:

NISP-FDIR-207 DBB operation fail (impossible to trigger a hardware memory fail)**

NISP-FDIR-216 CPU watchdog End of Exposure*

NISP-FDIR-217 CPU watchdog End of Dither*

NISP-FDIR-218 CPU watchdog End of Transmission*

NISP-FDIR-220 SCE double upset (impossible to trigger a hardware memory fail)

•

- the mechanism associated to a memory fail (error signaling) was already tested, in the previous tests were real memory problems were experienced.
- for these FDIRs all related to watchdogs in the current software configuration were the ASW is loaded through the serial interface one package at the time, there were dependences related to the order or code uploading. Therefore, the change of status (new feature for these FDIRs) cannot be called at this instance. Nevertheless, watchdog mechanisms were extensively tested during previous campaigns; therefore, only the status change associated to the watchdog was not tested. All these NISP-FDIRs could be tested once that the source code is loaded in the DPU E2PROM memory.

FDIRs under test are:

NISP-FDIR-209 large number if failed DCU/SCE accumulated in a single DPU

NISP-FDIR-210 internal DPU temperature - CPU board over lower threshold

NISP-FDIR-211 internal DPU temperature - CPU board over higher threshold

NISP-FDIR-212 internal DPU temperature - Main Power supply over lower threshold

NISP-FDIR-213 internal DPU temperature - Main Power supply over higher threshold

NISP-FDIR-214 internal DPU temperature – DBB board over threshold 1

NISP-FDIR-215 internal DPU temperature – DBB board over threshold 2

Comment by Eduardo Medinaceli Villegas [02/Jul/19]

see attached document NISP-FDIR_tests_part1.pdf**

NISP-FDIR-209 large number if failed DCU/SCE accumulated in a single DPU

this FDIR was tested by powering on the focal plane (with a wrong configuration for the DCUs, lower thresholds) and consequently the DCUs started to power off.
The successful criteria was to check the final state of the DPU (MONITOR_TAB word 11), and check the active DCU-SCE mask (MONITOR_TAB word 5).

It was verified that the active DCU-SCE mask was updated accordingly; and that when the last DCU was powered off by the DPU, the final state was PARKED.

NISP-FDIRs related to temperature thresholds

• for all the cases (NISP-FDIR 2010 to 2015) the test procedure was to change the thresholds in the SYSTEM CONFIGURATION TAB to trigger the over threshold.



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 109/188

The success criteria was to see the associated action over the hardware and detect the final status of the DPU.

NISP-FDIR-210 internal DPU temperature - CPU board over lower threshold

Measured temperature of the DPU was about T~300 K Lower temperature threshold was set to T~low_th~ = 289 K Higher temperature threshold was not changed and lived at T~high th~ = 320 K

Results:

- An error of medium criticality = 2 was send with the error code 0xBBB002 (CPU temperature warning) each five seconds.
- the final state of the DPU was DPU_SAFE

NISP-FDIR-211 internal DPU temperature - CPU board over higher threshold

Measured temperature of the CPU board was about $T \sim 300 \text{ K}$ Lower temperature threshold was set to $T \sim \text{low_th} \sim 289 \text{ K}$ Higher temperature threshold was set to $T \sim \text{high_th} \sim 292 \text{ K}$

Results:

- An error of high criticality = 3 was send with the error code 0xAAA003 (CPU temperature alarm).
- the final state of the DPU was DPU SAFE

**NISP-FDIR-212 internal DPU temperature - Main Power supply over lower threshold

Measured temperature of the DCDC main power supply was about $T\sim 302~K$ Lower temperature threshold was set to $T\sim low_th\sim =289~K$ Higher temperature threshold was not changed and lived at $T\sim high_th\sim =330~K$

Results:

- An error of medium criticality = 2 was send with the error code 0xBBB04 (DCDC temperature warning) each five seconds.
- the final state of the DPU was DPU_SAFE

NISP-FDIR-213 internal DPU temperature - Main Power supply over higher threshold



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 110/188

Measured temperature of the DCDC main power supply was about $T \sim 302 \text{ K}$ Lower temperature threshold was not changed and lived at $T \sim 10 \text{ M} = 324 \text{ K}$ Higher temperature threshold was set to $T \sim 10 \text{ M} = 100 \text{ M}$

Results:

- An error of high criticality = 3 was send with the error code 0xAAA05 (DCDC temperature alarm).
- the final state of the DPU was DPU SAFE

NISP-FDIR-214 internal DPU temperature – DBB board over threshold 1

Measured temperature of the DBB was about T~ 302 K Lower temperature threshold was set to T~low_th~ = 289 K Higher temperature threshold was not changed and lived at T~high_th~ = 324 K

Results:

- An error of medium criticality = 2 was send with the error code 0xBBB03 (DBB temperature warning) each five seconds.
- the final state of the DPU was DPU_SAFE

NISP-FDIR-215 internal DPU temperature – DBB board over threshold 2

Measured temperature of the DCDC main power supply was about T \sim 302 K Lower temperature threshold was not changed and lived at T \sim low_th \sim = 320 K Higher temperature threshold was set to T \sim high_th \sim = 292 K

Results:

- An error of high criticality = 3 was send with the error code 0xAAA04 (DBB temperature alarm).
- the final state of the DPU was DPU_SAFE

Comment by Eduardo Medinaceli Villegas [03/Jul/19]

IMPLEMENTATION:

new prototype for command DRB_SHSK:

STATUS DRBSHSK(int32_t onoff, uint32_t period, uint16_t dbbTfdir, uint16_t tempfdir, uint16_t dcdcfdir, uint16_t dcufdir5v, uint16_t EOEfdir, uint16_t EODfir, uint16_t EOTfdir)

NISP-FDIR-207



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 111/188

```
In file Process.c
res = ioctl(msgbuffer.pars[0], IOC_DBB_BUF_DEQUEUE, (uint32_t)&dbb_deq);
if (res != OK)
 ERRORLOG(errno);
 ERRORLOG(PRC EDEQUEUE);
 ASWErrnoLog(errno, IDtask2EntryID(taskIdSelf()),
 taskIdSelf());
 ASWErrorCmdLog(TASKPROC,
 (uint16_t)ASW_FUNC_IOC_DBB_BUF_DEQUEUE, (int32_t)PRC_EDEQUEUE,
 crit high);
 Set ASW STATUS CPU PARKED(); /* NISP-FDIR-207 */
 abortFlag = ASW TRUE;
 break; /* Can't control. Emergency exit with abort */
and
if (*data2Pack[i].crc != crc)
 ERRORLOG(PRC ECRC);
 ASWErrnoLog(0, IDtask2EntryID(taskIdSelf()),
 taskIdSelf());
 ASWErrorCmdLog(TASKPROC, (uint16_t)0, (int32_t)PRC_ECRC,
 Set ASW STATUS CPU PARKED(); /* NISP-FDIR-207 */
crcErrorMask Global |= 1 << i;
NISP-FDIR-209
void CheckFDIRactiveDCU(void)
 if(GetNActiveDCU() == 0)
 { ASWErrnoLog(0, 0, taskIdSelf()); /* 2nd param, dcu id = 0 */
   ASWErrorCmdLog(TASKCMD, 0, (int32_t)DCUASW_ALLDCUOFF,
   crit high);
   Set_ASW_STATUS_CPU_PARKED();
```



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 112/188

```
return;
NISP-FDIR-210
In file DRB_Commands.c
ASWErrorCmdLog(TASKCMD, 0, (int32_t)WARNING_CPUTEMP, crit_high);
if (drbFDIR_CPUTemp == ASW_TRUE)
  Set_ASW_STATUS_CPU_SAFE(); }
NISP-FDIR-211
In file DRB_Commands.c
ASWErrorCmdLog(TASKCMD, 0, (int32_t)ALARM_CPUTEMP, crit_ext);
if (drbFDIR CPUTemp == ASW TRUE)
  Set_ASW_STATUS_CPU_SAFE(); }
NISP-FDIR-212
In file DRB_Commands.c
ASWErrorCmdLog(TASKCMD, 0, (int32_t)WARNING_DCDCTEMP, crit_high);
if (drbFDIR DCDCTemp == ASW TRUE)
  Set_ASW_STATUS_CPU_SAFE(); }
NISP-FDIR-213
In file DRB Commands.c
ASWErrorCmdLog(TASKCMD, 0, (int32_t)ALARM_DCDCTEMP, crit_ext); /* NISP-FDIR-
213 */
if (drbFDIR_DCDCTemp == ASW_TRUE)
  Set_ASW_STATUS_CPU_SAFE(); }
```



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 113/188

```
NISP-FDIR-214
In file DRB_Commands.c
ASWErrorCmdLog(TASKCMD, 0, (int32_t)WARNING_DBBTEMP, crit_high); /* NISP-
FDIR-214 */
if(dbbFDIR_FPGATemp == ASW_TRUE)
  Set_ASW_STATUS_CPU_SAFE(); /* to prevent generation of new data */ }
NISP-FDIR-215
In file DRB Commands.c
ASWErrorCmdLog(TASKCMD, 0, (int32_t)ALARM_DBBTEMP, crit_ext); /* NISP-FDIR-
215 */
if(dbbFDIR FPGATemp == ASW TRUE)
{ Set_ASW_STATUS_CPU_SAFE(); /* to prevent generation of new data */ }
NISP-FDIR-216
in file WdExp.c
if (EOEfdir global == ASW TRUE)
  Set_ASW_STATUS_CPU_PARKED(); }
NISP-FDIR-217
In file WdProc.c
if (EODfdir_global == ASW_TRUE)
  Set ASW STATUS CPU PARKED(); }
NISP-FDIR-218
In file WriteData.c
len = write(spwMMU_Global, (char_t *)DRB_BASE_MEM_ADDR, sumBytes);
if (len < sumBytes)
```



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 114/188

```
ERRORLOG(errno); res = ERROR; ASWErrnoLog(errno, 0,
  taskIdSelf()); ASWErrorCmdLog(TASKPROC,
  (uint16_t)ASW_FUNC_WRITETOMMU,
 (int32_t)PRC_EMMUWRITE, crit_high);
 DataTransmissionError Global = 1U; /* NISP-FDIR-218 */
in file process.c
if ((DataTransmissionError Global == 1U) && (EOTfdir global == 1))
{ taskDelay(sysClkRateGet()); Set_ASW_STATUS_CPU_PARKED(); /* NISP-FDIR-218
*/ }
NISP-FDIR-220
In file DCU Commands.c
if (error sce off ==1)
 SetSCEBootOFF(dcu id);
 DCUPowerOff(dcu id);
 SetDCUPowerOFF(dcu_id);
 CheckFDIRactiveDCU(); /* NISP-FDIR-209 */
 if (SCEUPSET_global == ASW_TRUE)
 { SetSCEBootOFF(dcu_id);
   DCUPowerOff(dcu_id);
   SetDCUPowerOFF(dcu id);
   CheckFDIRactiveDCU(); /* NISP-FDIR-209 */
```



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 115/188

[EUNIDPUASW-100] SYS_CONFIG elapsed time 1553 initialization Created: 02/Jul/19 Updated: 02/Jul/19 Resolved: 02/Jul/19	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>1553</u>
Affects Version/s:	DPU ASW v1.2.2
Fix Version/s:	DPU_ASW_v1.2.3

Туре:	Bug	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		
Environment:	in SYS_CONFIG Added elap missing communication at A COMMANDING_TABLES internal structure sysConfigT	SW boot/re-boot. W document. There w	Vord 11, removed from



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 116/188

[EUNIDPUASW-104] Error Handling Strategy: Death Report errors at initialization phase Created: 05/Jul/19 Updated: 05/Jul/19 Resolved: 05/Jul/19	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>System</u>
Affects Version/s:	DPU ASW v1.2.2
Fix Version/s:	DPU ASW v1.2.3

Туре:	New Feature	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Attachments:	DethRepTest_initErrors.pdf	
--------------	----------------------------	--

Description

The structure of the Death Report was modified to include the driver/software error trapped at the initialization phase of the DPU-ASW, where there is not yet available the 1553 interface

Comments

Comment by Eduardo Medinaceli Villegas [05/Jul/19]

new structure

struct deathRep_s //Structure to map the death report memory area

{ int32_t deathSize; aswVersion[DEATH_VERS_MAX_SIZE]; t_obt time; int32_t driver_err; driver/ASW error, in the initialization phase int32_t vecNum; char taskName[32]; ESFPPC esfRegs; REG_SET regs; TaskInfo myTaskInfoData; char *myTaskInfoStack[10000]; TaskInfo AswTasks[TASK N]; };

new parameter: int32_t driver_err;

Comment by Eduardo Medinaceli Villegas [05/Jul/19]



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 117/188

```
functions to inject error, in DPU_Utils.c:

critical error, error injected and reset of the CPU:

void UnrecoverableError(int32_t ext_err) /* errno */

{ deathRep->driver_err = ext_err; kickWatchdog_Global = ASW_FALSE; /* DPU reset */ return; }

less critical error (withou reset):

void InitializationError(int32_t ext_err)
{ deathRep->driver_err = ext_err; INIT_ERR_Global = ASW_TRUE; return; }

Comment by Eduardo Medinaceli Villegas [ 05/Jul/19 ]

Test in DethRepTest_initErrors.pdf

Test in DethRepTest_initErrors.pdf

Test in DethRepTest_initErrors.pdf
```



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 118/188

[EUNIDPUASW-105] Error Handling Strategy: new level of criticality Created: 05/Jul/19 Updated: 05/Jul/19 Resolved: 05/Jul/19	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	error_handling
Affects Version/s:	DPU ASW v1.2.2
Fix Version/s:	DPU_ASW_v1.2.3

Type:	New Feature	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

To be compliant with the NISP-FDIR requirements a new level in the criticlity of erros was addes; indicating the higher criticality level wich is translated in a C3 PUS event by ICU

Comments

Comment by Eduardo Medinaceli Villegas [05/Jul/19]

The level 3 was added:

typedef enum /* check document Space to Ground ICD Part3 (EUCL-TAST-ICD-1-003) */

{ crit_low, /* 0, recovery error, warning */ crit_medium, /* 1, require autonomous on-board action */ crit_high, /* 2, stop of functionality / FDIR, require on-ground action */ crit_ext /* 3, stop of functionality / FDIR, require on-ground action, and is requested to SpC to turn OFF the DPU */ }

criticity_t;

A loop over this error queue was implemented in the Error Handling strategy with the highest priority.

Comment by Eduardo Medinaceli Villegas [05/Jul/19]

The presented document is Proprietary information of the Euclid Consortium.



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 119/188

This level of error is applied in:

NISP-FDIR-211 NISP-FDIR-213 NISP-FDIR-215

Comment by Eduardo Medinaceli Villegas [05/Jul/19]

tets:

new error handling strategy (highest criticality level)*

The new criticality level of error was successfully tested with the 1553 interface. The highest criticality error (equal to 3) was triggered and the associated ERROR_TAB was generated and retrieved. The criticality level was correctly reported in the ICU interface and at the SCOE, correspondingly. NISP-FDIR-211 was used as a trigger to test the new error interface.



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 120/188

[EUNIDPUASW-106] Optimization tables for 16 DCUs Created: 05/Jul/19 Updated: 17/Jul/19 Resolved: 05/Jul/19	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	Commands, E2PROM
Affects Version/s:	DPU ASW v1.2.2
Fix Version/s:	DPU_ASW_v1.2.3

Type:	New Feature	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

A set of personalized parameters for each DCU were saved in the configuration file written in E2PROM. The power on procedure of the DCUs access to these configuration values.

Comments

Comment by Eduardo Medinaceli Villegas [05/Jul/19]

The following structure was prepared for all 16 DCUs in the configuration file EEF in E2PROM:

/* DCU0 OPTAB Current Thresholds:

I Threshold VDD3P3 Max=20mAmp Min=12mAmp

I Threshold VDD2P5 Max=78mAmp Min=48mAmp

I Threshold VDDIO Max=80mAmp Min=48mAmp

I Threshold VDDA Max=105mAmp Min=96mAmp I Threshold VDDA Decimal values

Max=135mAmp Min=105mAmp (Current Spike)

I Threshold VREF Max=2mAmp Min=1mAmp */



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 121/188

```
0x02, 0x22, 0x01, 0x43,
0x08, 0x50, 0x06, 0x00,
0x08, 0x88, 0x05, 0x13,
0x07, 0x00, 0x06, 0x63, /* Current Threshold VDDA Hex values 0x08, 0x99 (135mA), and
0x07, 0x00 (105mA) (Current spike)*/
0x06, 0x66, 0x03, 0xD3,
/* DCU0 OPTAB Voltage Threshold:
V Threshold VDD3P3 =3.5V
V Threshold VDD2P5 = 2.8V
V Threshold VDDIO =2.2V
V Threshold VSSIO =1.4V
V Threshold VDDA =4.0V
V Threshold VREF = 3.5V
V Threshold VDDA R =4.0V */
0x0B, 0x32,
0x09, 0x99,
0x07, 0x09,
0x04, 0x7A,
0x0C, 0xCC,
0x0B, 0x32,
0x0C, 0xCC,
/* DCU0 OPTAB V2P5,
VDDA Voltage settings: */
0x08, 0x01,
0x08, 0x01,
   Comment by Eduardo Medinaceli Villegas [ 05/Jul/19 ]
A dedicated function to retrieve the corresponding value of each DCU was refactored to take
into account the 2nd DPU, using the RT address
static uint16_t
GetDCUOptPoint(int32_t dcu_id)
uint16_t DCU_opt;
if ((RTid_Global == 3) || (RTid_Global == 4)) /* get configuration tables of DPU2 */
   { dcu_id += DETECTORS; }
```



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 122/188

```
/* Compute off-set to Start of DCU optimization section inside EEF_w16 */
DCU_opt = ( (16 * SCE_OPTAB_SIZE) + EEF_SIZE + (DCU_OPTAB_SIZE*dcu_id) );
return (DCU_opt);
```

Comment by Eduardo Medinaceli Villegas [17/Jul/19]

test:

1. Focal plane turn-on with 16 DCUs and 16 SCEs customized configuration tables (EEF)

Test 1 was repeated, with the difference that this time the configuration tables was read from E2PROM. In test 1 the power-on of the focal plane was tested using the copy in RAM of the EEF.

The DPU-ASW at the initialization phase performs a copy in RAM of the EEF from E2PROM. This procedure is performed using internally the function CPU_MBE which is the same function associated with command CPU_MBE of the 1553 command interface. The copy is performed recursively at initialization, checking first the 1'st' page of the E2PROM image (controlling crc32 of the page) and checking for segment type 3; if the required segment id is not fount or the content is corrupted (crc16 is checked) then segment id = 4 is searched. This segment is the redundant copy of the EEF file. If neither segments id 3 nor 4 are found, the 2'nd' E2PROM page is accessed and segments 3 and 4 are searched.

If both pages (1^st^ and 2^nd^ have corrupted information), the ASW startup with a copy on RAM of the EEF. In all the error cases, an error is saved (CPUASW_ESEGTYPEA=0xCCC01U, or CPUASW_ESEGTYPEB=0xCCC4DU) in the DEATH_REPORT and the generic error code (ASW_INTERROR = 0xA573F3U) is sent at the end of the DPU initialization.

The test procedure was the following:

- run SFT01 (to power on ICU)
- run SFT03 (to power on DPU, and turn on the focal plane: 6DCU/SCE)
- run SFT06 (Nominal Dither)
- run SFT07 (a shorter Dither, using simulated data)

Test Results:

- all DCUs powered on, and all SCE booted correctly
- data correctly generated by the detectors for both SFT06 and SFT07; correctly processed, and correctly transmitted. Without errors in any phase.



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 123/188

Note: in both cases, the data transmission was low! for SFT06 it takes 3 times nominal time; data transmission without errors, correctly written on IWS, sizes OK. Only very low-speed transmission. This issue comes from the setup, and not from the software; therefore, the test was evaluated as successful.

_	/-107] Initialization error injection at DPU_START Created: d: 06/Jul/19 Resolved: 06/Jul/19
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>System</u>
Affects Version/s:	DPU ASW v1.2.2
Fix Version/s:	<u>DPU ASW v1.2.3</u>

Туре:	New Feature	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Attachments:	ASWinit_fromErrorHandlingStrategy.pdf

Description

Functions:

void InitializationError(int32_t ext_err) and void UnrecoverableError(int32_t ext_err) are used to inject erros when there is not yet available the 1553 interface

Comments

Comment by Eduardo Medinaceli Villegas [06/Jul/19]

It is foreseen to have an ASW initialization without any error in 1553 interface at the final state of the ASW (ASW_STATUS_SAFE or ASW_STATUS_PARKED); neither a reboot is expected at this phase for a regular initialization. But if, known issues related to the hardware (HW) could lead to medium criticality errors at the initialization. If those are expected because



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 124/188

the completely understand anomalous behavior of the HW, the ASW could still be run with the limitations generated by the error. In any case, this condition must be carefully examined by a DPU expert.

Comment by Eduardo Medinaceli Villegas [06/Jul/19]

- 1.1. List of medium criticality errors during the ASW initialization
 In the following conditions the ASW_INITERROR will be send at the end of the ASW initialization (all from DPU Start function supervisor.c):
- not able to copy the optimization EEF file from E2PROM in RAM (wrong segment A and/or wrong segment B)
- not able to open Nominal SpW channel form DRB interface with MMU
- not able to open Redundant SpW channel form DRB interface with MMU
- not able to open SpW link of DBB interface with DCU1
- not able to open SpW link of DBB interface with DCU2
- not able to open SpW link of DBB interface with DCU3
- not able to open SpW link of DBB interface with DCU4
- not able to open SpW link of DBB interface with DCU5
- not able to open SpW link of DBB interface with DCU6
- not able to open SpW link of DBB interface with DCU7
- not able to open SpW link of DBB interface with DCU8
- not able to send VxWorks message to DBB interrupt handler (IsrSelect)
- not able to open descriptor of DCU1
- not able to open descriptor of DCU2
- not able to open descriptor of DCU3
- not able to open descriptor of DCU4
- not able to open descriptor of DCU5
- not able to open descriptor of DCU6
- not able to open descriptor of DCU7
- not able to open descriptor of DCU8
- not able to open sdc interface of DCU1
- not able to open sdc interface of DCU2
- not able to open sdc interface of DCU3
- not able to open sdc interface of DCU4
- not able to open sdc interface of DCU5
- not able to open sdc interface of DCU6
- not able to open sdc interface of DCU7
- not able to open sdc interface of DCU8
- not able to open analog interface of DCU1
- not able to open analog interface of DCU2
- not able to open analog interface of DCU3
- not able to open analog interface of DCU4
- not able to open analog interface of DCU5



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 125/188

- not able to open analog interface of DCU6
- not able to open analog interface of DCU7
- not able to open analog interface of DCU8
- not able to initialize DRB memory
- not able to initialize DBB memory
- not able to receive VxWorks spv msg from ErrorHandling task
- not able to receive VxWorks spv msg from IsrSelect task
- not able to receive VxWorks spv msg from IsrHandler task
- not able to receive VxWorks spv_msg from HW_watchdog task
- not able to initialize the CPU load task
- not able to receive VxWorks spv_msg from ASW1553 task
- not able to send VxWorks spv_msg from HW_watchdog task handler

For the rest of the initialization errors, the usual 1553 interface is used (ERROR_TAB).

1.2. List of unrecoverable errors during the ASW initialization

The following is the list of critical/unrecoverable errors causing the DPU-ASW malfunctioning; the internal ASW action is to trigger a CPU reboot saving the internal error in the DEATH REPORT (from DPU_Start function supervisor.c):

- not able to open redundant SpW channel (in the MMU interface), after failing to open the Nominal SpW channel
- not able to open DRB Diagnostic device
- not able to open DRB HSK analog device
- not able to open DRB Sync device
- not able to open DBB Diagnostic device
- not able to open DCU Broadcast device
- not able to open DCU sdc Broadcast device
- not able to enable DRB Sync
- not able to install and activate DRB driver
- not able to activate OBT driver
- not able to install and activate DBB driver
- not able to install and activate DCU driver
- not able to create spv_msg VxWorks message queue
- not able to spawn Error Handling task
- not able to spawn Select task
- not able to spawn Isr task
- not able to spawn Watchdog system task
- not able to create VxWorks semaphore semLockDitherTable
- not able to create VxWorks semaphore semLockProcParamTable
- not able to create VxWorks semaphore semLockSysConfigTable
- not able to create VxWorks semaphore semLockAswStatus
- not able to create VxWorks semaphore semLockDcu



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 126/188

- not able to create VxWorks semaphore semLockTimePackage
- not able to spawn Watchdog 1553 task

from function ASW1553.c:

- not able to create VxWorks message queue mcr1553 msg
- not able to attach ISR to YF_INT of the 1553 interface
- not able to attach ISR to MSG_INT of the 1553 interface
 - not able to initialize Remote Terminal of the 1553 interface
 - not able to enable any of the 1553 sub-address to transmission
 - not able to enable any of the 1553 sub-address for receive
 - not able to configure mode code 1 of the 1553 interface
 - not able to configure mode code 17 of the 1553 interface
 - not able to legalize any of the sub-addresses (29, 18, 17) of the 1553 interface
 - not able to legalize any of the mode codes (1, 17) for broadcast of the 1553 interface
 - not able to send VxWorks spv_msg from 1553 task handler



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 127/188

[EUNIDPUASW 10/Jul/19 Resolve	/-108] Processing m chi2 rounding Created: 10/Jul/19 Updated: d: 10/Jul/19
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	Processing
Affects Version/s:	DPU ASW v1.2.2
Fix Version/s:	DPU ASW v1.2.3

Туре:	New Feature	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		


Attachments:	ProcAlgo_increaseresolut_chi2.pdf	ratio.png



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 128/188

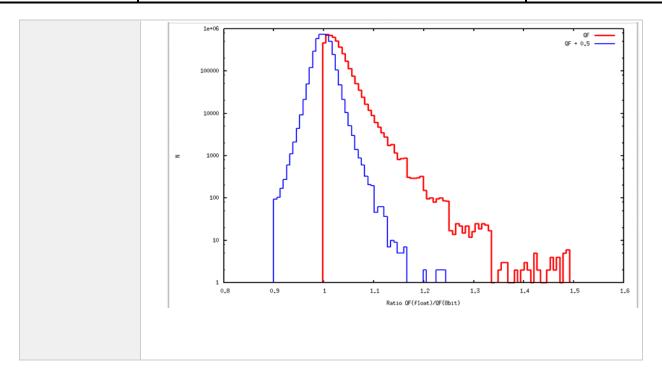

Description

Due to casting chi2 into uchar_t (8bit) some resolution is lost. To increase the resolution of the rounding before the cast, a +0.5 is added

Comments

Comment by Eduardo Medinaceli Villegas [10/Jul/19]

chi2 definition unvariable, line 385

 $chi2Temp = (((2.0F*gain) / (alfa + 1.0F)) * ((float32_t)nGroupsMin1 * fact - (ramp[nGroupsMin1] - ramp[0])));$

added +0.5 before the cast, line 407

p_chi2[pix] = (uchar_t)(chi2Temp + 0.5); /* increase resolution of rounding in 8 bit */



Ref: EUCL-OPD-CS-7-001

Issue: 2.0


Date: 25/03/2020 Page: 129/188



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 130/188

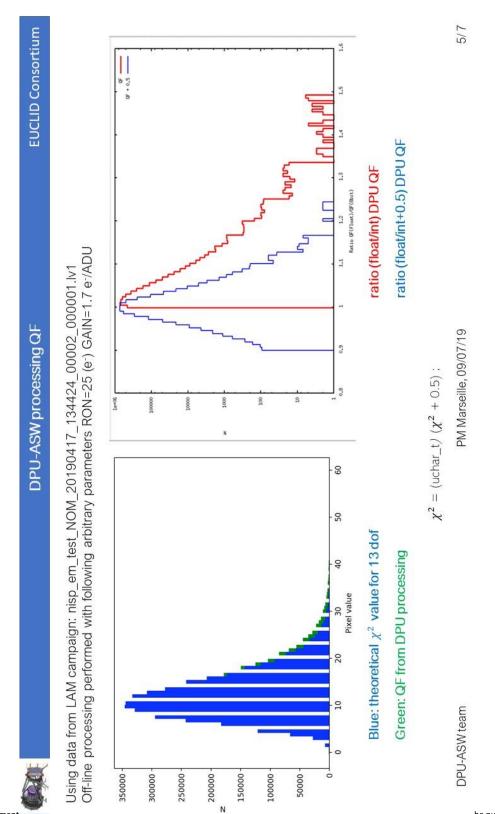



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 131/188

[EUNIDPUASW-101] CPU_WDG added limits for parameter: cpu scrubbing period, command acceptance. Changed DPU_STATUS_TAB format Created: 02/Jul/19 Updated: 02/Jul/19 Resolved: 02/Jul/19	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>Commands</u>
Affects Version/s:	DPU ASW v1.2.2
Fix Version/s:	DPU_ASW_v1.2.3

Туре:	New Feature	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		
Environment:	added min and max values fo	r CPU scrubbing	period

Attachments:	CPU WDG.pdf	STATUS TAB.pdf	
--------------	-------------	----------------	--

Comments

Comment by Eduardo Medinaceli Villegas [02/Jul/19]

 $COMMAND_t \ cpuWDG_cmd = \{\{13, 1, 0\}, \{\{1, 0, 1\}, \{1, 0, 1\}, \{1, 0, 0xFFFF\}, \{1, 0, 0xFFFF\}\}, \{1, 0, 0xFFFF\}\}, \{1, 0, 0xFFFF\}\}, \{1, 0, 0xFFFF\}\}$

(ASW_STATUS_MANUAL | SCE_EEF_STATUS_IDLE | ASW_STATUS_CPU_SAFE | ASW_STATUS_CPU_PARKED)};

Comment by Eduardo Medinaceli Villegas [02/Jul/19]

reference https://www.ict.inaf.it/redmine/issues/1882

during the test at LAM were verified some issues with command CPU WDG.

1. the 3rd argument of the command (CPU scrubbing period) send by ICU/SCOE was set to hours.

Due to changes in the documentation (commanding tables v2.8), where the period was changed from hours to arbitrary units [a.u.] (depending on the CPU board frequency, the total size of the



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 132/188

memory in cache lines) the period was not updated to a.u. From the DPU side, the command is implemented to be programmed using u.a for the scrubbing period.

Therefore, the parameter send by ICU/SCOE must be coherent with that convention. Default values for these parameters are:

CPU scrubbing flag default = 25749 (corresponding to a complete day time lapse), and CPU res-sync period = 10 s

2. the associated telemetry of the DPU to this command, which echoes the programmed parameters in the DPU_STATUS_TAB was kept in hours. And was used a single 16bit register to copy both the scrubbing period (parameter 3) and the CPU resrync time (parameter 4): telemetry_register = ((cpu_resync << 8) | cpu_scrub);

Under the convention of point 1. this is a bug.

The proposal is to add a 16bit register in the DPU_STATUS_TAB (changing the 1553 interface); nevertheless, this should be the option with a less impact for the functionality of NISP (instead of changing CPU_WDG command expressing the scrubbing time in hours. This implies truncation of floating point operations)

```
{{The new format of the DPU_STATUS_TAB should include new 16bit 1553 word, then the final length of the table should be of }} 
{{ 26 words (starting from 0). Where:}} 
{{ word 25 = CPU scrubbing period}} 
{{ word 26 = CPU re-sync period}} 
{{ all the other words of the table remain unchanged.}}
```

Documentation (Commanding tables) will be updated accordingly, the attached pdf files (CPU_WDG.pdf, and STATUS_TAB.pdf) show the updated tables.

The following modification to the code will be traced with the configuration control toolkit (Jira) of the DPU:

```
dpu_StatusTabGlobal.ASWWDGREG1 = wdEOE | (wdEODP << 1);
dpu_StatusTabGlobal.ASWWDGREG2 = scrubFlag;
dpu_StatusTabGlobal.ASWWDGREG3 = cpuTRC;
```

see attached documents: CPU_WDG.pdf STATUS_TAB.pdf



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 133/188

•	/-102] added error in Death Report at ASW initialization performing ted: 05/Jul/19 Updated: 05/Jul/19 Resolved: 05/Jul/19
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>System</u>
Affects Version/s:	DPU ASW v1.2.2
Fix Version/s:	DPU_ASW_v1.2.3

Туре:	New Feature	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		
Environment:	During initialization of the A segment A and in case it is no retrieved from segment B. If was not ok, the 3rd copy in R In both failure cases, errors a the Death Report; it is done to 1553 link available.	ot found, or not cor also in this case the AM is used. re signaled in the d	rect (wrong crc); then is ere is not found or neither edicated driver error field in

Comments

Comment by Eduardo Medinaceli Villegas [05/Jul/19]

Errors are injected using function InitializationError(ERROR), using ERROR codes: CPUASW_ESEGTYPEA and CPUASW_ESEGTYPEB respectively.

Both errors were added in the error list as:

#define CPUASW_ESEGTYPEA (CPUASW_OK + 0x01U) Wrong segment type A for EFF and

#define CPUASW_ESEGTYPEB (CPUASW_OK + 0x04DU) Wrong segment type B for EEF (using RAM copy of EEF)

Comment by Eduardo Medinaceli Villegas [05/Jul/19]



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 134/188

```
/* copy EEF from E2PROM (N or R) to RAM (to prevent misalignment), if fails keep RAM
version */
res = CPUMBE(EEF_SEG_TYPEA);
if (res != OK)
  ERRORLOG(CPUASW_ESEGTYPEA);
  res = CPUMBE(EEF_SEG_TYPEB);
 if(res != OK)
     ERRORLOG(CPUASW ESEGTYPEB);
     #ifdef ASW DEBUG
     printf("CPUMBE: using EEF_boot_tab from RAM \n");
     #endif
     InitializationError(CPUASW_ESEGTYPEB);
 }
 else
 #ifdef ASW DEBUG
  printf("CPUMBE: Copy EEF_boot_tab from EEF_SEG_TYPE = (CPUMBE) %d \n",
 EEF SEG TYPEB); #endif
  InitializationError(CPUASW_ESEGTYPEA);
else
 #ifdef ASW DEBUG
 printf("CPUMBE: Copy EEF_boot_tab from EEF_SEG_TYPE = (CPUMBE) %d \n",
 EEF SEG TYPEA);
 #endif
```



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 135/188

-	V-103] added GainFactor and ReadOutNoise in digital telemetry Created: od: 05/Jul/19 Resolved: 05/Jul/19
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	None
Affects Version/s:	DPU ASW v1.2.2
Fix Version/s:	<u>DPU_ASW_v1.2.3</u>

Туре:	New Feature	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	0 minutes		
Time Spent:	Not Specified		
Original Estimate:	1 day		

Attachments:	DigitalTLM.pdf

Description

it was found necessary to have these values written in the digital telemetry in order to have all the necessary information inside the single SpW packet, to cross-check the processing.

Comments

Comment by Eduardo Medinaceli Villegas [05/Jul/19]

In Process.c added

finalDataPack.uncHeader.telemetryDigital[40] = procParamTabGlobal.Ron_Det[curDet]; finalDataPack.uncHeader.telemetryDigital[41] = procParamTabGlobal.Gain_Det[curDet];



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 136/188

•	V-109] Toogle_ASW_STATUS_CPU_PARKED instead of Set in both WD Updated: 22/Jul/19 Resolved: 22/Jul/19
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>System</u>
Affects Version/s:	DPU ASW v1.2.2
Fix Version/s:	DPU_ASW_v1.2.3

Туре:	New Feature	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

Changed Toggle_ASW_STATUS_CPU_PARKED(); instead of Set_ASW_STATUS_CPU_PARKED();

in both Eo*_WDs

because SCE should be in IDLE state after the ResetDcuAndDbb()



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 137/188

[EUNIDPUASW	[EUNIDPUASW-110] NISP-FDIR-217 Created: 22/Jul/19 Updated: 05/Sep/19 Resolved: 22/Jul/19		
Status:	Done		
Project:	Application software for the Euclid NISP DPU		
Component/s:	<u>System</u>		
Affects Version/s:	DPU_ASW_v1.2.2		
Fix Version/s:	DPU ASW v1.2.3		

Туре:	New Feature	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

When the EoD_WD expires the DPU should transit to ASW_PARKED; just after the VxWorks message CMD_PRC_ABORT is handled ResetDcuAndDbb() taking the DPU into OBSERVATION_WAITING and SCE_IDLE which takes some time to be excuted. Then a 2 s delay was added before the final change of status

Comments

Comment by Eduardo Medinaceli Villegas [22/Jul/19]

```
if (EODfdir_global == ASW_TRUE)
{  taskDelay(sysClkRateGet() * 2); // wait for ResetDcuAndDbb() to finish
    Toggle_ASW_STATUS_CPU_PARKED(); // NISP-FDIR-217
}
```

The 2s delay was tested using the DPU-EQM equipped with 6 SCE and has to be tested/tunned with 8

Comment by Eduardo Medinaceli Villegas [05/Sep/19]

While performing a test with the SSS simulator at LAM using the DPU-EQMwith 8 DCU/SCE it was seen that the transition to PARKED occurs but before the finalization of the DCUABORT which ends in an OBSERVATION state.



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 138/188

Therefore, the task delay was increased to 4s to prevent guarantee that transition to PARKED happens after the abort operations.

•	[EUNIDPUASW-111] change of status after DCUDABT Created: 22/Jul/19 Updated: 22/Jul/19 Resolved: 22/Jul/19		
Status:	Done		
Project:	Application software for the Euclid NISP DPU		
Component/s:	<u>System</u>		
Affects Version/s:	DPU ASW v1.2.2		
Fix Version/s:	DPU_ASW_v1.2.3		

Туре:	New Feature	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

Added change of statuses to ASW_STATUS_OBS_WAIT() if not in MANUAL and SCE_EEF_STATUS_IDLE()

in DCUDABT called internally by the ASW when EO*_WD are triggered

Comments

Comment by Eduardo Medinaceli Villegas [22/Jul/19]

in this way when any of the WD will be triggered, the ASW will perform a full clean of the ongoing Dither.

It was already OK for EoE_WD and now is added to EoD_WD

Comment by Eduardo Medinaceli Villegas [22/Jul/19]

if ((AswStatusFlag_Global & ASW_STATUS_MANUAL) != ASW_STATUS_MANUAL) /* if comes from MANUAL stay in MANUAL */

// set-up of state OBSERVATION WAITING, without test on res of DCU_dabt Toggle_ASW_STATUS_OBS_WAIT();

The presented document is Proprietary information of the Euclid Consortium.



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 139/188

//set-up of state SCE EEF IDLE Toggle_SCE_EEF_STATUS_IDLE();

•	[EUNIDPUASW-112] DCU Error Flag in digital telemetry Created: 22/Jul/19 Updated: 27/Aug/19 Resolved: 22/Jul/19		
Status:	Done		
Project:	Application software for the Euclid NISP DPU		
Component/s:	Processing, telemetry		
Affects Version/s:	DPU ASW v1.2.2		
Fix Version/s:	<u>DPU ASW v1.2.3</u>		

Туре:	Bug	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	0 minutes		
Time Spent:	Not Specified		
Original Estimate:	1 day		

Attachments:	IWS_ERROR.PNG
--------------	---------------

Description

The DCU's error flag array data2Pack[i].errorTab was not correctly copied in the scientific telemetry.

Comments

Comment by Eduardo Medinaceli Villegas [22/Jul/19]

The error flag was correctly copied for each group

```
for (i = 0; i < dithConfTabLocal.Exposures[nExp].Groups; i++)
{
    memcpy((void *)&tmpErrors[i * DP_ERR_TAB_SIZE], (void *)data2Pack[i].errorTab,
    DP_ERR_TAB_SIZE);
}</pre>
```



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 140/188

but the size was not correct, the correct one is:

ErrFlagSizeNgroups = DP_ERR_TAB_SIZE * dithConfTabLocal.Exposures[nExp].Groups;


this size is used in both cases: compression failed, or flag of compression not enabled:

final Data Pack.unc Header.cmp Err Size = Err Flag Size Ngroups;

memcpy(finalDataPack.cmpErrors, tmpErrors, finalDataPack.uncHeader.cmpErrSize);

Comment by Eduardo Medinaceli Villegas [27/Aug/19]

the software was updated on the IWS as well. Now it contains an array of Ngroups times 1024

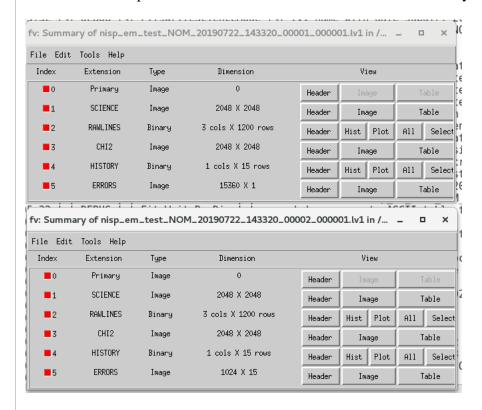

"Hi William,

Eduardo is testing a new version of the DPU ASW that is generating for the ErrorFlag data a vector of 1024xNumGroups values. The current version of the IWS software saves these values into a Nx1 image (top image in annex).

Another possibility is to create a 1024xNumGroups image (bottom image in annex). Please let me know.

Cheers.

Massimo"



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 141/188

Generated at Wed Mar 25 14:41:15 CET 2020 by Eduardo Medinaceli Villegas using Jira 8.7.1#807001-sha1:03e3702defc755fa4d5476f90791e76696be4d38.

10. Affect version DPU_ASW_v1.2.3 fixed version DPU_ASW_v1.2.4 change log

_	[EUNIDPUASW-113] ResetDcuAndDbb producing a change of status Created: 15/Oct/19 Updated: 06/Nov/19 Resolved: 15/Oct/19		
Status:	Done		
Project:	Application software for the Euclid NISP DPU		
Component/s:	1553, Processing		
Affects Version/s:	DPU ASW v1.2.3		
Fix Version/s:	DPU ASW v1.2.4		

Туре:	Bug	Priority:	Minor	
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas	
Resolution:	Done	Votes:	0	
Labels:	None	None		
Remaining Estimate:	Not Specified			
Time Spent:	Not Specified			
Original Estimate:	Not Specified			
Environment:	added change of status to OBSERVATION_WAIT (if not coming from MANUAL state) and SCE_IDLE after function execution			

Comments

Comment by Eduardo Medinaceli Villegas [06/Nov/19]

using the same strategy for the EoE_WD and EoD_WD i.e. link change of status to previous status, and for the transition to SAFE

```
if ( ((AswStatusFlag_Global & ASW_STATUS_CPU_SAFE) != ASW_STATUS_CPU_SAFE)
OR ((AswStatusFlag_Global & ASW_STATUS_CPU_PARKED) !=
ASW_STATUS_CPU_PARKED) ) /** TODO test // Eo*_WD case */
{
    if ((AswStatusFlag_Global & ASW_STATUS_MANUAL) != ASW_STATUS_MANUAL)
    /* if comes from MANUAL stay in MANUAL */
    { /* set-up of state OBSERVATION WAITING, without test on res of DCU_dabt */
```



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 142/188

Toggle_ASW_STATUS_OBS_WAIT();
} /* set-up of state SCE EEF IDLE */
Toggle_SCE_EEF_STATUS_IDLE();



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 143/188

[EUNIDPUASW-115] acceptance status for CPU_SST Created: 15/Oct/19 Updated: 15/Oct/19 Resolved: 15/Oct/19		
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	<u>Commands</u>	
Affects Version/s:	DPU ASW v1.2.3	
Fix Version/s:	DPU_ASW_v1.2.4	

Туре:	Bug	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		
Environment:	added acceptance status ASW_STATUS_OBS_PROC to command CPU_SST		



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 144/188

[EUNIDPUASW 17/Oct/19 Resolv	V-118] DCUDABT removed change of status Created: 15/Oct/19 Updated: red: 15/Oct/19
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	System, telemetry
Affects Version/s:	DPU ASW v1.2.3
Fix Version/s:	DPU_ASW_v1.2.4

Туре:	Bug	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

because this function is called inside a loop, the status change is removed and done by calling function ResetDcuAndDbb()

Comments

Comment by Eduardo Medinaceli Villegas [15/Oct/19]

removed:

if ((AswStatusFlag_Global & ASW_STATUS_MANUAL) != ASW_STATUS_MANUAL) /* if comes from MANUAL stay in MANUAL */

{ /* set-up of state OBSERVATION WAITING, without test on res of DCU_dabt */ Toggle_ASW_STATUS_OBS_WAIT(); }

/* set-up of state SCE EEF IDLE */
Toggle_SCE_EEF_STATUS_IDLE();

this now is done by Processing::ResetDcuAndDbb()



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 145/188

Comment by Eduardo Medinaceli Villegas [17/Oct/19]

An exception was added for the transition to SAFE case, in function ResetDcuAndDbb() after executing DCUDABT for all detectors (that don't change the status):

```
if ((AswStatusFlag_Global & ASW_STATUS_CPU_SAFE) != ASW_STATUS_CPU_SAFE)

/* if comes from SAFE stay in SAFE */

{
    if ((AswStatusFlag_Global & ASW_STATUS_MANUAL) != ASW_STATUS_MANUAL)
    /* if comes from MANUAL stay in MANUAL */

{        /* set-up of state OBSERVATION WAITING, without test on res of DCU_dabt */
        Toggle_ASW_STATUS_OBS_WAIT();    }
        /* set-up of state SCE EEF IDLE */
        Toggle_SCE_EEF_STATUS_IDLE();
        /* Eo*_WD if triggered will wait 30s for the DCUDABT finalization */
}
```

Generated at Wed Mar 25 14:42:28 CET 2020 by Eduardo Medinaceli Villegas using Jira 8.7.1#807001-sha1:03e3702defc755fa4d5476f90791e76696be4d38.



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 146/188

11. Affect version DPU_ASW_v1.2.4 fixed version DPU_ASW_v1.2.4.1 change log

[EUNIDPUASW-120] new SCE/SCA configuration for room temperature operations Created: 18/Oct/19 Updated: 11/Nov/19 Resolved: 18/Oct/19		
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	E2PROM, System	
Affects Version/s:	DPU_ASW_v1.2.4	
Fix Version/s:	DPU ASW v1.2.4.1	

Туре:	New Feature	Priority:	Critical	
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas	
Resolution:	Done	Votes:	0	
Labels:	None	None		
Remaining Estimate:	Not Specified			
Time Spent:	Not Specified			
Original Estimate:	Not Specified			
Environment:	new time constraints for operations of Flight model SCE-SCA at room temperature			

Attachments:	image-2019-10-18-10-04-13-515.png
--------------	-----------------------------------

Description

Due to a time constraint of the operations of flight model detectors (SCE/SCA) at room temperature given by JPL, it was decided by NISP (ESA and JPL) to change the default configuration of the DSub bias of the SCE in order to have:

 Δ Voltage = DSub - VReset ~ 50 mV

Comments

Comment by Eduardo Medinaceli Villegas [18/Oct/19]



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 147/188

The new value of Dsub bias (register 0x6002 of the SCE) written on DPU E2PROM and loaded by default in the SCE bootstrap operation is:

Dsub = 0x80B4 (HEX) [ADU] = 351 [mV]

The VReset bias (register 0x6000 of the SCE) was not changed from the default value of VReset = 0x8099 (HEX) [ADU] = 300 [mV]

Therefore, the resulting difference is $\Delta Voltage = DSub - VReset \sim 51 \text{ mV}$

Comment by Eduardo Medinaceli Villegas [18/Oct/19]

Using Jade2 Prototype Board with IDE Software from Teledyne, the imposed DSub value was read directly from the SCE, see figure 2. The measured value for the delta bias was ΔV oltage = 52.8 [mV].

This result was obtained with a procedure described in section 4 (using a default set of conversion factors from ADU to mV); the same note quoted in that section is valid here:

it is important to remark that the used conversion factors are representative, they will be replaced with optimized values for each SCE/SCA (16x) flight models (Teledyne/Markury, Hardware(SCE-SCA)/Firmware V3.1 Software, suppliers), as well as the conversion factors for the SCE bias voltages (VDDA, VDDIO, VREF) of the DCUs (16x) flight models (OHB Hardware supplier).


Therefore, engineering values in telemetry can slightly change according to the set of conversion factors used. This ambiguity will disappear when decalibrations dedicated to each Flight SCE/SCA will be applied. In any case, the ΔV oltage is guaranteed to be equal to ~ 51 mV.



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 148/188

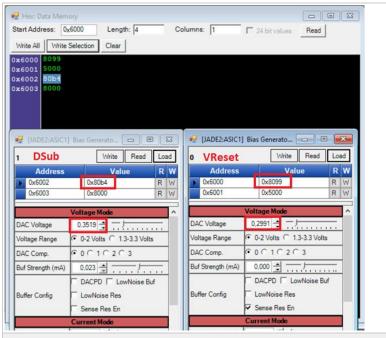

Comment by Eduardo Medinaceli Villegas [18/Oct/19]

Internal note SCE/SCA setup for cold Temperature operations ~ 135K was updated accordingly

[EUNIDPUASW 15/Oct/19	/-116] multiple RT actions Created: 15/Oct/19 Updated: 11/Nov/19 Resolved:
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	1553, Commands
Affects Version/s:	DPU_ASW_v1.2.4
Fix Version/s:	DPU ASW v1.2.4.1

Туре:	Bug	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 149/188

Environment:

added internal execution of a command at the same CF

Comments

Comment by Eduardo Medinaceli Villegas [15/Oct/19]

aligned execution time of commands for all RTs



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 150/188

[EUNIDPUASV 11/Nov/19 Resolv	V-119] Synchronization mechanism modified Created: 15/Oct/19 Updated: ved: 15/Oct/19
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>System</u>
Affects Version/s:	DPU ASW v1.2.4
Fix Version/s:	<u>DPU_ASW_v1.2.4.1</u>

Type:	New Feature	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	synchronization		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Attachments:	acceptancy_window.jpg	newSyncMechanism.jpg	test_postNRB.pdf

Description

increased the acceptancy window of the synchronization impulse for the Slave unit to 1s

Comments

Comment by Eduardo Medinaceli Villegas [15/Oct/19]

in function SCE_exp added test to function SynEnable()

res = SyncEnable();

/* Broadcast: we don't check. An error would be reported by LOGERROR */

if(res != OK)

{ return res; }

and added delay (SyncSlaveDelay_Global =1s) for the Slave unit to way for sync pulse:

timeDelay = SyncDelay_Global;

taskDelay(timeDelay); /* Wait ExpW default = SyncDelay_Global ms before sync pulse */



Ref: EUCL-OPD-CS-7-001

Issue:

25/03/2020 Date: 151/188 Page:


```
/* Send sync signal through DRB if master */
if (IsMaster_Global == ASW_TRUE)
  res = SyncSend();
  #ifdef ASW DEBUG
  printf("DPU_BRD_DEV::Master:: Sync to DRB sent successfully\n");
else
{ taskDelay( SyncSlaveDelay_Global ); }
   Comment by Eduardo Medinaceli Villegas [ 15/Oct/19 ]
```

NCR open and documentation produced, see file test_postNRB.pdf

Comment by Eduardo Medinaceli Villegas [06/Nov/19]

see pictures attached:

- newSyncMechanism.jpg = UML diagram of the new synchronization mechanism
- acceptancy window.jpg

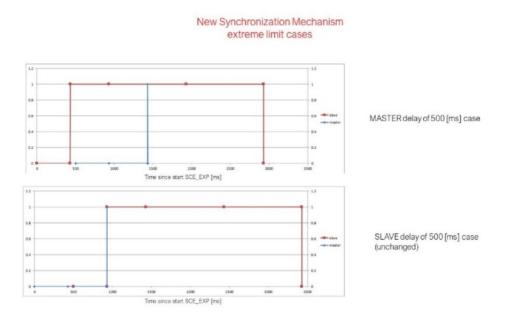


The presented document is Proprietary information of the Euclid Consortium.



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 152/188

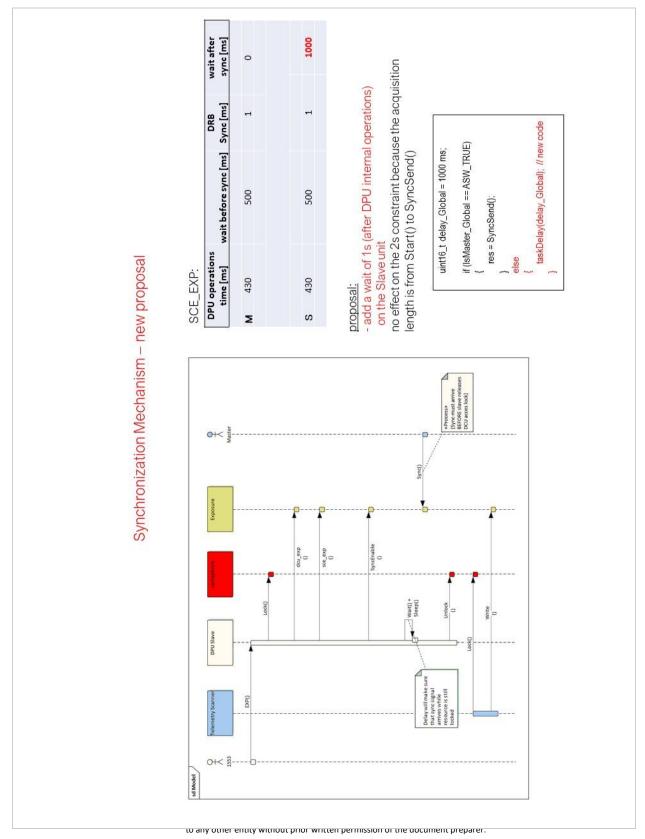



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 153/188

[EUNIDPUASW-117] added global variables for fixed time delays Created: 15/Oct/19 Updated: 11/Nov/19 Resolved: 15/Oct/19		
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	<u>System</u>	
Affects Version/s:	DPU ASW v1.2.4	
Fix Version/s:	DPU ASW v1.2.4.1	

Туре:	New Feature	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

added global variables in order to allow the modification of this values in RAM runtime

Comments

```
added:
/* TASK DELAYS */
/* synchronization */
uint32_t SyncDelay_Global; /* common delay before sync send */
uint32_t SyncSlaveDelay_Global; /* Slave delay before sync send */
/* DCU exp */
uint32_t DCUpktgenDelay_Global; /* Start simulated DCU frames */
uint32_t DCUframegroupDelay_Global;
/* wd */
uint32_t EOEwdDelay_Global;
uint32_t EOEwdDelay_Global;
uint32_t EOTwdDelay_Global;
uint32_t EOTwdDelay_Global;
uint32_t EOTwdDelay_Global;
uint32_t EOTwdDelay_Global;
/* state transitions */
uint32_t GoToSafeDelay_Global;
```



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 154/188

```
/* housekeeping scanner */
uint32 t HSKdelay Global;
uint32 t HSKfreq Global;
/* SpW id depending on RT */
uint32 t spwid Global;
   Comment by Eduardo Medinaceli Villegas [ 15/Oct/19 ]
added initialization in InitGlobalVars.c
/* TASK DELAYS */
/* synchronization */
SyncDelay_Global = ( sysClkRateGet()/2U ); /* 500 ms */
SyncSlaveDelay_Global = ( sysClkRateGet()1U ); / 1000 ms */
/* DCU exp */
DCUpktgenDelay Global = ( sysClkRateGet()5U ); / Start simulated DCU frames */
DCUframegroupDelay Global = ((sysClkRateGet()/2U) + (sysClkRateGet()2U)); / 2.5s delay
/* wd */
EOEwdDelay Global = (sysClkRateGet()30U); / wait for ResetDcuAndDbb() to finish */
EODwdDelay Global = (sysClkRateGet()30U); / wait for ResetDcuAndDbb() to finish */
EOTwdDelay Global = ( sysClkRateGet()*1U );
/* state transitions */
GoToSafeDelay_Global = (sysClkRateGet()/2);
/* housekeeping scanner */
HSKdelay_Global = ( sysClkRateGet()*5 );
HSKfreq Global = ( sysClkRateGet()*1 );
return:
   Comment by Eduardo Medinaceli Villegas [17/Oct/19]
added dedicated global variables for delays in the SCE IPCexp:
SyncDelayIPC_Global = ( sysClkRateGet()/2U ); /* 500 ms */
SyncSlaveDelayIPC_Global = ( sysClkRateGet()1U ); / 1000 ms */
   Comment by Eduardo Medinaceli Villegas [17/Oct/19]
added global var for delay in DCU_dabt:
DABTdelay_Global = ( sysClkRateGet()*3U );
   Comment by Eduardo Medinaceli Villegas [06/Nov/19]
removed:
uint32 t EOEwdDelay Global;
uint32_t EODwdDelay_Global;
also initialization
because not longer used for the EoE and EoD_WD FDIR strategy
```



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 155/188

Generated at Wed Mar 25 14:43:12 CET 2020 by Eduardo Medinaceli Villegas using Jira 8.7.1#807001-sha1:03e3702defc755fa4d5476f90791e76696be4d38.

12. Affect version DPU ASW v1.2.4.1 fixed version DPU ASW v1.2.5 change log

•	V-114] strategy for NISP-FDIR of EoE_WD and EoD_WD Created: ed: 11/Nov/19 Resolved: 15/Oct/19
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>1553</u> , <u>System</u>
Affects Version/s:	DPU ASW v1.2.4.1
Fix Version/s:	<u>DPU ASW v1.2.5</u>

Туре:	Bug	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		
Environment:	added taskDelay(sysClkRate /* wait for ResetDcuAndDbb if Eo_(E or D) is enabled		

Description

for EoE_WD:

function WdExpHandler changes the status to PARKED, and the Process::ResetDcuAndDbb perform a test over this state, and do not change it

Comments

Comment by Eduardo Medinaceli Villegas [06/Nov/19]

for EoD WD:

function WdProcHandler changes the status to PARKED, and the Process::ResetDcuAndDbb perform a test over this state, and do not change it



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 156/188



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 157/188

[EUNIDPUASW-121] dump of SCE microcode in CPU_MDMUP Created: 11/Nov/19 Updated: 11/Nov/19 Resolved: 11/Nov/19	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	Commands, E2PROM
Affects Version/s:	DPU ASW v1.2.4.1
Fix Version/s:	DPU_ASW_v1.2.5

Туре:	Bug	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

CPU_MDUMP(uint16_t hardev, uint16_t length, uint16_t msword, uint16_t lsword) command in the case dev = 5 retrieves the EEF microcode from E2PROM.

The dedicated function accessing the E2PROM is

GetRawE2PROMEEF(length, lsword); which arguments are length, and offset.

The offset is intended for DUMP inside a loop where the new start address is the previous on plus an offset. Because of the total length is always minor to the unin16_t value = 65536, the offset will always be lower. Therefore, only one uin16_t word is enough for this parameter. ICU when performing recursive DUMPS save this info in the address (composed of lswrod and msword); then if for this case the offset value will be stord in the lsword.

Comments

Comment by Eduardo Medinaceli Villegas [11/Nov/19]

```
Then it was changed the second argument of function GetRawE2PROMEEF
STATUS CPUMDUMP(uint16_t hardev, uint16_t length, uint16_t msword, uint16_t lsword)
{ if (hardev == 5U) /* EEF */
{ res = GetRawE2PROMEEF(length, lsword);
} ...
}
```



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 158/188

Generated at Wed Mar 25 14:43:56 CET 2020 by Eduardo Medinaceli Villegas using Jira 8.7.1#807001-sha1:03e3702defc755fa4d5476f90791e76696be4d38.

13. Affect version DPU_ASW_v1.2.5 fixed version DPU_ASW_v1.2.5.1 change log

[EUNIDPUASW-122] History telemetry (scientific file) Created: 26/Nov/19 Updated:			
26/Nov/19 Resolved: 26/Nov/19			
Status:	Done		
Project:	Application software for the E	uclid NISP DPU	
Component/s:	<u>telemetry</u>		
Affects Version/s:	DPU_ASW_v1.2.5		
Fix Version/s:	DPU ASW v1.2.5.1		
Type:	New Feature Priority: Minor		
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas

Туре:	New Feature	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	0 minutes		
Time Spent:	Not Specified		
Original Estimate:	1 day		


Attachm ents:	SCA_T1.jpg	SCA_T2.jpg



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 159/188

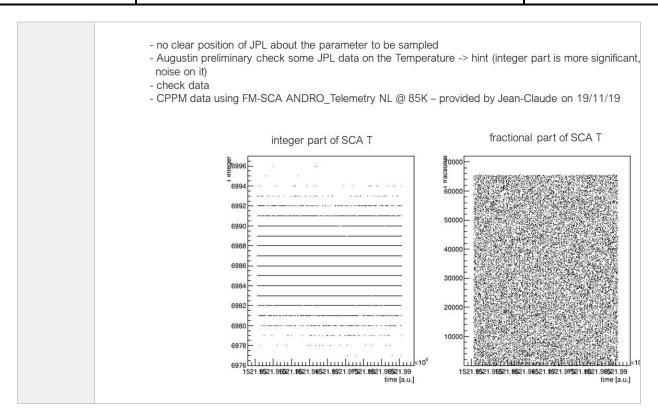




Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 160/188

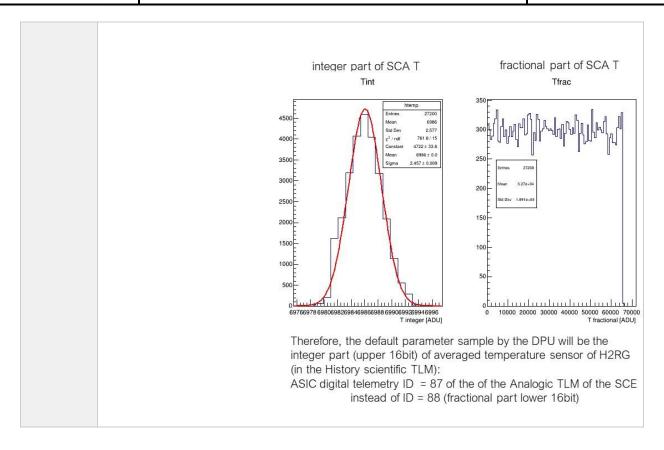

Description

After a discussion and CPPM data (flight SCS) analysis with Markus Loose and JPL staff it was decided to save in the history telemetry array of the scientific package the integer part (16bit) of the SCA Temperature

Comments

Comment by Eduardo Medinaceli Villegas [26/Nov/19]

initialization of global table changed to:

macc_Global.TLM_history_sel = 87L; /* integer part of the SCA Temperature */



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 161/188

[EUNIDPUASW	V-124] DARK modes Created: 09/Dec/19 Updated: 09/Dec/19 Resolved: 09/Dec/19
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	Processing
Affects Version/s:	DPU_ASW_v1.2.5
Fix Version/s:	DPU ASW v1.2.5.1

Туре:	New Feature	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

it was requested to allow different types of DARK sub-modes i.e. spectro and photo

Comments

Comment by Eduardo Medinaceli Villegas [09/Dec/19]

added switch of instrument sub-modes SPECTRO_DARK and PHOTO_DARK to ENG_DARK_SPECTRO and ENG_DARK_PHOTO modes.

In DPU_ASW_types.h:

/* Instrument sub modes */
typedef enum tag_ins_sub_mode

{ MODE_VOID = 0U, /* drop from documentation */ SPECTRO_GRISM_R_0, /* science */ SPECTRO_GRISM_R_270, /* science */ SPECTRO_GRISM_R_180, /* science */ SPECTRO_GRISM_B_0, /* science */ PHOTO_FILTER_Y, /* science */ PHOTO_FILTER_J, /* science */ PHOTO_FILTER_H, /* science */ SPECTRO_DARK, /* dark */ PHOTO_DARK /* dark */ }

ins_sub_mode_t;



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 162/188

```
and in Process.c:
static void
SetChi2Mode(void)
 /* Set chi2 array according to exposure sub-type */
 switch (insSubMode)
 { /* Spectro cases */
   case MODE VOID: /* drop from documentation */
   case SPECTRO_GRISM_R_0:
   case SPECTRO_GRISM_R_270:
   case SPECTRO_GRISM_R_180:
   case SPECTRO GRISM B 0:
   case SPECTRO DARK:
     chi2Mode = CHI2SPECTRO;
     chi2Size = TSIZE_MAX;
   break:
   /* Photo cases */
   case PHOTO FILTER Y:
   case PHOTO_FILTER_J:
   case PHOTO_FILTER_H:
   case PHOTO DARK:
     chi2Mode = CHI2PHOTO;
     chi2Size = TSIZE MAX / 8U;
   break;
```




Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 163/188

-	/-125] silent action of failure of ICU_CMD_COUNTER check Created: ed: 09/Dec/19 Resolved: 09/Dec/19
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	Commands, telemetry
Affects Version/s:	DPU ASW v1.2.5
Fix Version/s:	DPU_ASW_v1.2.5.1

Туре:	New Feature	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

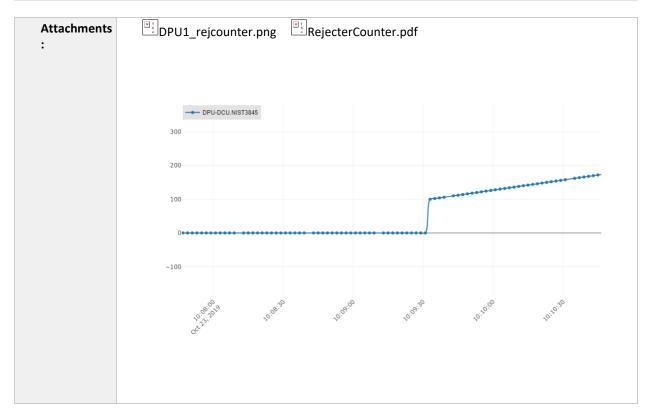

The presented document is Proprietary information of the Euclid Consortium.



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 164/188

Description

to make the ICU - DPU 1553 communication protocol more similar to the PUS standard, the reject command counter telemetry (dpu_MonitorTabGlobal.REJCMDCNT1 and dpu_MonitorTabGlobal.REJCMDCNT2) are not incremented when the tests fail i.e. when the information on the corresponding sub-address is not updated (no command send). The tests is performed by the function checkICUcounter, which checks for a different that precedent counter

Comments

Comment by Eduardo Medinaceli Villegas [09/Dec/19]

shows the old behaviour of the counter which increments by one unit each second (without a new command).

With the newly implemented strategy, the counter does not increase when there is no new command



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 165/188

[EUNIDPUASW 17/Dec/19 Resolv	V-127] enqueue for simulated DCU exposure Created: 17/Dec/19 Updated: ved: 17/Dec/19
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>System</u>
Affects Version/s:	DPU ASW v1.2.5
Fix Version/s:	DPU_ASW_v1.2.5.1

Туре:	New Feature	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

The DCU_exp function will be part of the ASW because it may help to simulate operations. Therefore, the possibility to perform the enqueue for the DCU_exp case without a test on the SCE availability was introduced

Comments

Comment by Eduardo Medinaceli Villegas [17/Dec/19]

added in STATUS enqueue():

For the enqueue procedure in the simulated DCU exposure case:

if((SimulatedExposureFlag_Global == DCUSIMULEXP) &&
 (TestCurrentDCUAvailable(nDet) == ASW_TRUE)) /* DCU simulated mode */

in the SCE exposure (nominal) case:



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 166/188

For the DBB buffer setup the same logic was applied

Comment by Eduardo Medinaceli Villegas [17/Dec/19]

error code ASW_EDBBBUFFER was added for error selecting the DBB buffer

#define ASW_EDBBBUFFER (ASW_OK + 0x3F4U)

/* Error during enqueue at selecting DBB buffer */

[EUNIDPUASW-123] acceptance range for device ID for CPU_DUMP Created: 26/Nov/19 Updated: 26/Nov/19 Resolved: 26/Nov/19		
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	Commands	
Affects Version/s:	DPU ASW v1.2.5	
Fix Version/s:	DPU_ASW_v1.2.5.1	

Туре:	Bug	Priority:	Trivial
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

the range of the device ID was increased to allow the dump of the of the SCE thresholds, IDs = 90-97

Comments

Comment by Eduardo Medinaceli Villegas [26/Nov/19]

internal database updated:

0, 0, 0xFFFF}, {0, 0, 0xFFFF}},7,

(ASW_STATUS_MANUAL | SCE_EEF_STATUS_IDLE)};



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 167/188

[EUNIDPUASW-126] added error code for DBB buffer selection Created: 17/Dec/19 Updated: 17/Dec/19 Resolved: 17/Dec/19		
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	error_handling	
Affects Version/s:	DPU ASW v1.2.5	
Fix Version/s:	DPU ASW v1.2.5.1	

Туре:	New Feature	Priority:	Trivial
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

added:

#define ASW_EDBBBUFFER (ASW_OK + 0x3F4U)

// Error during enqueue at selecting DBB buffer

Generated at Wed Mar 25 14:44:22 CET 2020 by Eduardo Medinaceli Villegas using Jira 8.7.1#807001-sha1:03e3702defc755fa4d5476f90791e76696be4d38.



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 168/188

14. Affect version DPU_ASW_v1.2.5.1 fixed version DPU_ASW_v1.3 change log

[EUNIDPUASW-129] Personality files for Focal Plane Created: 20/Jan/20 Updated: 20/Jan/20 Resolved: 20/Jan/20		
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	E2PROM, System	
Affects Version/s:	DPU_ASW_v1.2.5.1	
Fix Version/s:	DPU-ASW v1.3	

Туре:	New Feature	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Attachments:	personalization_test.txt	
--------------	--------------------------	--

Description

personalization files of the 16 Flight SCS and the 16 flight DCUs included for operations at room temperature (VDsub = 50 mV)

Comments

Comment by Eduardo Medinaceli Villegas [20/Jan/20]

created binary file EEF_boot_tab_16DCU&SCE_50mV.bin to load in E2PROM

refactored file to be load in RAM

EEF_boot_tab_16DCU&SCE_50mV_ASWfile_wComments.c = EEF_boot_tab.c

Comment by Eduardo Medinaceli Villegas [20/Jan/20]



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 169/188

test performed:

perform the FP power-on procedure (DCUs power on, SCEs bootstrap) SFT3 (include SCEs HK1-2-3) using Flight HW see personalization_test.txt attached personalization_test.txte , result format:

SCE_ID, FM-SCS, INBIAS_I from register dump (from documentation), VDSUB_I from register dump (from documentation), VREF_MAIN_V from register dump (from documentation) ok for all 16 SCEs

Comment by Eduardo Medinaceli Villegas [20/Jan/20]

added Personality folder containing the toolkit needed to create the binary file containing the personalization of the flight SCEs (JPL) and flight DCUs (OHB);

[EUNIDPUASW 20/Jan/20	V-128] fake error injection Created: 20/Jan/20 Updated: 20/Jan/20 Resolved:
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>Commands</u>
Affects Version/s:	DPU ASW v1.2.5.1
Fix Version/s:	DPU-ASW v1.3

Туре:	Bug	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

in function enqueue:

removed error injection in case:

else{ /* ASWErrorCmdLog(TASKCMD, 0, (int32_t)ASW_EENQUEUE, crit_medium); */ continue;



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 170/188

Comments

Comment by Eduardo Medinaceli Villegas [20/Jan/20]

tested using FM HW

[EUNIDPUASW-131] added initialization error Created: 20/Jan/20 Updated: 20/Jan/20 Resolved: 20/Jan/20		
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	None	
Affects Version/s:	DPU_ASW_v1.2.5.1	
Fix Version/s:	DPU-ASW v1.3	

Туре:	New Feature	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

added in MChandler.c:

InitializationError(ASW_ESENDMSG); for error sending msg to ErrorHandling added error code

#define ASW_ESENDMSGERRORLOG (ASW_OK + 0x03F5U) /* Error sending msg to Error Log */

Comments

Comment by Eduardo Medinaceli Villegas [20/Jan/20]

in Supervisor.c changed:

UnrecoverableError(errno); with

InitializationError(errno);



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 171/188



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 172/188

[EUNIDPUASW-130] removed TBD, and Dead code Created: 20/Jan/20 Updated: 20/Jan/20 Resolved: 20/Jan/20		
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	<u>System</u>	
Affects Version/s:	DPU ASW v1.2.5.1	
Fix Version/s:	DPU-ASW_v1.3	

Туре:	New Feature	Priority:	Trivial
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

TBD /TODO removed:

ClockSpeed_Global set to TIME_RATE (200)
 set to sysClkRateSet(TIME_RATE) i.e. time resolution = 5ms as VIS

DEAD CODE removed:

- #ifdef AFTERREST_ISSUE
- commented code in DPUSCE_StatusRegister.c DCU_ID == DPU_BRD_DEV
- #ifdef TESTREMOVETHIS in CMD_DPU_Handler.c
- removed from DPU_ASW_globals.h: int16_t errTabSendReady_Global; /* Error table ready to send */ /* uint32_t EOEwdDelay_Global; */ /* uint32_t EODwdDelay_Global; */
- removed from Process.c:
- if (((AswStatusFlag_Global & ASW_STATUS_CPU_SAFE) != ASW_STATUS_CPU_SAFE)

((AswStatusFlag_Global & ASW_STATUS_CPU_PARKED) != ASW_STATUS_CPU_PARKED)) /** TODO test // Eo*_WD case */



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 173/188

removed comment /* Eo*_WD if triggered will wait 30s for the DCUDABT finalization / /* TODO remove comment */

removed from InitGlobalVars.c

/* EOEwdDelay_Global = (sysClkRateGet()*30U); wait for ResetDcuAndDbb() to finish */
/* EODwdDelay_Global = (sysClkRateGet()*30U); wait for ResetDcuAndDbb() to finish */

removed from WdExp.c: #ifdef OLD_IMPL

removed from WdProc.c: #ifdef OLD_IMPL

Generated at Wed Mar 25 14:44:54 CET 2020 by Eduardo Medinaceli Villegas using Jira 8.7.1#807001-sha1:03e3702defc755fa4d5476f90791e76696be4d38.

15. Affect version DPU ASW v1.3 fixed version DPU ASW v1.3.1 change log

[EUNIDPUASW-134] DCU simulated exposure Created: 20/Jan/20 Updated: 20/Jan/20 Resolved: 20/Jan/20		
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	<u>Commands</u>	
Affects Version/s:	DPU-ASW v1.3	
Fix Version/s:	DPU-ASW_v1.3.1	

Туре:	New Feature	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

refactored case DCU_exp(simulated)

added end = 1 to allow loop for single SCE case



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 174/188

Comments

```
comment by Eduardo Medinaceli Villegas [20/Jan/20]
in if (SimulatedExposureFlag_Global == DCUSIMULEXP)
changed
start = 0;
/* end = 0; */
end = 1; /* single SCE case */ and

for (i = start; i < end; i++)
{
    if (TestCurrentDCUAvailable(sce_ID) == ASW_TRUE)
    to allow loop on all detectors performed a single time cmd_ver_plus_telemetry:

if (ver == res_ok)
{
    new_ver = cmd_ver_plus_telemetry(&sceEXP_cmd, &recv_data[SubAddr][2]);
    if (new_ver == res_notok){
        ERRORLOGID(ASW_ECMD, sce_ID);
        /* error is embedded in the cmd_ver_plus_telemetry */ }
}
else{ break; }</pre>
```



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 175/188

[EUNIDPUASW 20/Jan/20	/-132] acceptance parameters_Created: 20/Jan/20 Updated: 20/Jan/20 Resolved:
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>1553</u>
Affects Version/s:	DPU-ASW v1.3
Fix Version/s:	DPU-ASW_v1.3.1

Туре:	New Feature	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

DITHERCINF_cmd:

- added new indices for exp config2 (0-9) to allow DARK SPECTRO and DARK PHOTO modes
- changed comments
- changed lower limit for droplines to 0 cpuRBT_cmd: - changed comment sceIPCEXP cmd:
- added comments (param description)
- changed upper range for drop lines1 to 4095
- fixed limits to droplines2b to 0
- fixed limits to droplines2a to 2048
- changed upper limits to 0xFFFF to ipc start and step x, y sceKTCEXP_cmd:
- added comments (description of paramas)
- changed upper limit to reset frames
- changed upper limit to droplines1



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 176/188

Comments

Comment by Eduardo Medinaceli Villegas [20/Jan/20]

for Dither Tab: $\{0, 0, 9\}$, /exp config 2/

for SCE_IPCEXP_cmd:

added comments: description to params

limits:

```
{8, 8, 0xFFFF}, /* ipc start y */
{16, 16, 0xFFFF}, /* ipc step y */
{8, 8, 0xFFFF}, /* ipc start x */
{16, 16, 0xFFFF}, /* ipc step x */
{0, 0, 0xFFFF}}, /* ipc reset voltage */
for SCEEXP_cmd:
{2048, 0, 0x090B}, /* drop lines 2 */
{0, 0, 0xFFFF}, /* exp config */
```



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 177/188

[EUNIDPUASW-133] added semaphores to change of status in ResetDcuAndDbb function Created: 20/Jan/20 Updated: 20/Jan/20 Resolved: 20/Jan/20	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>Commands</u>
Affects Version/s:	DPU-ASW v1.3
Fix Version/s:	<u>DPU-ASW_v1.3.1</u>

Туре:	New Feature	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

```
added semTake e semGive for semLockAswStatus
```

```
if ((AswStatusFlag_Global & ASW_STATUS_MANUAL) != ASW_STATUS_MANUAL) /*
if comes from MANUAL stay in MANUAL */
{ /* set-up of state OBSERVATION WAITING, without test on res of DCU_dabt */
    semTake(semLockAswStatus, WAIT_FOREVER);
    Toggle_ASW_STATUS_OBS_WAIT();
    semGive(semLockAswStatus); }

/* set-up of state SCE EEF IDLE */
    semTake(semLockAswStatus, WAIT_FOREVER);
    Toggle_SCE_EEF_STATUS_IDLE();
    semGive(semLockAswStatus);
}
```

Generated at Wed Mar 25 14:45:31 CET 2020 by Eduardo Medinaceli Villegas using Jira 8.7.1#807001-sha1:03e3702defc755fa4d5476f90791e76696be4d38.



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 178/188

16. Affect version DPU ASW v1.3.1 fixed version DPU ASW v1.3.2 change log

-	[EUNIDPUASW-136] changed maximum value in the allowance range for parameter Created: 20/Jan/20 Updated: 20/Jan/20 Resolved: 20/Jan/20		
Status:	Done		
Project:	Application software for the Euclid NISP DPU		
Component/s:	<u>1553</u>		
Affects Version/s:	DPU-ASW_v1.3.1		
Fix Version/s:	DPU-ASW v1.3.2		

Туре:	New Feature	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

changed maximum value in the allowance range for parameter droplines 1 for sceIPCEXP_cmd, sceEXP_cmd, and sceKTCEXP_cmd{128, 0, 4096}, /* drop lines 1 */

Generated at Wed Mar 25 14:46:02 CET 2020 by Eduardo Medinaceli Villegas using Jira 8.7.1#807001-sha1:03e3702defc755fa4d5476f90791e76696be4d38.



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 179/188

17. Affect version DPU_ASW_v1.3.2 fixed version DPU_ASW_v1.3.3 change log

[EUNIDPUASW-137] corrected upper limit of expoconfing and droplines2 Created: 20/Jan/20 Updated: 20/Jan/20 Resolved: 20/Jan/20		
Status:	Done	
Project:	Application software for the Euclid NISP DPU	
Component/s:	<u>Commands</u>	
Affects Version/s:	DPU-ASW_v1.3.2	
Fix Version/s:	DPU-ASW v1.3.3	

Туре:	New Feature	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

{2048, 0, 0xFFFF}, /* drop lines 2 */ {0, 0, 0x090B}, /* exp config */



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 180/188

[EUNIDPUASW-138] rollback DCU exposure simulated Created: 20/Jan/20 Updated: 20/Jan/20 Resolved: 20/Jan/20	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	Commands
Affects Version/s:	DPU-ASW v1.3.2
Fix Version/s:	<u>DPU-ASW_v1.3.3</u>

Туре:	New Feature	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

rollback to limited functionalities of the DCU_exp_SIM functional for Broadcast only, without the exposure flag and with no watchdogs. Removed the test of the DBB interrupts for this case

Comments

Generated at Wed Mar 25 14:46:31 CET 2020 by Eduardo Medinaceli Villegas using Jira 8.7.1#807001-sha1:03e3702defc755fa4d5476f90791e76696be4d38.



Ref: EUCL-OPD-CS-7-001


Issue: 2.0

Date: 25/03/2020 Page: 181/188

18. Affect version DPU_ASW_v1.3.3 fixed version DPU_ASW_v1.3.4 change log

[EUNIDPUASW-142] false positive error injection Created: 23/Mar/20 Updated: 23/Mar/20 Resolved: 23/Mar/20	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	error_handling
Affects Version/s:	DPU-ASW_v1.3.3
Fix Version/s:	DPU-ASW v1.3.4

Туре:	New Feature	Priority:	Critical
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

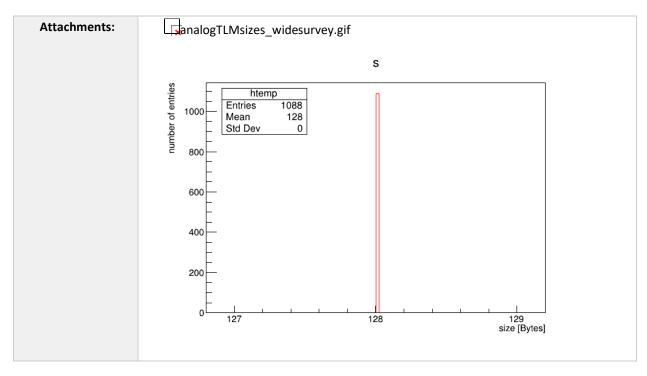

The presented document is Proprietary information of the Euclid Consortium.



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 182/188

Description

error PRC_ECMPTEL removed because it was a FALSE POSITIVE

Comments

Comment by Eduardo Medinaceli Villegas [23/Mar/20]

verified that in all the cases the error was a false positive.

The error was related to a wrong test on the compression algorithm, that returns the same size of the uncompressed package.

Plot - analysis of a wide survey dataset - analogTLMsizes_widesurvey.gif shows the size of all the compressed files, indicating a size equal to the un-compressed one = 128 MB. In all these cases an error was injected incorrectly.

The picture can't be



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 183/188

[EUNIDPUASW-143] New Baseline optimization results loaded by default Created: 23/Mar/20 Updated: 23/Mar/20 Resolved: 23/Mar/20	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	E2PROM, System
Affects Version/s:	DPU-ASW v1.3.3
Fix Version/s:	<u>DPU-ASW_v1.3.4</u>

Type:	New Feature	Priority:	Major
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

TV3 Baseline adjustment included CPPM-JCC 12/02/2020 data included in the EEF_boot_tab.c file



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 184/188

[EUNIDPUASW-140] Static Tests input Created: 23/Mar/20 Updated: 23/Mar/20 Resolved: 23/Mar/20	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	<u>ASW</u>
Affects Version/s:	<u>DPU-ASW_v1.3.3</u>
Fix Version/s:	DPU-ASW_v1.3.4

Туре:	New Feature	Priority:	Minor
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Attachments:	DPU ASW #86 Console [Jenkins].html

Description

Static test DPU-ASW #86 from Jenkins Console report, applied to the ASW

Comments

Comment by Eduardo Medinaceli Villegas [23/Mar/20]

- DPU CmdHanlder/CMD SCE Handler.c:
 - Static Tests: removed unused variable uint16_t new_ver;
- DPU_ErrorHandling/ASWErrorHandling.c:
 - Static Tests: removed unused variable uint16_t current_error;
- int32_t emergencyFlag;
- initialization of queueCounter = 0U;
- DPU_Process/RiceComp.c:
 - Static Test, comment added for macro putcbuf: macro defined in CFITSIO not maintained, static test exception added
- DPU_HskScan/HskSacn.c:
 - Static Test, removed unused variable uint32_t testres;
- DPU Include/DPU ASW defs.h:
 - added define for maximum number of elements in the ISR message queue, value not changed
- #define ASW ISR MSGMAX 10 (Max number of messages handled by ISR)

The presented document is Proprietary information of the Euclid Consortium.



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 185/188

DPU_Start/Supervisor.c:

added define for maximum number of elements in the ISR message queue, value not changed if((select_msg = msgQCreate(ASW_ISR_MSGMAX, sizeof(mailbox_msg_t), MSG_Q_FIFO)) == NULL) Static Test, added comment for exception to unit test result: Vxworks definition cannot be changed DPU Process/Process.c:

Static Tests, added comment to value never reached: defensive coding. To increase code legibility for variables WdProcEnabled = ASW_FALSE; and abortFlag = ASW_FALSE

DPU_Process/WriteData.c:

Static test, added cast to Macro result (MAXDRBSPWSIZE) before comparison if(sumBytes > (int32_t)MAXDRBSPWSIZE)

DPU_WatchdogLib/WdProc.c:

Static Test, added comment to explain static test exception WdProcHandler(int32_t mode) (wdStart wants at least one parameter, exception added for Static test)



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 186/188

[EUNIDPUASW-139] disclaimer added CFITSIO code Created: 23/Mar/20 Updated: 23/Mar/20 Resolved: 23/Mar/20	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	Processing
Affects Version/s:	<u>DPU-ASW_v1.3.3</u>
Fix Version/s:	DPU-ASW_v1.3.4

Туре:	New Feature	Priority:	Trivial
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas
Resolution:	Done	Votes:	0
Labels:	None		
Remaining Estimate:	Not Specified		
Time Spent:	Not Specified		
Original Estimate:	Not Specified		

Description

Disclaimer added to RiceComp.c

Static Test, comment added for macro putcbuf: macro defined in CFITSIO not maintained, static test exception added



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 187/188

[EUNIDPUASW-141] Static test - CLANG format Created: 23/Mar/20 Updated: 23/Mar/20 Resolved: 23/Mar/20	
Status:	Done
Project:	Application software for the Euclid NISP DPU
Component/s:	None
Affects Version/s:	<u>DPU-ASW_v1.3.3</u>
Fix Version/s:	DPU-ASW_v1.3.4

Туре:	New Feature	Priority:	Trivial	
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas	
Resolution:	Done	Votes:	0	
Labels:	None			
Remaining Estimate:	Not Specified			
Time Spent:	Not Specified			
Original Estimate:	Not Specified			

Description

static test, clang format Macro applied to all source code

Generated at Wed Mar 25 14:47:00 CET 2020 by Eduardo Medinaceli Villegas using Jira 8.7.1#807001-sha1:03e3702defc755fa4d5476f90791e76696be4d38.



Ref: EUCL-OPD-CS-7-001

Issue: 2.0

Date: 25/03/2020 Page: 188/188

19. Affect version DPU ASW v1.3.4 fixed version DPU ASW v1.3.5 (Flight) change log

[EUNIDPUASW-144] default value for PROC_PARAM_TAB parameter "broadcast device" Created: 23/Mar/20 Updated: 23/Mar/20 Resolved: 23/Mar/20				
Status:	Done			
Project:	Application software for the Euclid NISP DPU			
Component/s:	Processing			
Affects Version/s:	DPU-ASW v1.3.4			
Fix Version/s:	DPU-ASW_v1.3.5			

Туре:	Bug	Priority:	Major	
Reporter:	Eduardo Medinaceli Villegas	Assignee:	Eduardo Medinaceli Villegas	
Resolution:	Done	Votes:	0	
Labels:	None			
Remaining Estimate:	Not Specified			
Time Spent:	Not Specified			
Original Estimate:	Not Specified			

Description

updated broadcast device ID in default ProcParamTab, takin into account 1553 interface convention

Comments

Comment by Eduardo Medinaceli Villegas [23/Mar/20]

procParamTabGlobal.det2Send = 8U; (Detector number 1 = Detector ID 0)

Generated at Wed Mar 25 14:47:28 CET 2020 by Eduardo Medinaceli Villegas using Jira 8.7.1#807001-sha1:03e3702defc755fa4d5476f90791e76696be4d38.