

Aalborg Universitet

The influence of ventilation on moisture conditions in facades with wooden cladding

Hansen, Ernst Jan de Place; Brandt, Erik

Published in:

Proceedings of the Fourth International Building Physics Conference: Energy efficiency and new approaches

Publication date: 2009

Document Version Publisher's PDF, also known as Version of record

Link to publication from Aalborg University

Citation for published version (APA):

Hansen, E. J. D. P., & Brandt, E. (2009). The influence of ventilation on moisture conditions in facades with wooden cladding. In N. T. Bayazit, G. Manioglu, G. K. Oral, & Z. Yilmaz (Eds.), *Proceedings of the Fourth International Building Physics Conference: Energy efficiency and new approaches* (1 ed., Vol. 1, pp. 347-354). Beysan Matbaacilik ve Reklamcilik, Istanbul.

General rights

Copyright and moral rights for the publications made accessible in the public portal are retained by the authors and/or other copyright owners and it is a condition of accessing publications that users recognise and abide by the legal requirements associated with these rights.

- Users may download and print one copy of any publication from the public portal for the purpose of private study or research.
- ? You may not further distribute the material or use it for any profit-making activity or commercial gain ? You may freely distribute the URL identifying the publication in the public portal ?

Take down policy

If you believe that this document breaches copyright please contact us at vbn@aub.aau.dk providing details, and we will remove access to the work immediately and investigate your claim.



The influence of ventilation on moisture conditions in facades with wooden cladding

Ernst Jan de Place Hansen Senior Researcher Danish Building Research Institute, Denmark



Content

- Background
- Test design
- Measurement
- Results
- Conclusions
- Perspectives





Background

- Ventilated cavity
 - Remove moisture behind the cladding in timber framed walls
- Walls with no cavity
 - Less expensive
 - Reduce the risk of a two-faced fire in the cladding



Test design

- Full-size wall elements
- Type of cladding
 - open or more "dense"
- Type of cavity
 - · Ventilated cavity, non-ventilated cavity, no cavity
- Type of wind barrier



Test building



IBPC4, Istanbul, June 2009 - The influence of ventilation on moisture conditions in facades with wooden cladding



Test building



IBPC4, Istanbul, June 2009 - The influence of ventilation on moisture conditions in facades with wooden cladding

Measurements




- Full-size wall elements oriented towards north and south
- Moisture content and temperature in wall elements

- Temperature and RH of indoor and outdoor air
- Precipitation
- Wind speed and wind direction

Test design Full-size wall elements



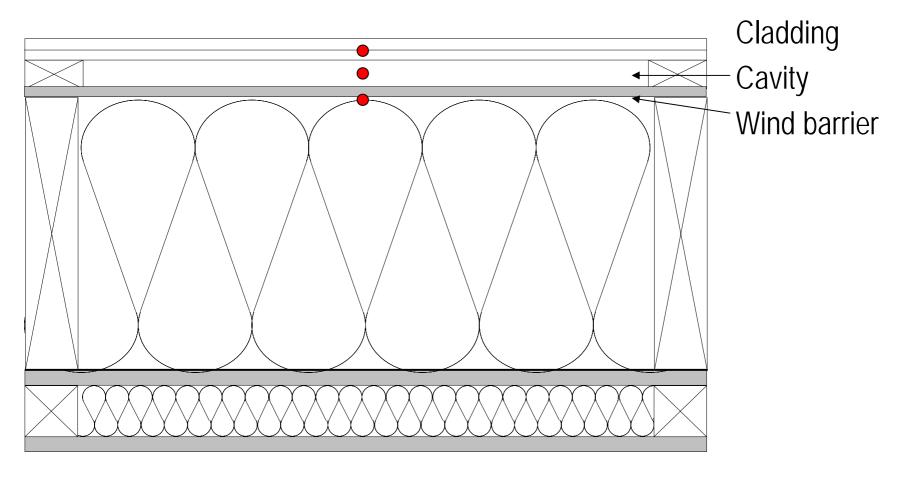


• Position of sensors

IBPC4, Istanbul, June 2009 - The influence of ventilation on moisture conditions in facades with wooden cladding




Indoor and outdoor temperature

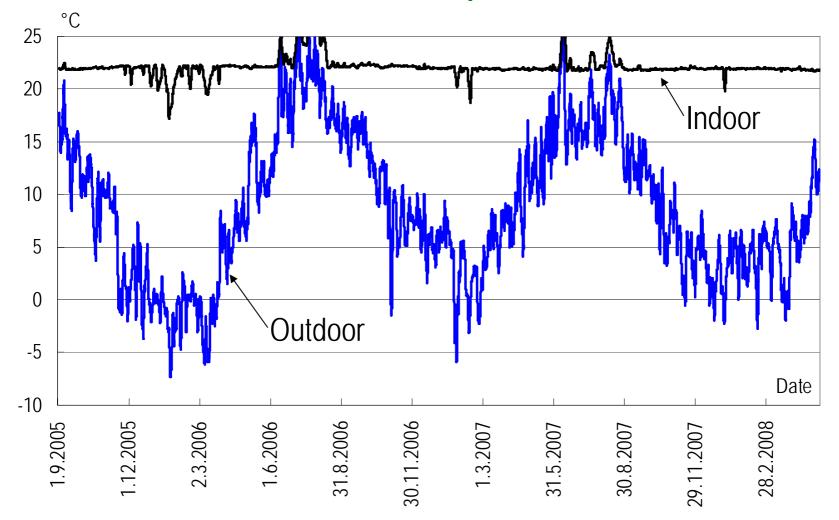




Indoor and outdoor RH

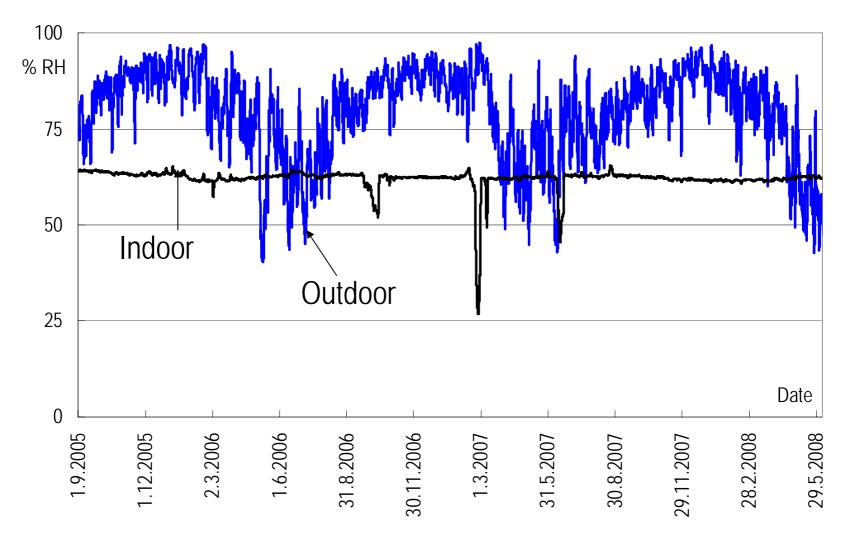



Moisture content – behind wind barrier

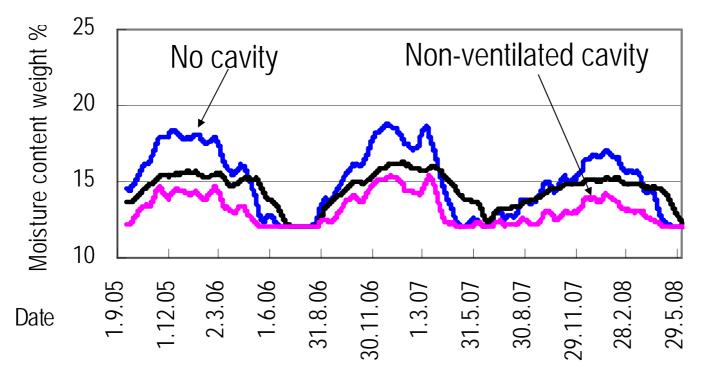




Facade elements facing north. Horisontally lapped boarding




Moisture content – behind wind barrier

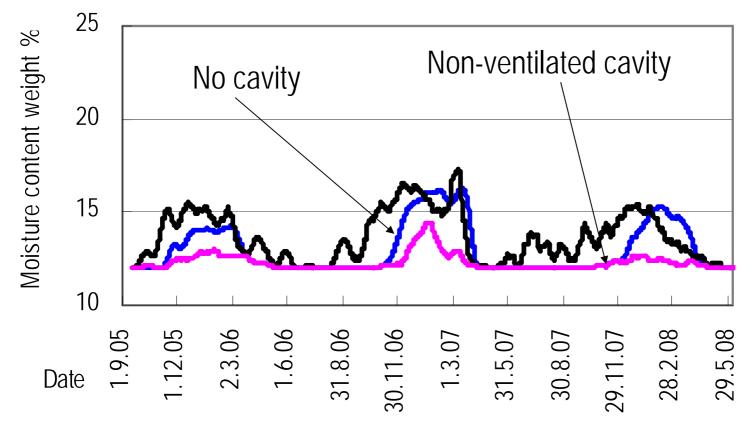


Facade elements facing south. Horisontally lapped boarding



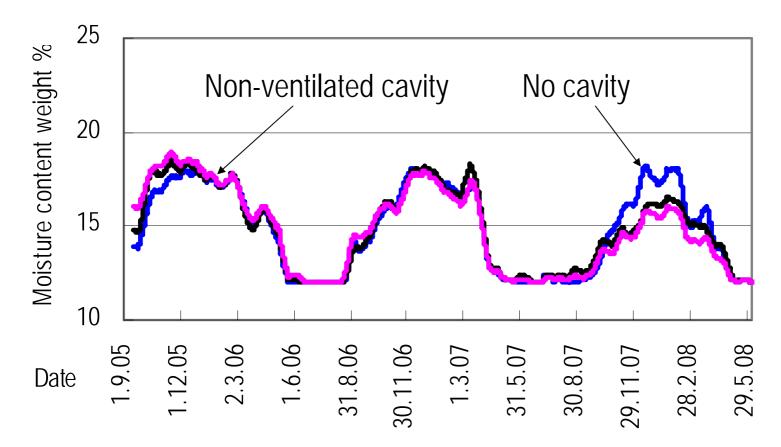


Facade elements facing north. Horisontally lapped boarding



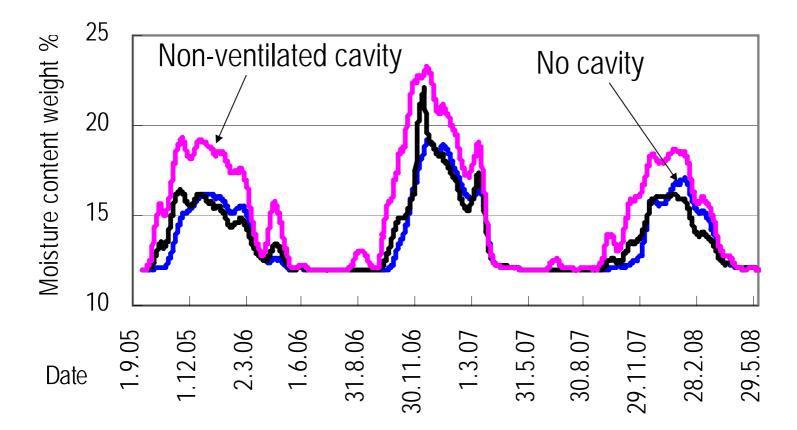


Facade elements facing south. Horisontally lapped boarding



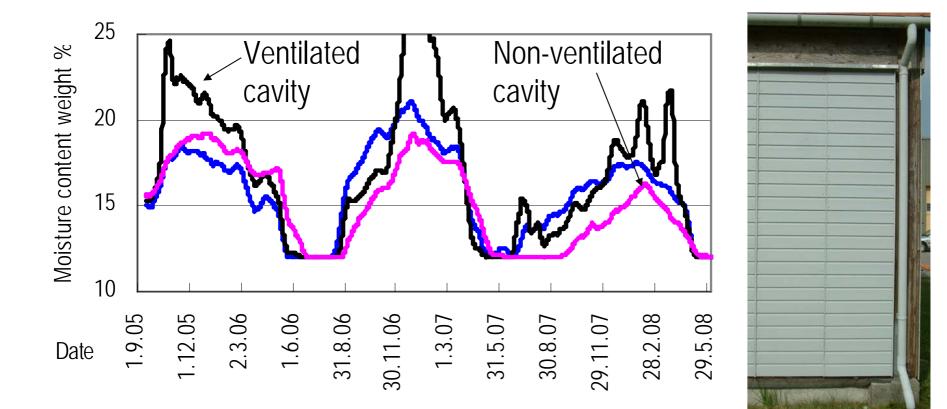

Facade elements facing north. Horisontal weatherboard




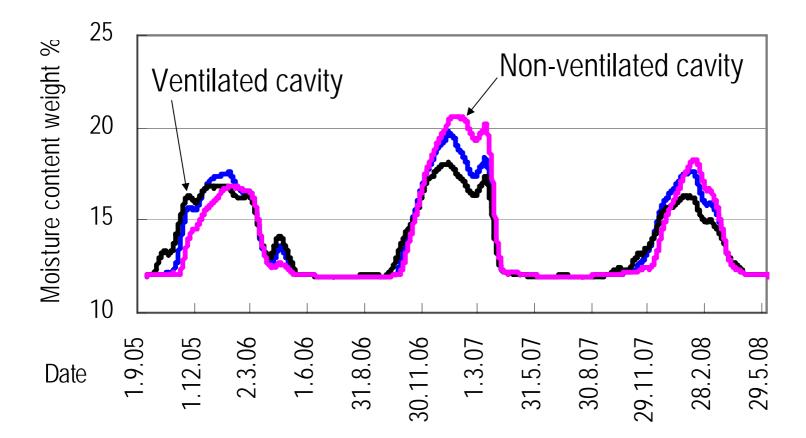

Facade elements facing south. Horisontal weatherboard



Moisture content – non ventilated cavity

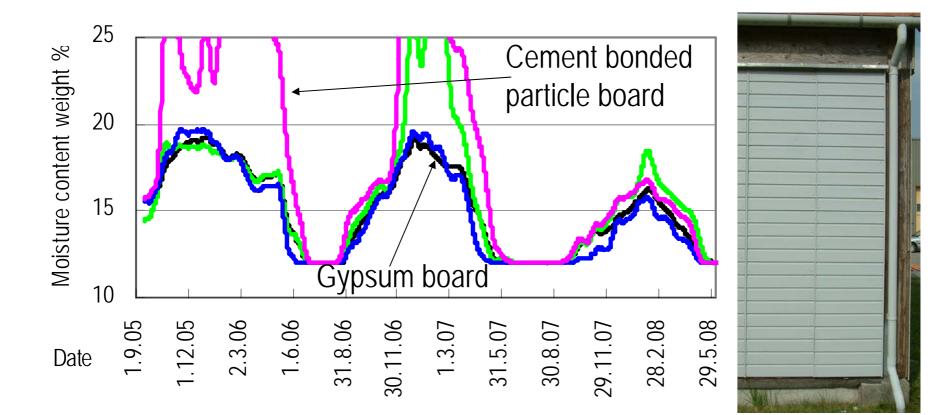


Facade elements facing north. Type of wind barrier

IBPC4, Istanbul, June 2009 - The influence of ventilation on moisture conditions in facades with wooden cladding




Moisture content – non ventilated cavity

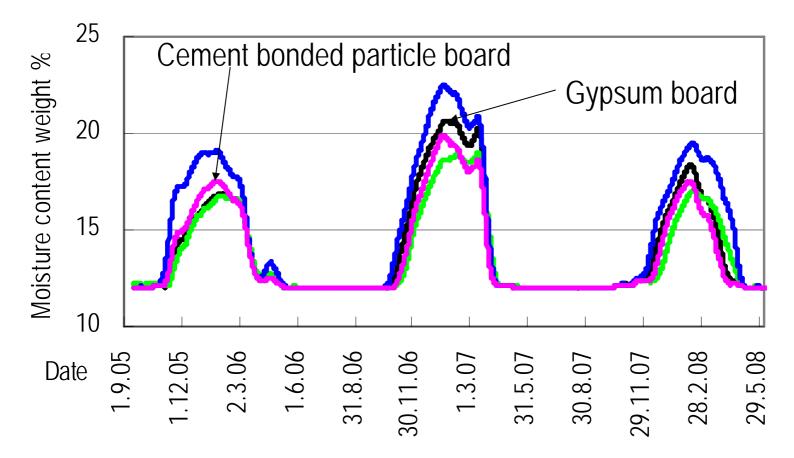

Facade elements facing south. Type of wind barrier




Moisture content – no cavity

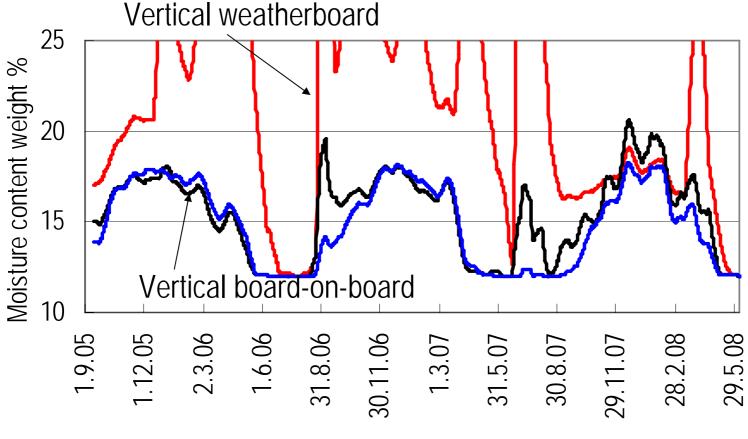

Facade elements facing north. In the cladding



Moisture content – no cavity

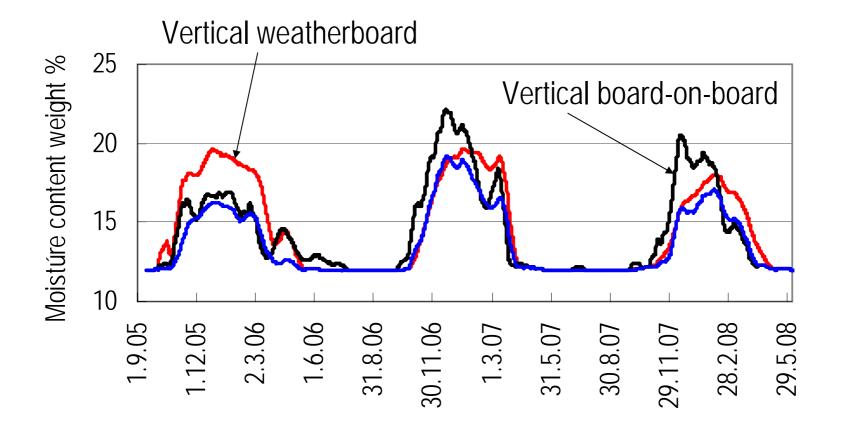

Facade elements facing south. In the cladding

Conclusions



- Not possible to confirm that a ventilated cavity should be preferred to a non-ventilated cavity behind the cladding in timber framed walls
- If non-ventilated cavities are used the type of wind barrier is important
- Façade elements without a cavity cannot be recommended

Perspectives



- Mould growth modelling and inspection
- Calibration of full-size tests with calculations of heat, liquid and vapour moisture transfer
- Air-tightness of the vapour barrier