

IN-09
106608
p. 66

NASA Contractor Report 189595

Buffet Test in The National Transonic Facility

Clarence P. Young, Jr.
North Carolina State University
Raleigh, North Carolina

Dennis W. Hergert, Thomas W. Butler,
and Fred M. Herring
The Boeing Company
Seattle, Washington

Cooperative Agreement NCC1-141
July 1992



National Aeronautics and
Space Administration
Langley Research Center
Hampton, Virginia 23665-5225

(NASA-CR-189595) BUFFET TEST IN THE
NATIONAL TRANSONIC FACILITY Final Report
(North Carolina State Univ.) 66 p

N92-29352

Unclas
G3/09 0106608

Foreword

This report documents a buffet test in the National Transonic Facility carried out jointly by the Boeing Airplane Company and the NASA Langley Research Center. The report contains information developed by both Boeing and NASA personnel. The authors wish to acknowledge the contributions of all those personnel at Boeing and Langley who were involved in preparations for the test and actual conduct of the test. The excellent teamwork and dedication resulted in a highly successful test completed in a timely manner.

TABLE OF CONTENTS

	<u>Page</u>
Summary	1
Introduction	1
Symbols List	1
Model Description	2
Test Approach and Run Schedule	2
On-Board Instrumentation	3
Vibration Monitoring and Model Protection Systems	3
Boeing Systems	4
NASA Langley Systems	4
Transonic Dynamics Tunnel System	4
NTF FFT Analyzer	5
Balance Dynamic Display Unit (BDDU) and Critical Point Analyzer (CPA)	5
Data Storage	5
Video Monitors	5
Monitoring System Location in Control Room	6
Wind Tunnel Interlock System	6
Pre-Test Dynamic Monitoring and Safety Systems Shutdown Checkout	7
Wind-Off Vibration Tests	7
Safety Analysis and Risk Assessment	8
Structural Integrity	8
Fan Protection	9
Catcher Screen	9
Debris Fence	9
Undesired Events and Risk Assessment	9
Results and Discussion	10
Reynolds Number Sweep With Vortex Generators Installed	10
Reynolds Number Sweep With Vortex Generators Removed	10
Aeroelastic Stability Trends For Roll Buffet With and Without Vortex Generators	11
Mach Number Sweep With and Without Vortex Generators	12
Mach Number Sweep With VG's Installed	12
Mach Number Sweep With VG's Removed	12
Aeroelastic Stability Trends For Pitch or Stall Buffet	12

TABLE OF CONTENTS
(concluded)

	<u>Page</u>
Conclusions and Recommendations	13
References	13
Appendix A. Specifications, Calibration Test Sequence and Measured Sensitivities for Accelerometers Used for 767 Test Program	15
Appendix B. Description of Pre-Test Checkout Dynamic Monitoring and Safety Shutdown Systems	18
Appendix C. Safety and Risk Assessment Model	21
Appendix D. Special Procedure For Model Protection Variable Inputs	27

LIST OF TABLES AND FIGURES

TABLE

TITLE

TABLE	TITLE
I	Run Schedule for 767 Test Program
II	Summary of Measured Model System Primary Structural Modes and Frequencies
III	Critical Loading/Failure Locations For Various Vibration Modes
IV	Wing Stress Calculations (Normalized)
V	Summary of Critical Model Components, Factors of Safety, and Failure Acceptability For 20 Hz Roll Mode - 100 g's AT Wing Tip
VI	Undesired Events and Risk Assessment

FIGURE

TITLE

FIGURE	TITLE
1	Boeing 767 Model in the NTF
2	Vortex Generator Locations on Right Wing
3	Test Profile for Investigating Reynolds Number Effect on Buffet
4	Photo of Model in NTF Illustrating Accelerometer and Strain Gage Locations
5	Illustration of PCB Accelerometer Installation at Outboard Location on Left Wing of Model-View Looking Forward - Not To Scale
6	Example of Colorgraphics Frequency and Time Domain Display For Roll Buffet Condition
7	Example of Colorgraphics Frequency and Time Domain Display For Pitch Buffet Condition
8	Typical BDDU Display
9	Monitoring System Location in NTF Control Room
10	Monitoring and Shutdown Systems Schematic
11	Setup For Dynamic Loads Monitoring and Shutdown Systems Checkout
12	Wind-Off Vibration Test Setup
13	Vibration Modes of Primary Interest for Buffet Test
14	Finite Element Model of Pure Roll Mode (20 Hz.)
15	Finite Element Model of First Wing Bending Symmetric Mode (55 Hz.)
16	Balance Yawing Moment Response Showing Evidence of Fouling Between Aft Fuselage and Swept Strut. (At Mach 0.80, Re No. 67 million/ft, $\alpha = 4.4^\circ$)
17	Balance Yawing Moment and Side Force Response From Forced Vibration Tests Illustrating Fouling Between Aft Fuselage and Swept Strut.
18	Example Frequency Spectrum for Outboard Wing Accelerometer and Balance Rolling Moment
19	Roll Buffet Stability Index Versus Angle of Attack for Variable Reynolds Number and with VG's Installed
20	Roll Buffet Stability Index Versus Angle of Attack for Variable Reynolds Number and with VG's Removed
21	Force Balance and Strain Gage Dynamic Response Due to Roll Buffet
22	Buffet Boundaries for Model at cruise Reynolds Number of 67 Million/ft
23	Force Balance and Strain Gage Response Due to Pitch Buffet

Summary

A buffet test of a commercial transport model was accomplished in the National Transonic Facility (NTF) at the NASA Langley Research Center. This aeroelastic test was unprecedented for this wind tunnel and posed a high risk to the facility. This paper presents the test results from a structural dynamics and aeroelastic response point of view and describes the activities required for the safety analysis and risk assessment. The test was conducted in the same manner as a flutter test and employed on-board dynamic instrumentation, real time dynamic data monitoring, automatic, and manual tunnel interlock systems for protecting the model. The procedures and test techniques employed for this test are expected to serve as the basis for future aeroelastic testing in the National Transonic Facility. This test program was a cooperative effort between the Boeing Commercial Airplane Company and the NASA Langley Research Center.

Introduction

In the fall of 1988, a Boeing 767 transport model was tested in the National Transonic Facility (NTF) at high Reynolds number (R_e). When testing at R_e number of 67 million/ft at Mach numbers of 0.75, 0.80, 0.82 and at angles-of-attack between 3 to 5 degrees, significant model vibrations were encountered. These oscillations appeared to be a strong function of R_e number and Mach number in that these oscillations were observed at Mach 0.80 and R_e number of 67 million/ft but not at R_e number of 37 million/ft for the same Mach number. Subsequent to this test, analyses were performed in an attempt to understand the cause of these oscillations. Although the exact nature of the flow excitation was not determined, the analyses suggested that the oscillations occurred at angles-of-attack where the lift curve slope breaks, indicating onset of flow separation over the wing. The mechanism is postulated to be a limited amplitude aeroelastic instability involving interaction of the rigid body roll inertia and the balance roll spring, driven by alternating flow separation and reattachment induced by variation of the effective angle-of-attack in rolling motion.

In 1991, a second test of the model was undertaken in order to understand the relation between test variables (Mach number, Reynolds number and dynamic pressure) and model dynamics; develop test techniques and procedures to allow safe testing into the buffet regime; and to verify wing vortex generator performance. (The actual airplane is equipped with two sets of vortex generators near the wing mid-span.) Since the NTF does not have any protection for the fan blades and the stability of the model system aeroelastic (buffet) response could not be predicted with confidence, the re-entry test was judged to be a high risk for the facility. NASA Langley agreed to the re-entry contingent upon an acceptable Safety Analysis Review (SAR).

The objectives of this paper are to describe the analyses, tests, instrumentation, on-line monitoring system, tunnel interlock and test procedures that were employed for this special test in the NTF. Preparatory investigations as well as elements of the failure modes analysis and risk assessment are presented, along with the results of the measured model system aeroelastic response during the wind tunnel tests. The Boeing 767 buffet test is expected to serve as the benchmark for all future aeroelastic and/or other high risk testing in the NTF.

SYMBOLS LIST

A	RMS amplitude of frequency response
C_L	Lift coefficient
C_M	Moment coefficient
ft	Foot

ft	Foot
g	Acceleration of gravity
Hz	Hertz
in.	inches
kip	One thousand pounds
ksi	kips per square inch
K_{1c}	Measure of fracture toughness
mv	Millivolt
psf	Pounds per square foot
q	Dynamic pressure
R_e	Reynolds number
α	Angle of attack

Model Description

The Boeing 767 model installed in the NTF is shown in figure 1. The model is supported by a swept strut sting and uses an NTF 101B force balance. The model and support structure is constructed of 18 nickel Maraging Steel Grade 200. This material is used extensively for NTF models because of its high strength and acceptable fatigue and fracture properties when exposed to a cryogenic environment. Typical properties at -250°F include an ultimate strength of 252 kips/in². Young's modulus of 30 million lbs/in² and a fracture toughness K_{1c} of 85 ksi-in^{1/2}.

The .03 scale model has 48 pressure orifices, a wingspan of 56 inches, is 56 inches long and weighs approximately 238 pounds. The model has been previously tested in the Boeing Transonic Wind Tunnel and the NASA Ames Research Center 11-foot Transonic Tunnel.

A planform view of the right wing is given in figure 2. In the figure, the locations of the vortex generators (VG's) on the wing are shown. The scaled VG's were bonded to the wings and are extremely small, i.e. .09 in. long, .024 in. high and .004 in. thick.

Test Approach and Run Schedule

Prior test results showed the roll buffet (buzz) oscillations to be sensitive to Reynolds number. The test approach was to obtain data at various Reynolds numbers and dynamic pressures, at the cruise Mach number of 0.80, for the configuration with and without vortex generators. This approach resulted in the test program profile shown in figure 3. Initial high R_e number runs were to be made with wing vortex generators on, with the expectation that the severity of the roll buffet model dynamics would be reduced or eliminated. The magnitude of the primary test variables R_e and q , would then be slowly increased as per the test profile of figure 3, and small angle-of-attack increments taken as indicated in the run schedule of Table I.

Emphasis was placed on testing the model safely. Reliance was placed on special model dynamics instrumentation, experienced Boeing and NASA LaRC test personnel and wind tunnel interlocks for model/facility protection. Once confidence was established in the instrumentation, monitoring systems and other safeguards, the plan was to test into and (if possible) through the roll buffet regime. After this part of the plan was completed, the model was to be tested with and

without vortex generators to verify their aerodynamic performance and to complete the rest of the test program according to the run schedule of table 1.

On-Board Instrumentation

Safety requirements for testing in the NTF, dictated that special instrumentation be installed on the model and swept strut (sting). During the 1988 test, limited dynamic data from the force balance and a video of the oscillations were used for post-test analyses. Quantitative analyses relative to the elastic response of the wings, swept strut, and the vibration modes involved could not be obtained from the limited data. Therefore, for this test 3 accelerometers were installed in the wings. Also, the wing and swept strut were strain gaged to provide additional data. The additional instrumentation provided capability to monitor the rigid body, and flexible modes of primary interest for the model system. The wings were machined by Boeing for installation of miniature accelerometers which had been qualified and calibrated for cryogenic use. Appendix A gives a description of the accelerometers and the qualification test program that was performed to establish that the accelerometers would work in a cryogenic environment.

The locations of the accelerometers are indicated in the photograph of figure 4. The most outboard accelerometer was located in the left wing about 5 inches from the tip. The other accelerometer placed in the left wing was located at the outboard flap track fairing approximately 10 inches from the wing tip. These two accelerometers were positioned to monitor the wing bending modes of principal interest as well as the model rigid body roll modes. The third accelerometer was located in the right wing at the intersection of the engine nacelle strut with the wing (18.5 inches inboard from the tip). This accelerometer was used to monitor the rigid body roll modes but was not used for wing elastic modes response due to its location at or near node points of the two wing modes of interest (see section on wind-off vibration tests). The two accelerometers in the left wing provided redundancy for monitoring the wing bending modes. Instrumentation redundancy is particularly important for testing in the NTF due to the likelihood that instrumentation will be lost in the harsh environment. Also, model access to troubleshoot or repair instrumentation requires tunnel warm-up which is very costly in time and resources.

The accelerometers were installed in insulated foam cups (see figure 5 for typical installation), to prevent grounding problems. The accelerometer wires were routed in existing or special channels (grooves) machined into the wing. Planned installation of a pressure transducer near the trailing edge on the left wing could not be made due to lack of sufficient space in the channels for both accelerometers and the transducer wires. Problems were encountered with cracking in the channel filler material during the initial cryogenic cycling of the model in the NTF cryogenic test chamber. Subsequently, a filler material consisting of Hysol EA 9309 epoxy, mixed with 100 micron carbon spheres on a 1:1 ratio by volume, was used without problems (see ref. 1 for information on filler materials). During cryo cycling of the model system in the NTF model conditioning chamber, the accelerometers were functionally checked by vibrating the model at various times during the cooldown, cold soak, and warmup cycles.

The NTF 101B balance provided force and moment dynamic data corresponding to the six measured components. The dynamic data from the force balance are processed and monitored by the Balance Dynamic Display Unit (BDDU) and Critical Point Analyzer (CPA) (see ref. 2 for a description of the BDDU and CPA).

Vibration Monitoring and Model Protection Systems

The primary function of the vibration monitoring and model protection system was to protect the model against failure by limiting the static plus dynamic loads to pre-established limits. The

system was comprised of both Boeing and NASA equipment and employed equipment and test techniques that are used at Boeing and at NASA LaRC for buffet and flutter testing.

Boeing System

The Boeing Company uses a portable monitoring and shutdown system called Dynamic Response Actuated Switch (DRAS) which has been used for flutter testing for approximately fifteen years. DRAS has the capability to monitor 2 channels/unit of dynamic data simultaneously. It has provisions for automatically tripping wind tunnel interlock systems if pre-set limit levels (voltage output from on-board instrumentation) and vibration cycle counts are exceeded. DRAS uses lowpass filters for mode separation between channels. By filtering, DRAS can monitor 4 or more different vibration modes (depending on the frequency spread) simultaneously. DRAS monitors time domain signals and employs a trip algorithm which automatically opens or closes a relay switch(es). It has provisions for setting dynamic amplitude levels (voltage output from an accelerometer for example), and cycle count. The cycle count provision limits trips associated with signal spikes and is usually set for 3 to 9 cycle counts. Lights on the DRAS units indicate cycle count and trip status.

In addition to DRAS, the Boeing Co. has developed a Wind Tunnel Monitoring System (WTMS) for real time dynamic monitoring. This system provides real time colorgraphic displays in both the time and frequency domains. This WTMS provides real time diagnostic information which is essential to understanding the character of the aeroelastic response in terms of vibration modes participation, and buildup in amplitude levels as tunnel operating parameters are varied. Also, energy levels and frequency changes are monitored along with other types of information which can be used for initiating manual interlock trips or making risk decisions during a real time test situation. An example of the colorgraphics display used for this test is given in figure 6. Examples of the WTMS colorgraphics displays used for this test are given in figures 6 and 7. In the figures, the time domain signal is shown at the top, with the peak values shown in the bar graph in the lower right hand corner as a function of elapsed time. The two displays on the left side of the figures are the frequency versus amplitude (indicated by volts) and the waterfall display which shows the amplitude in color versus time (vertical scale) and frequency. The snapshot display in figure 6 illustrates a roll buffet (buzz) condition where the high vibration levels are associated primarily with the rigid body roll mode at 20 Hz. Wing bending mode responses at 55 Hz and 77 Hz respectively, are also present as can be seen in the spectra. Figure 7 illustrates a pitch buffet condition where the high vibration levels are associated primarily with the first sting bending mode at 10 Hz. Also, as can be observed from the figure, the rigid body rolling mode (20 Hz) vibration is present but at a much lower energy level. The roll and pitch plane vibrations in figures 6 and 7 are representative of run conditions that resulted in the wind tunnel interlocks being tripped to rapidly unload the model. The Boeing DRAS and WTMS were used primarily to monitor the accelerometers placed in the wings which gives a normalized measure of the dynamic loads/stresses at critical (highly stressed) points in the model structure. These systems could have been used to monitor any of the dynamic signals.

NASA Langley Systems

Systems employed by NASA Langley Research Center (LaRC) for monitoring and protection of the model system are described in the following sections.

Transonic Dynamics Tunnel System. Personnel from the LaRC Transonic Dynamics Tunnel participated in the test and used equipment and techniques that are typically employed for flutter testing in the Langley Transonic Dynamics Tunnel (TDT). This system consists of a Fast Fourier

Transform (FFT) Analyzer and an 8 channel strip chart or O-Graph. The FFT Analyzer is used to monitor the frequency response of the model system and to track the RMS amplitude of the response for each of the vibration modes of interest as a function of tunnel test parameters. For this test, the inverse of the peak amplitude response ($1/A$) was plotted at various test points to measure the rate of change of the aeroelastic response and trends toward aeroelastic instability (see ref. 3 for a discussion of the technique).

A strip chart recorder was used to monitor the time domain signal for indications of amplitude buildup and/or trends toward instability. The use of this system by an experienced test engineer provides the capability for interlock trip decisions (manual mode). The combined use of the FFT and the time domain data from the strip chart recorder were used as a basis for aeroelastic response analysis and risk decisions related to test continuation, and/or changes in test variables. The TDT system was used to monitor the three wing accelerometers, two swept strut strain gages, and selected force balance channels, e.g. rolling moment, and yawing moment.

NTF FFT Analyzer. This analyzer was used to monitor selected channels for evidence of fuselage/swept strut fouling, as a backup for the TDT FFT, and for post-test analysis of data from selected runs. In addition, the system provided the capability for immediate playback of any of the data channels being recorded on magnetic tape; in both the time and frequency domain.

Balance Dynamic Display Unit (BDDU) and Critical Point Analyzer (CPA). The BDDU has been used in the NTF for several years to monitor the force balance dynamic loads. The system is described in reference 2. The BDDU monitors the six strain gage balance output channels and provides a visual alarm if the 100% full scale limit load is exceeded and both visual and audible warning if 140% of the full scale limit load is exceeded. The full scale limit load is the design load for the individual force or moment component. The alarm algorithm assumes that all other components are simultaneously loaded to 100% of full scale value. The BDDU is equipped with a bar type display (see figure 8) for each of the six channels and a computer graphics display screen which allows the operator to get snapshot hard copies of the time domain signals for all six or selected channels.

The Critical Point Analyzer scales and sums each normalized signal from the BDDU to obtain the combined static and dynamic signals representative of the loads at pre-determined high stress points. The CPA display is similar to the BDDU display shown in figure 8. A two-level alarm similar to the BDDU is used for this system as well. The CPA was used to monitor and limit the loads on the NTF 101B balance. The unit was coupled to the wind tunnel interlocks which provided an automatic shutdown capability. In addition to preventing overload at critically stressed points on the balance, the CPA was used to limit model side forces and yaw moments which could overstress the swept strut. Both the force balance and swept strut were protected from structural overload by the CPA through the automatic tunnel interlock.

Data Storage

All dynamic data obtained from the test were recorded on a 14 track magnetic tape recorder. Written records of tape count as well as recorded audio were used to identify and access test points for post-test analyses. These taped data were very useful for post-processing analyses and in particular for analyzing data channels that were not always monitored real time. This magnetic tape is being retained in the NTF archives for future reference.

Video Monitors

Two video monitors were located at the Dynamics Monitoring workstation and were used for observing the model dynamics from two different viewing angles. In a normal run situation the video monitors and BDDU serve as the only monitoring devices for model protection.

One camera provided a view of a portion of the fuselage and the left wing. The other view was focused on the left wing tip with the model fuselage discernible in the background. In some cases, particularly for the pitch or stall buffet oscillations, the tunnel interlock(s) was triggered manually based on judgment of the dynamics test engineer observation of the dynamic motion. The combination of viewing the Boeing WTMS, the NASA O-graph and FFT along with the video monitor provided a good real time monitoring system for model dynamics. Also, video cameras were used to assure that the vortex generators remained on the wing during testing. Video tapes of the model dynamics were made for virtually all the runs. Selected runs illustrating the roll buffet and pitch buffet modes of oscillation are available on VHS format.

Monitoring System Location in Control Room

A planview of the monitoring system layout in the NTF control room is given in figure 9. The Monitoring Workstation included the Boeing WTMS and DRAS systems, the NASA TDT FFT Analyzer and strip chart and the NTF FFT Analyzer station. A block diagram of the Monitoring System workstation is given in figure 10 which illustrates the data acquisition, storage, channels being monitored by specific equipment and associated interlock paths. As previously mentioned, 2 additional video monitors (showing 2 different model views) plus a wind tunnel test parameters monitor were provided at the workstation. The NASA CPA and BDDU stations were located in the Test Conductor's area. The tape recorder was positioned adjacent to the monitoring systems workstation.

Three manual kill buttons (switches) were located at the workstation for use by both Boeing and NASA personnel. Two additional kill switches were located in the vicinity of the Test Conductor's station. One switch was manned by the NTF Facility Manager or Facility Safety Head while the other switch was installed at the Test Conductor's station. A communication link was established between the workstation and Facility Safety Manager or Safety Head. The Dynamics workstation operator(s) were not in the communication loop with the test conductor and wind tunnel operators in order to avoid communication confusion. Communication from the workstation operator(s) to the Facility Manager or Safety Head on model system dynamics, tunnel parameter changes and/or hold conditions were relayed to the Test Conductor by the Facility Manager or Safety Head in charge of the test.

Wind Tunnel Interlock System

As previously stated, the monitoring and shutdown system schematic is given in figure 10. As shown in figure 10, the DRAS 1, DRAS 2, and CPA units provided automatic interlock capability for protection of the model structure, force balance and swept strut. Manual interlock switches were provided to both Boeing and NASA personnel.

The National Transonic Facility has the capability for rapidly reducing model loads through the wind tunnel interlock or trip system. Prior to the Boeing 767 test the procedure for unloading the model was to fail-safe the Inlet Guide Vanes (IGV) upstream of the fan and to trip the drive system. The IGV fail-safe unloads the IGV at a rate of 18 degrees/sec which has the potential for

reducing the test section Mach number from 0.80 to .65 in approximately 2 seconds. This provides a very rapid reduction in dynamic pressure when operating at high Mach numbers (i.e. >0.65).

Based on earlier tests it was clear that buffet onset was highly sensitive to change in angle-of-attack. (Note: This is generally true for all buffet phenomena related to airfoil separated flow.) A special interlock was installed on the pitch system which provides an angle-of-attack reduction rate of approximately 3 degrees per second.

The interlocks used for the 767 test simultaneously failsafed the IGV and brought the model pitch system to the home position (0 angle-of-attack). As previously mentioned, interlocks were set up to be tripped automatically by the DRAS and/or CPA and manual trip (kill) switches were provided to the dynamics test engineers. Also, system functional checks on each automatic channel and manual kill switches were performed prior to each run or test series. The interlock system worked extremely well in rapidly unloading the model with no operational problems encountered.

Pre-Test Dynamic Monitoring and Safety Systems Shutdown Checkout

In preparation for the model entry into the NTF, tests were done to verify operation of monitoring equipment and instrumentation and to perform functional checks for the automated emergency shutdown interlocks. This testing included exercising the Boeing DRAS 1 unit, the CPA, the NASA TDT equipment and NASA NTF FFT Analyzer. This checkout provided an opportunity for the NASA test engineers to become familiar with the Boeing system and to simulate (to the degree possible) an actual run condition. The test setup is illustrated in figure 11. The test is described in detail in Appendix B. The approach was to conduct a forced vibration test to simulate model dynamics during a tunnel run, and exercise the monitoring and shutdown system. Only the DRAS 1 unit was available for this test. The WTMS and DRAS 2 were setup just prior to the actual wind tunnel test. A threaded hole was machined, by Boeing, in the outboard flap track fairing on the right wing to provide an attachment point for the shaker. In addition, the shaker was attached to the fuselage with a special threaded plug which fit into an existing threaded hole in the fuselage.

Wind-Off Vibration Tests

To accurately determine the vibration modes that were involved in the model system aeroelastic response, and to set limits on vibration levels during wind tunnel testing, it was necessary to do a wind-off vibration test or modal survey. This test experimentally determines the model system natural vibration modes, frequencies and damping. This information was used to validate the dynamic model of the structure, to evaluate, identify and analyze the system structural mode frequencies during testing, and to set limit load levels associated with the vibration modes of major concern. These data were also used to strategically locate instrumentation (e.g. accelerometers) to assure that the various wing vibration modes could be properly monitored.

The modal survey was performed on the model system after installation in the wind tunnel test section. The test setup is shown in figure 12 which shows the actual model, a vibration exciter system, and modal data acquisition system. A shaker (vibration exciter) was attached to the model at an outboard position on the right wing (as shown in figure 12) and also at the fuselage centerline. The natural vibration data were acquired by an HP 5423A Modal Analyzer System which provides a tabulated set of mode shapes, frequencies and damping data, and displays of the animated mode shapes for different views which are selectable on the machine.

The measured mode shapes and frequencies of primary interest are illustrated in figure 13. Two of the mode shapes obtained from the Boeing finite element dynamic model are illustrated in

figures 14 and 15. Note the excellent agreement between calculated and measured frequencies for the roll mode and first wing bending mode. The modes of primary concern for the roll buffet response were the 23 Hz rigid body roll, 1st wing bending (55 Hz symmetrical) and 1st wing bending (77 Hz asymmetrical). Of particular concern was the potential for getting into a flutter type instability at the wing mode frequencies. Based on the earlier tests and analyses it was thought that the so-called rigid-body roll mode (the model attached to a torsional spring which is represented by the NTF 101B balance) was a clean 20 Hz rolling motion. However, the wind-off vibration survey revealed two modes that were associated with rigid body roll. For the mode at 19.5 Hz (see table II and figure 13), the motion is predominantly roll but also involves yawing and pitching of the model on the balance spring. The 23 Hz mode was a clean roll or torsional oscillation. During the wind-off vibration test, at a resonance frequency of 19.5 Hz it was experimentally determined that fouling or hard contact occurred between the model fuselage and the swept strut (see figure 4). The minimum measured gap between the model fuselage and swept strut was approximately .32 inches. In the 1988 test an aerodynamic seal was installed in this gap; however for the 1991 tests, no seal was installed in order to simplify the testing. The fact that fouling occurred for the 19.5 Hz resonance forced response test suggested the likelihood that hard fouling should occur during wind on testing. However, the decision was made not to install the seals, to provide maximum clearance.

Safety Analysis and Risk Assessment

In order to establish that the Boeing-767 test was an acceptable risk for the NTF, a safety analysis and risk assessment was required. This assessment required a large effort on the part of both Boeing and NASA personnel. The risk assessment model developed for use by Boeing and NASA personnel in performing the safety/risk assessment, is provided in Appendix C. The analyses and tests that were performed to support this assessment are discussed in the following sections.

Structural Integrity

The Boeing 767 model was one of the first transport models designed for testing in the NTF. The model structural integrity and aeroelastic stability characteristics met the criteria for static testing in the NTF (ref. 4). However, the re-entry for high risk buffet testing required a complete review of the model structural integrity. In-depth dynamic loads analyses were performed to identify all critically loaded components, to establish acceptable dynamic load limit levels and to evaluate fatigue and fracture life. Previously, handbook calculations were sufficient to meet the NASA requirements, but in-depth analysis required a detailed finite element analysis of the wing structure. The control point on the structure (the most highly stressed single order failure point) was found to be the engine nacelle strut to wing attachment holes (wing station 9.3). This was true for the worst case static loads and primary vibration modes including all rigid body roll and elastic wing modes (see Table III). Other areas of concern included fasteners working loose and possible overstress of the swept strut. In table IV, the calculated stresses at the nacelle hole (with and without stress concentration affects) and associated wing tip deflections, for a normalized value of 100 g's measured at the wing tip are presented. These calculations reflect only the one particular vibration mode participation for each normalized load case. One significant observation from the data of table IV is that large amplitude oscillations (5.5 inches peak to peak) for the 20 Hz roll mode could be tolerated at an acceptable stress level of 100.8 ksi. These results suggested that acceptable model oscillation amplitudes for the 20 Hz roll mode could be 5 times greater than those experienced in 1988 with the peak stresses well within the dynamic loads allowables of reference 4. As previously mentioned, the 18 Nickel, 200 grade maraging steel material has an ultimate strength capability of ~250 ksi at -250°F. A summary of the critical components, along with their classification and monitoring requirements as determined from the Boeing analysis is provided in table V.

The wing vibration modes were of particular interest due to the potential for wing flutter type oscillations at the higher frequencies (e.g. 55 Hz and 77 Hz). A detailed Boeing finite element model of the wing gave good definition of structural modes and resulted in a high level of confidence for establishing safe dynamic limit loads. All of the detailed structural analyses indicated that the model structure was capable of taking greater dynamic loads than the model balance could withstand for the 20 Hz roll mode. These results suggested that the force balance would be the limiting structural component for the buffet test, if the 20 Hz vibration was the predominant buffet mode. However, this did not turn out to be the case and is discussed in the section on "Results and Discussion." Rigid-body roll motion amplitudes of 5 inches (peak to peak) were not considered acceptable either, and reduced limits were used during the test.

Fan Protection

The National Transonic Facility is not equipped with catcher screen(s) to protect the fan from either a model failure or a failure of any internal structural component in the tunnel. Most facilities which perform dynamic and aeroelastic testing (e.g. the LaRC TDT) are equipped with such catcher screens. Also many closed circuit wind-tunnel facilities have a full set of spare fan blades to allow quick resumption of testing if blades are lost; the NTF did not. Subsequent to the mishap at the NTF in January 1989 (see ref. 5), a replacement set of blades was fabricated which in addition to other structural repairs resulted in a down time exceeding 1 year. Plans were also approved to build a spare set of blades but these blades were not to be ready until mid to late 1991.

Catcher Screen. In preparation for the Boeing 767 test all available means for protecting the fan and other internal components from damage due to potential model failure were investigated. As a result of one of the many design reviews held during the design and construction phase of the NTF, it was recommended and approved that a catcher screen assembly be designed and fabricated for the NTF. This screen was to be located at the end of the high speed diffuser ahead of turn 1. The catcher screen was an aluminum or steel honeycomb design supported in an egg crate type assembly attached to the tunnel shell. However, installing the screen for the 767 test was determined impractical for the following reasons:

- a) The structure was partially fabricated and the steel honeycomb material needed for completion had a very long delivery time (beyond 10 weeks). This could not meet the 767 test schedule.
- b) The fabricated parts and pieces would have to be inspected and the installation, fit-up, and tunnel checkout would further lengthen the long lead time.
- c) The installation of the screen would add significantly to the critical part count (highly stressed single point failure) for the tunnel.

In the final analysis, it was determined that the screen could not be fabricated, inspected, installed and checked out in time to meet the test schedule.

Debris Fence. An existing debris fence was considered for installation to reduce the risk associated with the test. The debris fence was designed to be installed on the downstream side of the turning vanes in turn 1 but had never been installed during tunnel operations. The installed fence would be three feet from the tunnel floor, and had very little energy absorption capability due to the small wire mesh type construction. Further, some of the welds in the attachment hardware were found to be defective. It was thus determined that the fence had little or no capability for stopping steel parts moving at high speed, and the screen itself posed an additional hazard to the facility. Therefore, the debris screen installation was abandoned.

Undesired Events and Risk Assessment

The final step in the safety analysis and risk process (see Appendix C) is to formulate a list or table of undesired events/failure modes, and identify the effects or consequences of such events as well as establish safeguards to eliminate or to reduce the risks to acceptable levels. A summary of the primary undesired events and risk assessments is provided in table VI.

As an example of an undesired event, consider the case when incorrect limits could be entered on the monitoring system (e.g. Boeing DRAS). In order to safeguard against this possibility, a special procedure and Facility Safety Head Approval Form was implemented for this test. This procedure required instrumentation and interlock check-out prior to each run and required both Boeing and NASA personnel to agree on load limit levels and to independently check the trip level settings. The special procedure forms used for the test are provided in Appendix D.

Results and Discussion

The results of the buffet test are presented in this section. Emphasis is placed on discussion of test techniques, experience and conditions under which buffet was encountered during the test.

Reynolds Number Sweep With Vortex Generators Installed

The first configuration tested had the vortex generators installed on the model. The test plan run profile shown in figure 3 was followed and testing began on January 18, 1991. During the initial phase of the testing, small angle-of-attack increments ($\Delta\alpha \simeq 0.1$ to 0.2°) and conservative limit amplitude (load) levels were used while monitoring the onboard accelerometers and strain gages. Several trips were initiated (either automatic or manual) during the early phases of the test until the model dynamics were characterized and acceptable levels of vibration were established, to avoid premature interlock trips. As the Reynolds number sweeps began, it became apparent that angle-of-attack would be limited to about 5 degrees due to pitch or stall buffet dynamics. Initial testing was slow due to the use of small angle-of-attack increments and the dwell time required for FFT analysis which developed amplitude or inverse amplitude ($\frac{1}{A}$) plots as angle-of-attack was slowly increased. The test profile of figure 3 was completed without encountering roll buffet, with VG's on the model. An additional run at Mach .86 and 67 million/ft Reynolds number was completed, with VG's installed, without roll buffet onset. This initial test series was interrupted by the failure of the liquid nitrogen pump on 1/25/91. The pump was repaired at LaRC, and testing resumed on 2/13/91.

Reynolds Number Sweep With Vortex Generators Removed

The second series of tests with the vortex generators removed began at a Reynolds number of 49 million per foot since the clean wing configuration (without VG's) was tested previously in 1988 at R_e number of 7 and 35 million per foot without buffet encounter. Roll buffet was first observed for this series of tests at R_e number of 59 million/ft at Mach .80. Subsequent testing at Mach .80 and 67.5 million/ft R_e number and dynamic pressure of 2670 lb/ft² resulted in a strong roll buffet response at $\alpha \simeq 4.5^\circ$. This test repeated the roll buffet encountered with the clean wing model at the same test conditions in 1988. The roll buffet (or buzz) amplitude was about 1 inch peak to peak at the wing tips and the frequency response was predominantly 20 Hz. These data clearly indicated that under roll buffet conditions the fuselage and swept strut were coming into contact (see figure 16) due to the yawing motion associated with the 20 Hz model response. The fouling occurred at about 80% of yawing moment full scale and is evident by signal clipping of the response peaks as shown in figure 16. The same type of signal clipping was observed during pre-test

dynamic load simulation (Appendix B) when fouling was visually observed and recorded as shown in figure 17. This fouling indication during testing was verified by inspection during tunnel entry for model change, and was subsequently monitored closely throughout the test program.

Aeroelastic Stability Trends For Roll Buffet With and Without Vortex Generators

An established technique for conducting flutter and buffet tests is to develop inverse amplitude ($\frac{1}{A}$) plots for the pertinent model frequency responses (FFT of time domain response) as tunnel parameters are varied (see ref. 3). In flutter testing, Mach number and dynamic pressure are normally varied to identify flutter boundaries. In the initial tests series in NTF for varying R_e and q , Mach number was held constant at 0.8 and angle-of-attack was varied for the model with and without VG's. As a result, the primary variables affecting the buffet response onset and amplitude buildup were angle-of-attack and dynamic pressure. To evaluate trends toward buffet instability, RMS amplitudes were measured with the FFT Analyzer for the structural response modes of interest and the inverse of these amplitudes was plotted as a function of angle-of-attack and Reynolds number for constant Mach number. An example of a typical frequency response spectrum for the 767 model is given in figure 18. In the figure, the upper spectrum is for the left wing tip accelerometer in g 's versus frequency. For the data shown, the predominant modes are at 10 Hz (1st sting bending mode); 20 Hz (roll/yaw mode) and 55 Hz (1st wing bending mode). The bottom graph illustrates the response as observed from the rolling moment output of the force balance. In this case, the predominant balance response frequency is 20 Hz as this channel cannot detect the structural modes response of the model support structure and the wing.

The $1/\text{amplitude}$ plots for the 20 Hz mode response at Mach .8 and varying Reynolds number are illustrated in figures 19 and 20. Figure 19 gives the stability trends for the initial series of tests with the VG's installed on the model, while figure 20 gives similar results with VG's off the model. The condition for incipient instability is when $\frac{1}{A} \rightarrow 0$. As the slope of the curve tends to become steeper and $\frac{1}{A}$ shows a sharp trend toward zero, more data points must be taken at smaller angle-of-attack increments.

In figure 19, the $\frac{1}{A}$ plots tend to break over at about 3.5° angle-of-attack. (This corresponds to a break in the C_M and C_L curve for the model). However, the plot shows that for the 20 Hz response, although increasing ($\frac{1}{A}$ decreasing) up to 5 degrees, there is no sharp trend toward instability. As previously stated, roll buffet onset (lock-in) did not occur for these series of runs with the VG's installed. Also, as previously mentioned, these tests were limited to an angle-of-attack of 5 degrees due to onset of stall (pitch) buffet dynamics.

Similar plots of the $\frac{1}{A}$ stability index are given in figure 20 for varying R_e number versus angle-of-attack without VG's installed. The breakover point also occurs around 3 degrees angle-of-attack but with a much more rapid buildup in amplitude with increasing angle-of-attack. However, for a R_e number of 49 million/ft and q of 1962 psf, the 20 Hz mode $\frac{1}{A}$ value decreased slightly between 3.5° and 4.1° but became stable (tends toward increasing stability) with increasing angle-of-attack. However, at 59 and 67 million Reynolds number, buffet onset or lock-in is encountered and interlock trips initiated at fairly high (small $\frac{1}{A}$) amplitudes. As previously mentioned, because of fouling between the aft model fuselage and swept strut support, attempts to further test into and possibly through the buffet region were abandoned due to risk of structural damage to the model and/or swept strut. Thus, it remains to be determined whether or not the model roll buffet is a limit cycle oscillation.

An example of the roll buffet response, as seen from the time domain strip chart signal, is given in figure 21. The four channels of data shown in the figure include the yawing and rolling moment response as obtained from the balance and the swept strut bending and torsion strain gages response. When buffet onset and lock-in occurs, the frequency on all channels stabilizes in at 20 Hz with amplitude increasing rapidly. The buildup in amplitude to the interlock trip point for this case occurred in about 2 seconds. However, note the very rapid decay of the response from peak value to near zero in approximately 1/4 second. Since the tunnel Arc Sector pitch system moves about 3 degrees/second, the data suggests that only a very small change in α relieves the roll buffet lock-in oscillations. The interlock trip for the run shown in figure 21 was initiated manually by the engineer observing this strip chart data.

Mach Number Sweep With and Without Vortex Generators

After the roll buffet investigation was completed, the next phase of testing focused on obtaining aerodynamic data at a Reynolds number of 67 million/ft for varying Mach number with and without vortex generators installed. These tests were conducted in a normal testing mode, that is to say, polars were run at pre-established Mach numbers using normal angle-of-attack sweeps. The function of the team monitoring the dynamic and aeroelastic response would be to trip the interlocks if the pre-established buffet amplitudes were exceeded or roll buffet lock-in was encountered. Once the interlocks were tripped during a Mach number run, the tunnel conditions were changed and the next Mach number run was initiated. It was expected that angle-of-attack would be limited by either roll buffet or pitch buffet, for all polars to be run.

Mach Number Sweep With VG's Installed. The initial run was made at Mach .86 and aerodynamic data were obtained up to 6.5° angle-of-attack. The interlock automatically tripped on the 55 Hz mode (1st wing bending) which is believed to be due to system stall response rather than wing flutter. Tests at Mach numbers .86, .84, .82 and .80 were limited by pitch buffet. These boundaries are plotted in figure 22. Roll buffet was encountered with VG's on at Mach numbers of 0.75 and 0.70 at angles-of-attack of 5.9° and 6.7°, respectively. These test results indicated that the VG's altered the flow over the wing such that roll buffet was not encountered at test Mach numbers greater than .75 but the pitch buffet boundary is about the same with or without VG's installed as can be seen in figure 22.

Mach Number Sweep With VG's Removed. The initial run was made at Mach .86 and data were obtained up to 6.25° angle-of-attack. This run was limited by a violent pitch buffet response which is discussed in the next section. Roll buffet was observed during the Mach 0.84 run but testing continued through this condition (vibration levels were within limits) to the point where the run was terminated due to pitch buffet at an angle of attack of approximately 6.6°. The remaining runs at Mach 0.82, 0.75, and 0.70 were limited by the roll buffet oscillations.

Aeroelastic Stability Trends For Pitch or Stall Buffet

As previously mentioned, pitch or stall buffet dynamics limited testing the model at high angles of attack. The pitch buffet boundary is illustrated in figure 22 for tests at full scale Reynolds number (67 million/ft). Buffet at high angles-of-attack is a common occurrence in wind tunnel testing. The problem is usually associated with flow separation over the wing at high angles-of-attack resulting in unsteady aerodynamic loads on the model. Typically, the lowest fundamental model system structural mode in the pitch plane is excited (along with higher modes at lower energy) and amplitude is usually dynamic pressure dependent. High angle-of-attack buffet is not unique to the NTF. However, the loads associated with very high dynamic pressures (e.g. 767 tested at ~2800 psf) can result in violent, high amplitude oscillations.

During the full scale R_e number and Mach number sweeps with and without VG's attempts were made to get to the highest angle-of-attack possible without jeopardizing structural integrity of the model. The quality of the aerodynamic data was adversely affected when the model vibrated at high angles-of-attack. While testing at Mach 0.86 and 0.84 violent pitch oscillations were encountered at angles-of-attack of 6.4 and 6.0 degrees respectively. During the Mach .86 run the model oscillations were measured to be approximately 2.5 inches peak-to-peak at a frequency of 10 Hz, (1st model/sting bending mode in the pitch plane). At the peak amplitude the left wing inboard accelerometer and swept strut strain gage signals were lost. The peak pitch buffet response at Mach .86 as measured from the balance pitch, roll and normal force output and the bending gage on the swept strut is illustrated in figure 23. Note that the normal force response locks in at 10 Hz while the pitching moment responds at 10 and 17 Hz (balance pitching mode). The signal from the swept strut bending gage was lost. After disassembly of the model, it was found that the swept strut strain gage wires were severed due to fouling between the bottom of the swept strut and the bottom of the model fuselage. Figure 23 shows that after the interlock is tripped, the motion is completely decayed in approximately one second. Although the pitch or stall buffet oscillations were violent, the model and support system (sting) were not in jeopardy as the stresses (both combined static and dynamic) were within acceptable limits.

Conclusions and Recommendations

Buffet testing of the Boeing 767 wind tunnel model was successfully completed in the National Transonic Facility at the NASA Langley Research Center. A comprehensive safety analysis and risk assessment program was carried out by Boeing and NASA personnel, as a prerequisite for testing in the NTF facility. On-line dynamic signal monitoring of on-board instrumentation and wind tunnel interlocks were successfully used to protect the model system. Buffet boundaries were established at various Mach numbers and angles-of-attack at full scale Reynolds number. Pitch or stall buffet limited testing to a maximum angle-of-attack of 6.5 degrees. Testing into the roll buffet region was limited due to fouling between the model fuselage and swept strut support sting. Test techniques employed were based on those used by Boeing and NASA LaRC for testing flutter models.

This test is expected to serve as the model for future aeroelastic tests in the National Transonic Facility. Buffet of wind tunnel models is expected to be a continuing problem when testing in the NTF, at full scale Reynolds numbers and associated high dynamic pressures. It is recommended that pre-entry assessment of the potential for buffet should be made for each model to be tested in the NTF. Also, provisions should be made for instrumenting potentially high risk cryogenic test models with accelerometers or strain gages placed at strategic locations to monitor and protect the model structure against dynamic and/or aeroelastic response overloads.

References

1. Young, Clarence P., Jr.; and Gloss, Blair B.: Second Workshop on Cryogenic Wind-Tunnel Models. NASA Conference Publication 3010. November 1987.
2. Ferris, Alice T.; and White, William C.: Monitoring Dynamic Loads on Wind Tunnel Force Balances, ISA Paper 89-0021, 1989.
3. Rublin, C. L.; Watson, J. J.; Ricketts, R. H. and Doggett, R. V., Jr.: Evaluation of Four Subcritical Response Methods For One-Line Prediction of Flutter Onset in Wind Tunnel Tests. Journal of Aircraft Volume 10, October 1983, pp. 835-840.

4. Anon: Wind-Tunnel Model Systems Criteria: NASA Langley Research Center, LHB 1710.15. August 1986.
5. Report of the NASA-LaRC National Transonic Facility Mishap Investigation Board, Vol. I of III Final Report, April 11, 1989.

Appendix A

Specifications, Calibration Test Sequence and Measured Sensitivities For Accelerometers Used For 767 Test Program

Specifications for the PCB quartz accelerometers used for the Boeing 767 test program are available from the manufacturer. These miniature accelerometers are about the size of a pencil eraser (.23 in. diameter \times .30 in. high) and were tested extensively at the NASA Langley Research Center. The Model No. of the accelerometers used is the 309M42: which has a different type of connecting wire than the 309M15. The accelerometer calibration test sequence is provided in Figure A-1. The test sequence is designed to characterize a cryogenic test profile for the NTF. Accelerometer sensitivities at low temperatures for four of the units are provided in figure A-2. The data of figure A-2 were used to select the sensitivity at test temperature for signal calibration. Note that sensitivity curves slopes are fairly flat for the left wing outboard and right wing nacelle accelerometers at -250°F (test temperature). The accelerometers performed very well during the tests. Drop out of accelerometer signals occurred twice during the test and both were attributed to wire breakage due to thermal and/or mechanical loading. Care must be taken to install the wires to prevent fraying across sharp edges and allow enough slack for wire contraction.

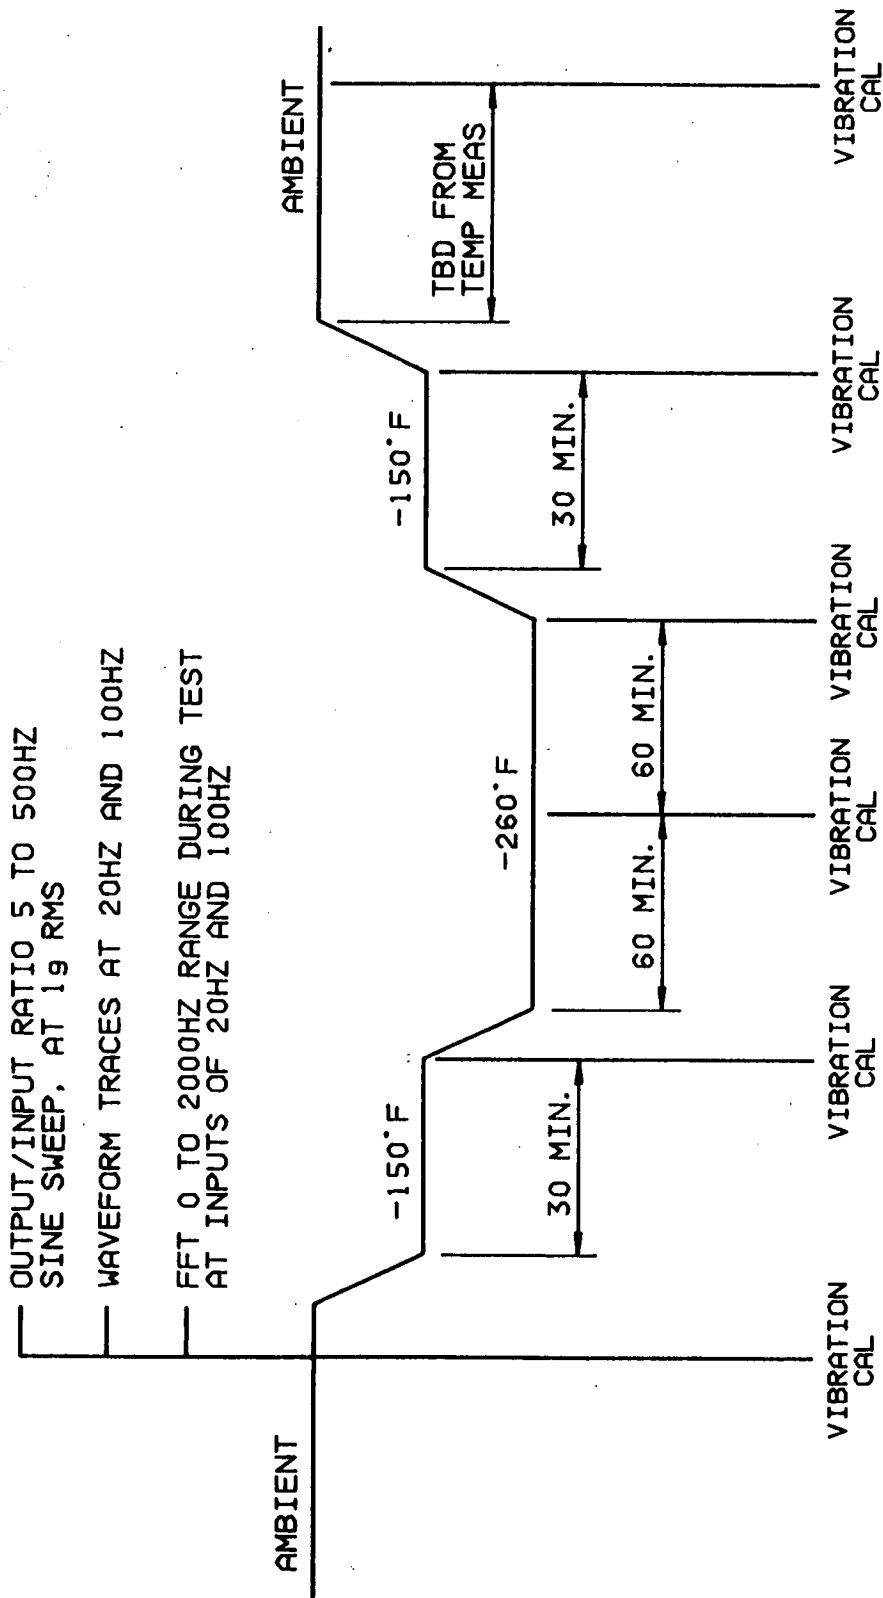


Figure A-1. VIBRATION CALIBRATION TEST SEQUENCE FOR PCB 309M15/309M42 ACCELEROMETERS

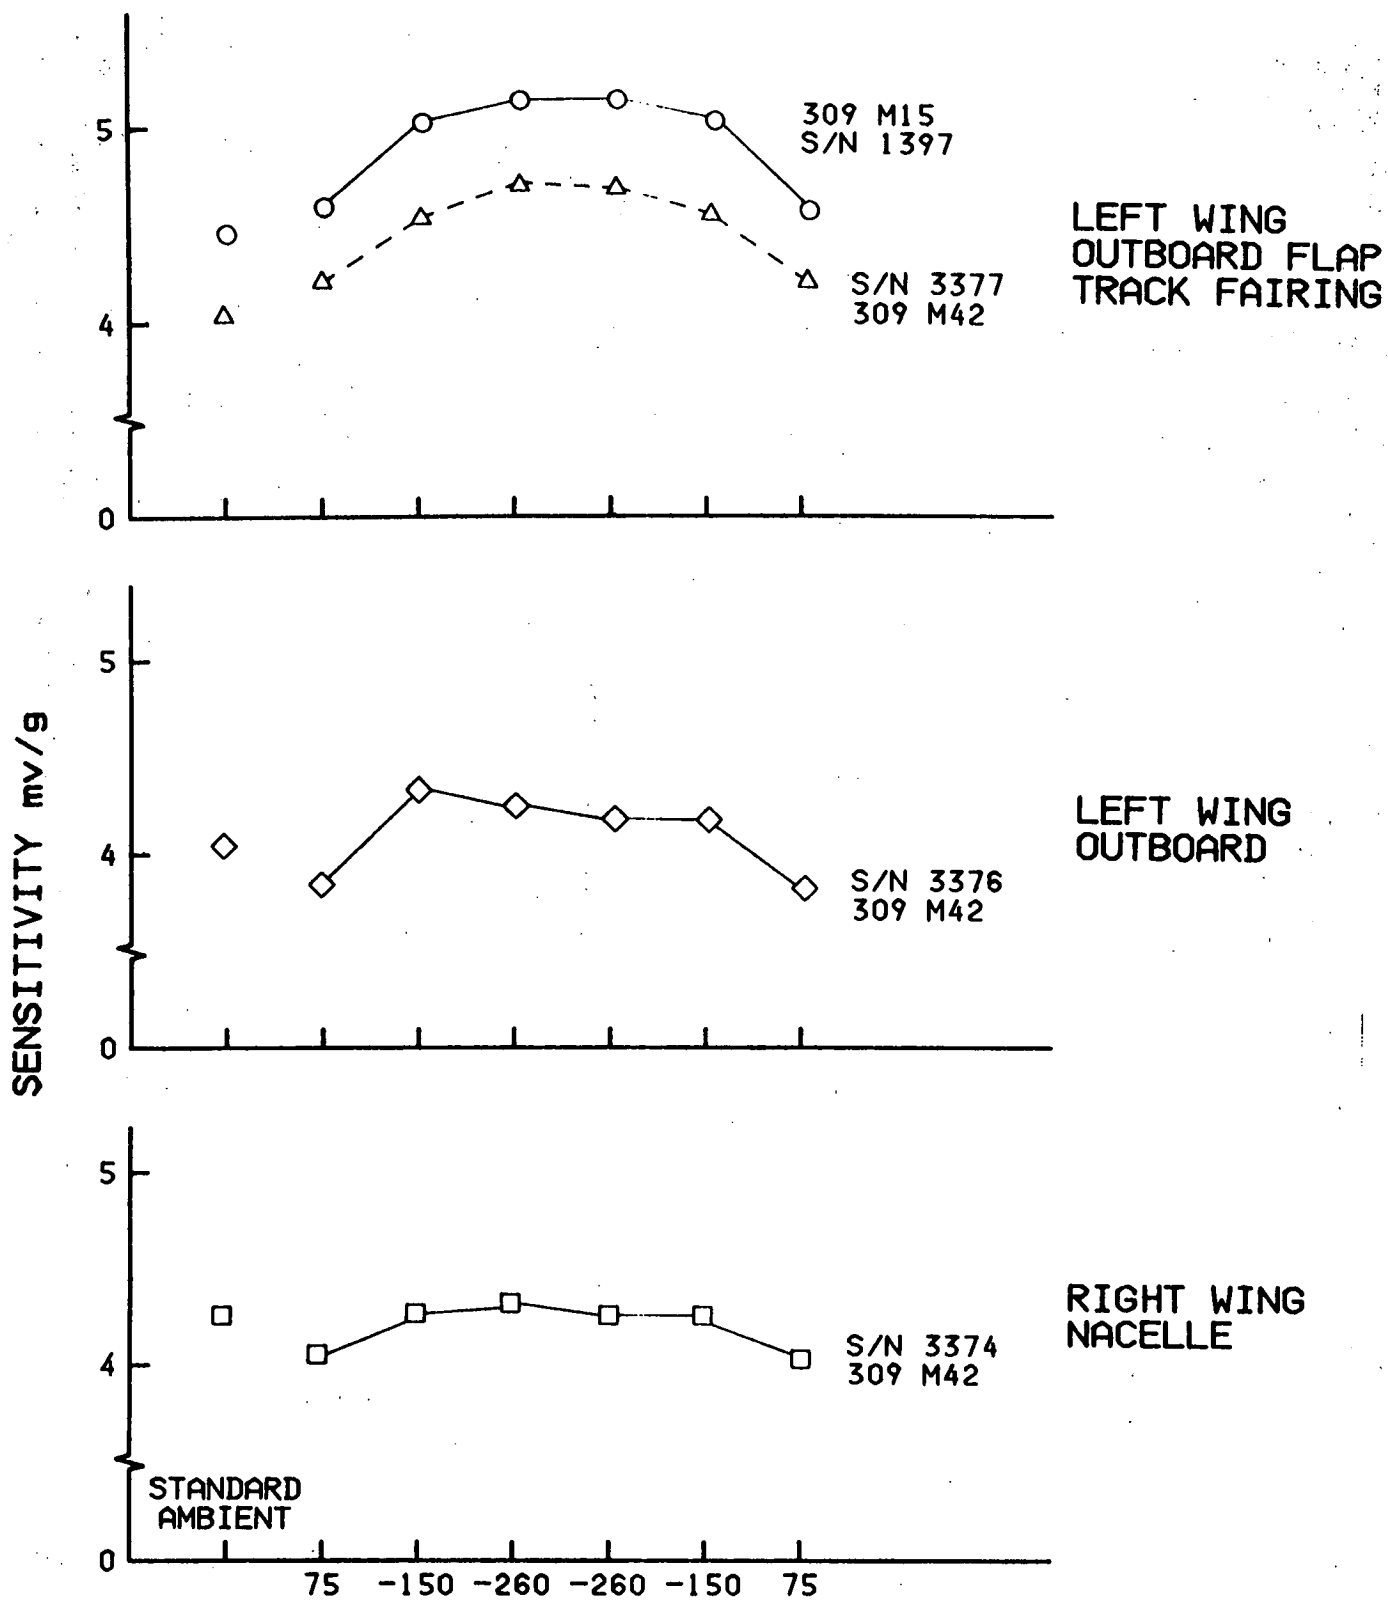


Figure A-2. **ACCELEROMETER SENSITIVITIES AT CRYO TEMPERATURES.**
PCB MODELS 309 M15 & 309 M42

Appendix B

Description of Pre-test Checkout For Dynamic Monitoring and Safety Shutdown Systems

Background

This test was conducted to check out the dynamic monitoring and safety shutdown systems that were to be used for conducting the Boeing 767 model buffet test in the NASA Langley National Transonic Facility. The test(s) verified operation of monitoring equipment and instrumentation; and was used to simulate model system dynamic response expected during the actual wind-tunnel test. Also, the systems to be used for automatic emergency shutdown of the facility were functionally checked. These included the Boeing DRAS 1 system and the Langley Critical Point Analyzer (CPA). The Boeing DRAS system was used to guard against overload of the Boeing 767 model structure (excluding the force balance). The Critical Point Analyzer (CPA) was used to protect the balance and support sting swept strut against dynamic overload.

Test Apparatus

The test setup is given in figure 10. The vibration shaker used was an Electro-Seis, model 113LZ with a 30-pound maximum input force capability and 6 inch stroke. The shaker was attached to a wooden support frame that sat on the test section floor (see figure 12). This set-up provided a semi-rigid base for mounting the vibration exciter (shaker).

Test Procedure

The test procedure was designed to simulate anticipated model system dynamic response during the actual wind-tunnel test. The shaker was attached to designated hard points on the model and forcing function loads and frequencies established for exciting specified vibration modes.

The test was conducted in the following manner:

1. The shaker was attached to the model at hard points on the right wing outboard flap track fairing and at a forward point on the fuselage centerline. Note: Provision was made for a threaded rod attachment to the outboard flap track fairing. An adapter rod and threaded bolt was used for the fuselage attachment. The shaker was mounted on the wooden support base provided by NTF.
2. All available monitoring system equipment and model instrumentation was active during the forced vibration testing. Vibration test engineers were in voice communication with the test director and/or monitoring equipment operators in the control room, during the test(s).
3. Specified modes were excited to the highest levels possible without exceeding preestablished load or displacement limits established by Boeing and/or NASA.

4. Modes excited for these tests were:

Symmetric		
Mode #	Mode	Measured Freq., Hz
1	1st Sting Bending	10-11
2	Rigid Model Pitching on Balance	17
3	1st Wing Bending	55
Anti-Symmetric		
1	Rigid Model Rolling and Yawing on Balance	19
2	Rigid Model Rolling on Balance	23
3	First Wing Bending	77

Primary emphasis was placed on exciting the 19 and 23 Hz roll modes (anti-symmetric) to approximately 1 inch peak-to-peak at the wing tip. Wing bending modes are also excited but at very low levels.

5. During the forced vibration testing, the model system instrumentation output was recorded on the NASA 14-channel tape recorder, and monitored real-time by Langley personnel. The following monitoring equipment was used:

Boeing

- DRAS Unit No. 1

NASA

- BDDU
- CPA
- TDT O-Graph & FFT Analyzer
- NTF FFT Analyzer

6. The forced vibration response test accomplished the following objectives.

A. Verified monitoring equipment and instrumentation operation.

B. Correlated measured response with


1) Input Forcing Function

2) Balance (BDDU response) with accelerometer/strain gage(s) response on wings and support sting. (Note: The results of this study could have had a bearing on decisions related to continuation of testing if one or more accelerometers had been permanently lost during the wind-tunnel test.)

- C. The forced vibration testing was used to check the function of the model safety and shutdown systems. This was done by setting trip levels (and frequencies as appropriate) on the DRAS 1 unit and the CPA that were detected from the forced vibration loads. Shutdown commands to appropriate visual and/or audible alarms were verified, and tunnel interlocks signal transmission verified.
- D. Data taken from the BDDU yaw moment dynamic response were used to characterize the dynamic signal response and establish the % full scale value at which fouling occurred between the fuselage and swept strut when forcing the model at ~20 Hz in roll.

Appendix C
Safety/Risk Assessment Model Used For
Boeing 767 Buffet Test in NTF


SAFETY/RISK ASSESSMENT MODEL

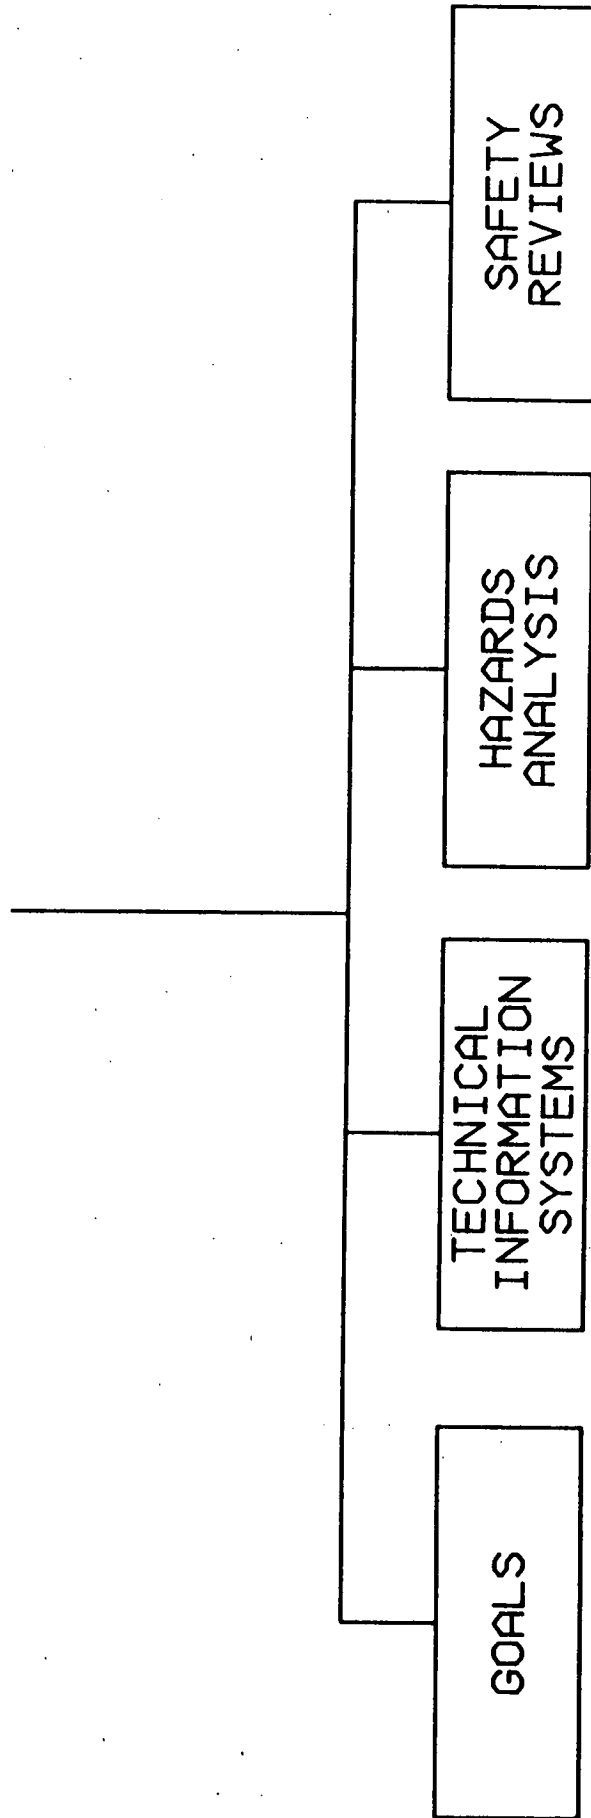


GOALS

- SAFELY TEST MODEL IN BUFFET REGIME
- TEST INTO OR THROUGH BUFFET REGIME OR TO POINT WHERE C_M VS. α CURVE BREAKS BACK TO STABLE SLOPE
- INVESTIGATE RELATIONSHIP BETWEEN TEST VARIABLES (q , R_n AND α) AND MODEL DYNAMICS
- VALIDATE TEST TECHNIQUES FOR FUTURE NTF MODELS
- TEST WITH AND WITHOUT VORTEX GENERATORS

TECHNICAL INFORMATION SYSTEMS

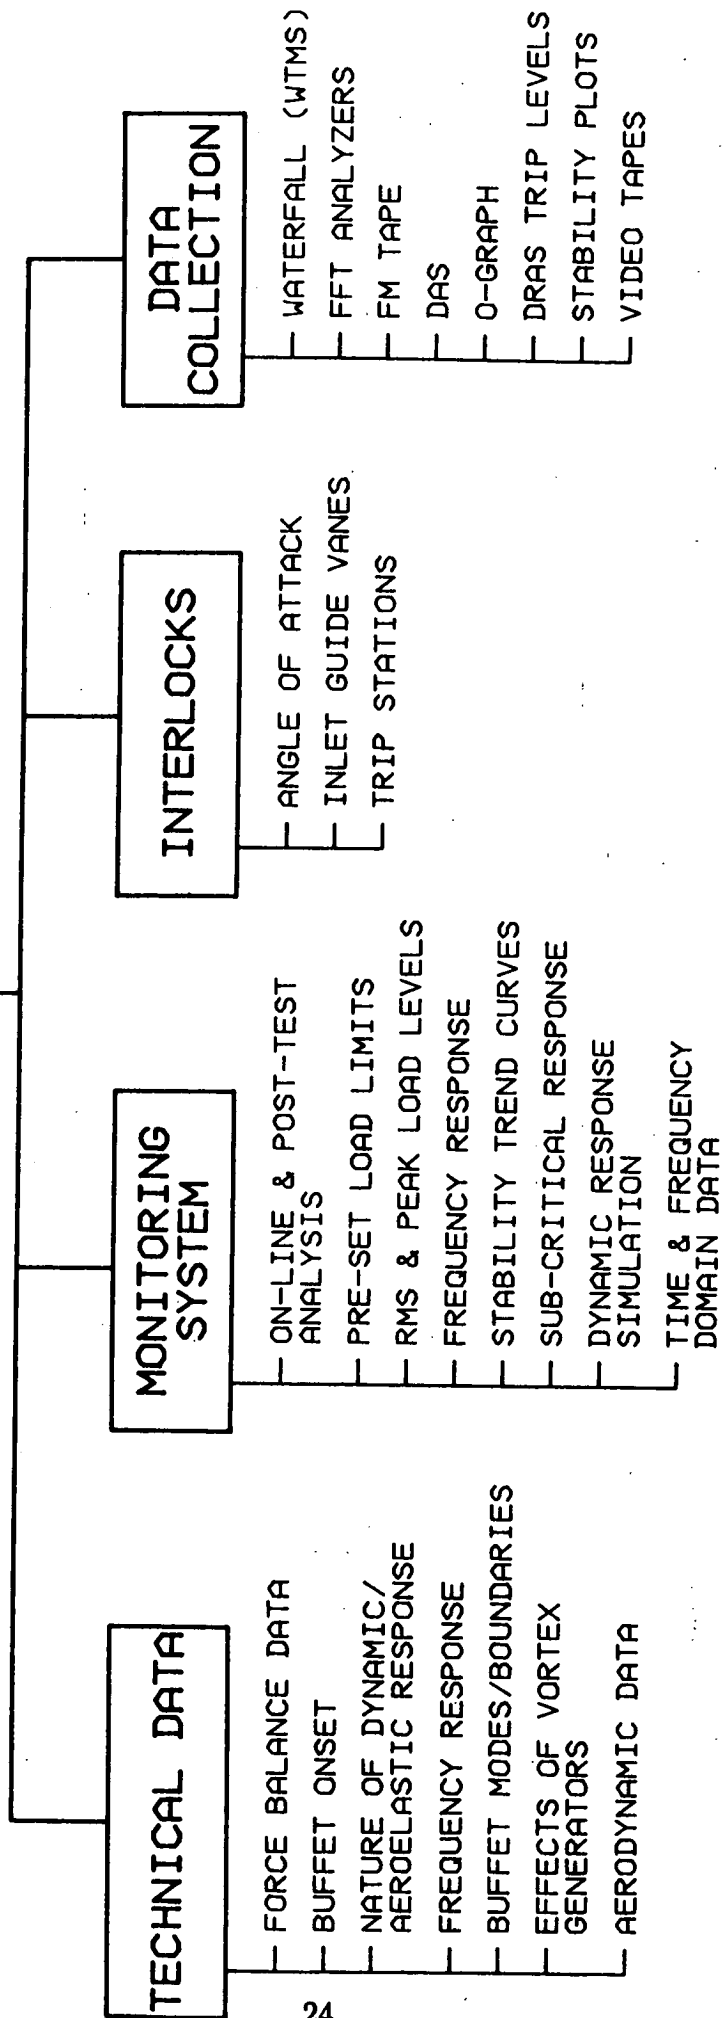

HAZARDS ANALYSIS

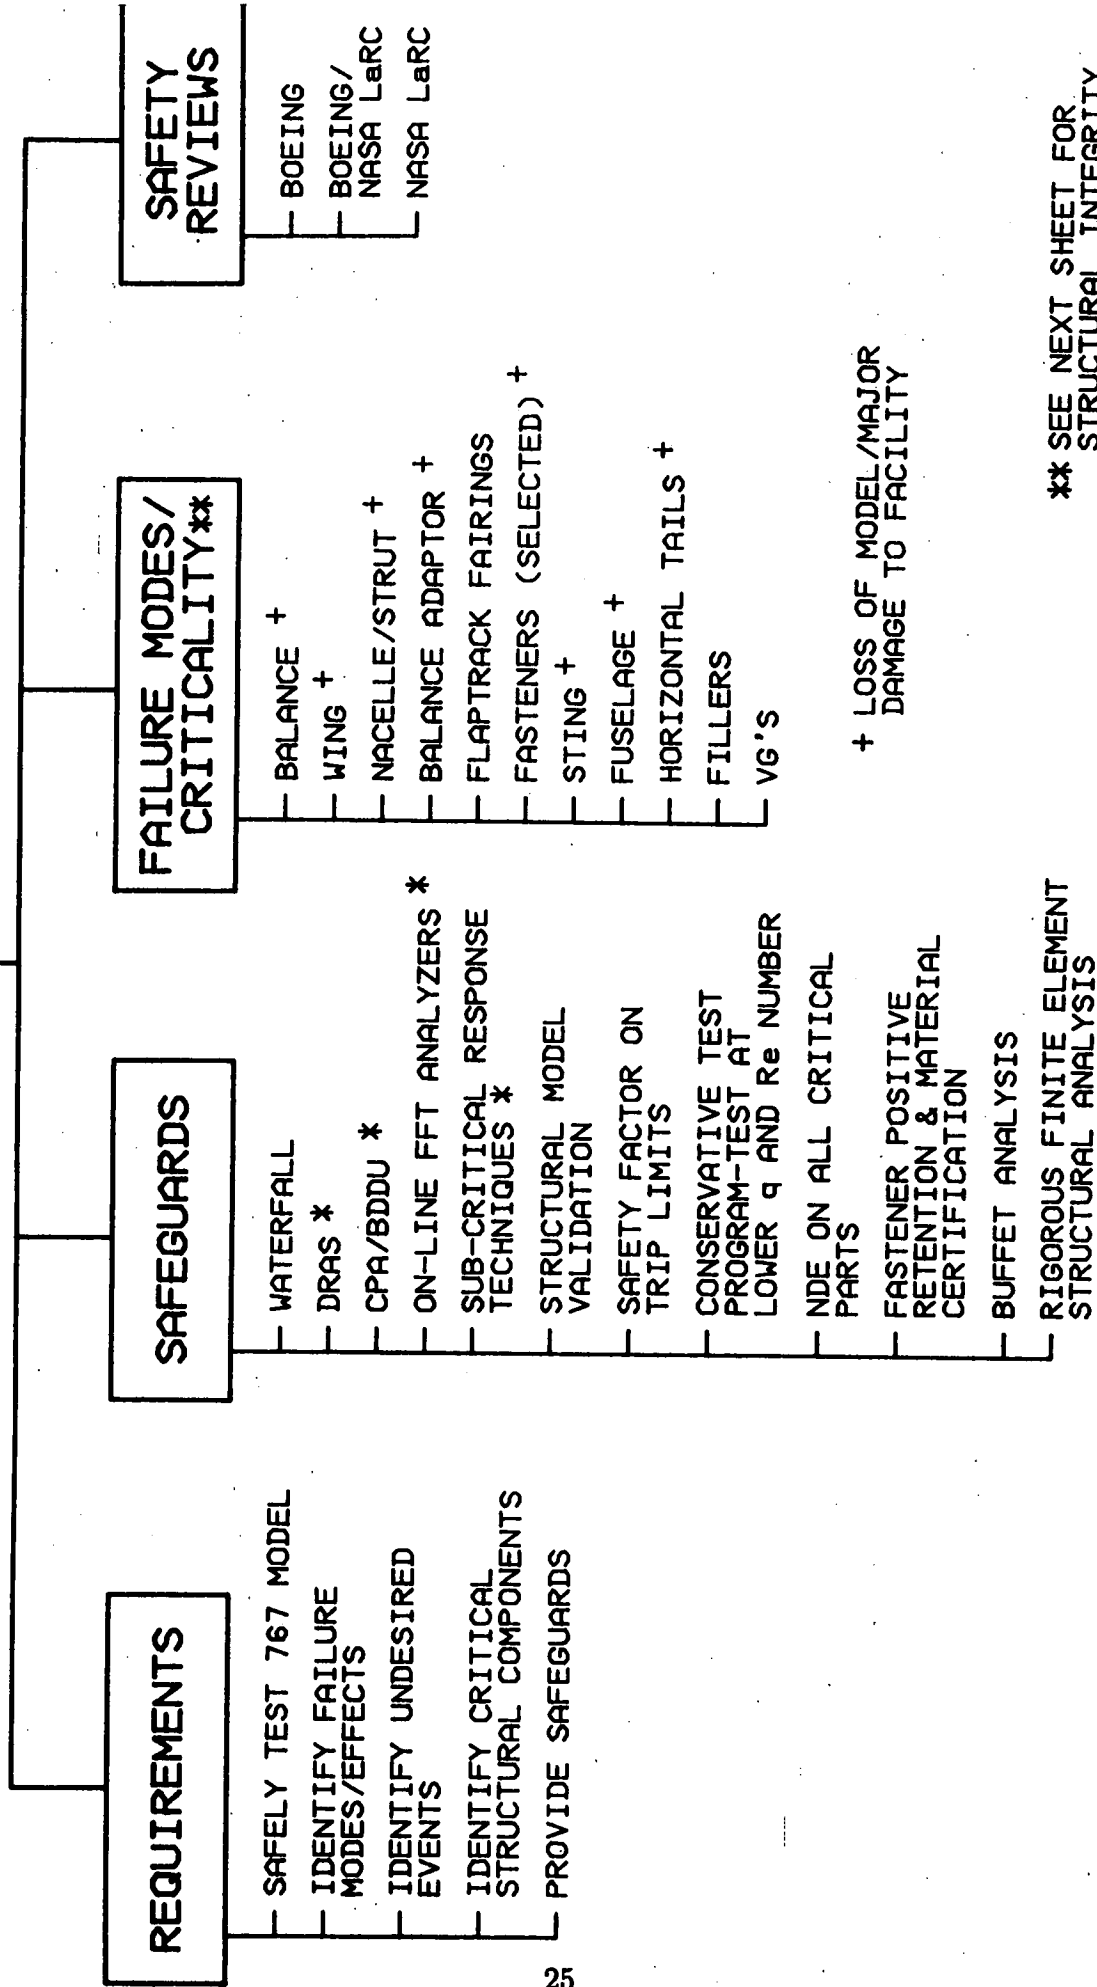


** SEE NEXT SHEET FOR STRUCTURAL INTEGRITY ASSESSMENT

* INTERLOCK TRIPS ON ANGLE OF ATTACK AND INLET GUIDE VANES - AUTOMATIC AND MANUAL

RISK ASSESSMENT

STRUCTURAL INTEGRITY KEY ELEMENTS

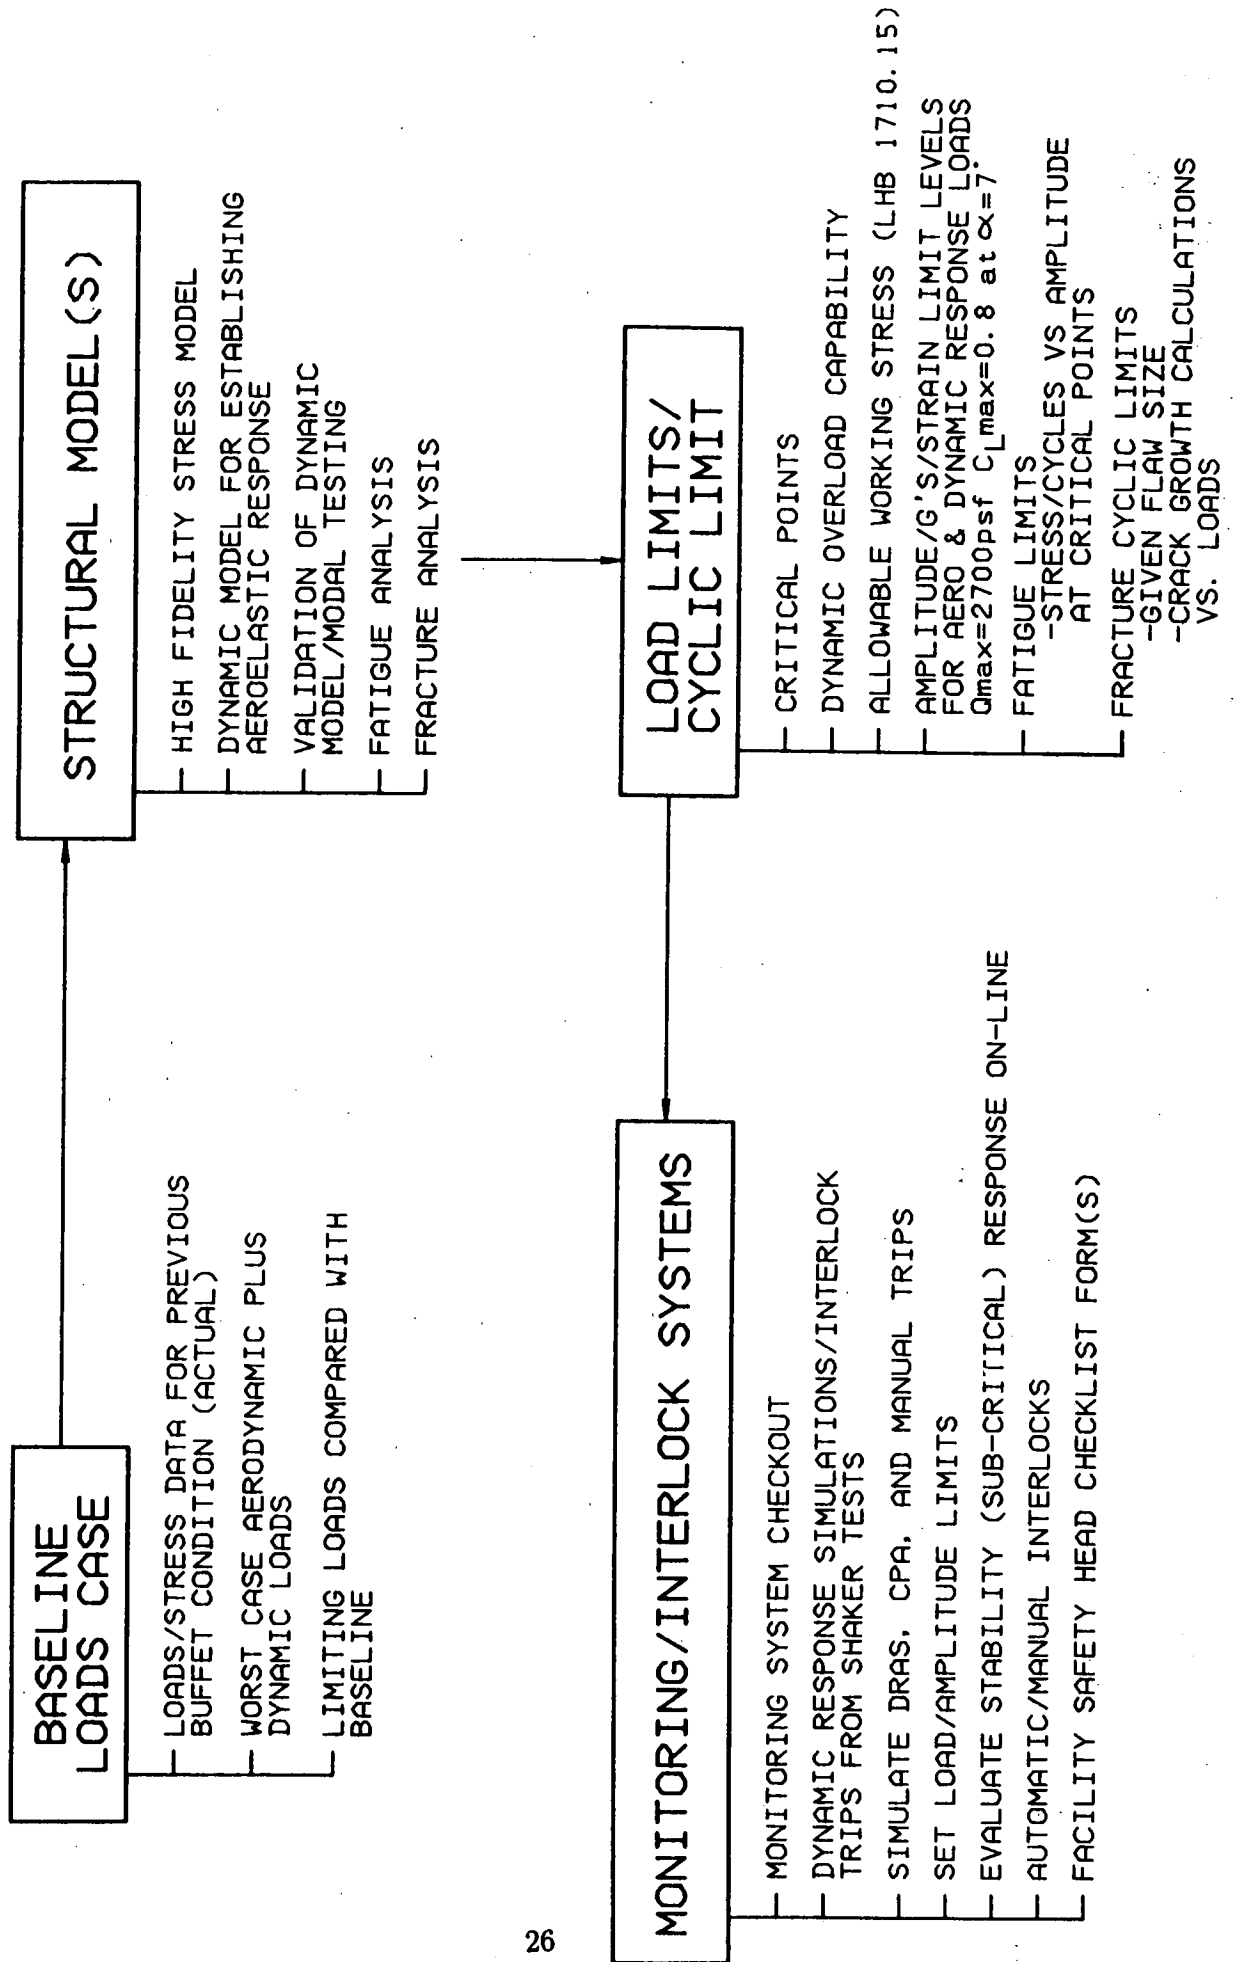

Appendix D
Special Procedure For Model Protection
Interlock Variable Inputs

Special Procedure
Model Protection Interlock Variable Inputs
Boeing 767 Test #038

Purpose: The purpose of this procedure is to provide a series of checklist items that will be approved by the Facility Safety Head prior to operating the tunnel. The checklist items are for the safe management of instrumentation interlock variable inputs that are critical to protecting the structural integrity of the test model and the model support system. Prior to each new run where a variable (limit) change is required or to reset system after an interlock trip, the following checklist will be used. The test director will be responsible for tracking variable input changes throughout the test program and interlock trip conditions.

Objective: The objective of this procedure is to ensure that interlock limits defined as variable inputs are properly maintained and correctly entered into the proper instrumentation device(s) figure 1. The instrumentation devices are the critical components for sensing (automatic/visual) model buffeting boundaries and initiating the appropriate interlock actions. Incorrect variable input entries may result in model/support system failure and tunnel damage as identified in the NTF/Boeing 767 Safety Analysis Review.

Scope: Prior to running a selected test condition, (Mach Number, Reynolds Number $\{R_e\}$ and Dynamic Pressure $\{Q\}$), the test director will review the need to change interlock variables and/or verify the current variable inputs (no changes from the last checklist sign-off). Any discrepancies or input changes are to be documented and/or changed via this special procedure.

Seven (7) stations have been identified as noted on Figure 2. Each station will have an assigned person who is responsible for equipment operation, calibration and variable (limit) input. Each assigned person(s) will sign off the indicated items on this checklist.

Procedure Approved: Rev. A

FSH: _____

FC: _____

**Model Protection Interlock Checklist
Variable Inputs**

Date: _____
Time: _____

Test Condition

Run	Mach	R_e	Q (psf)	U/Inv	Trip	Reset

STATION 1: Assigned to: _____

INITIAL
NASA/Boeing

1.1	DRAS #1	Channel 1	Channel 2		
	Trip Level Millivolts Pk	_____	_____	_____	_____
	Maximun Freq-HZ	_____	_____	_____	_____
	Flutter Freq-HZ	_____	_____	_____	_____
	No. Events	_____	_____	_____	_____
	Relay Enable	_____	_____	_____	_____
	Power	_____	_____	_____	_____

1.2	DRAS #2	Channel 1	Channel 2		
	Trip Level Millivolts Pk	_____	_____	_____	_____
	Maximun Freq-HZ	_____	_____	_____	_____
	Flutter Freq-HZ	_____	_____	_____	_____
	No. Events	_____	_____	_____	_____
	Interlocks Checked	_____	_____	_____	_____
	Power	_____	_____	_____	_____

1.3 WATERFALL _____

1.4 WATERFALL (Slave) _____

STATION 2: Assigned to _____

INITIAL

2.1	FFT		
	Wing	_____	
	Strut	_____	
	Balance	_____	

2.2 FFT (All Channels) _____

STATION 3: Assigned to _____

3. TV Monitors _____

**Model Protection Interlock Checklist
Variable Inputs**

STATION 4: Assigned to _____ INITIAL

4.1 Tape Recorder _____

4.2 Power Supplies _____

4.3 Gain Settings/Voice Record _____

4.4 Technician Available _____

STATION 5: CPA Assigned to _____

5.1	Normal	Axial	Pitch	Roll	Yaw	Side	
Ch1	08	13	14	17	35	14	_____
Ch2	38	00	42	00	09	10	_____
Ch3	51	00	24	00	18	07	_____
Ch4	47	00	25	08	07	14	_____
Ch5	58	00	07	03	03	29	_____
Ch6	00	00	00	19	14	67	_____

5.2 Power - On _____

5.3 Mode - Scan _____

5.4 Dynamic Interlock - Checked\on _____

STATION 6: BDDU Assigned to _____

6.1 Set Up per RIOP-20 _____

6.2 Ocilliscope (Yaw Moment) _____
for Monitoring Model Fouling (+20% = 100% ALARM)

STATION 7: Test Director Console

CAUTION

**Ensure correct sign is entered
for "Pitch Home" setpoint.**

7.1 Pitch Home Setpoint U/Inv _____

7.2 Pitch - Armed _____

7.3 Reset Model Protection (FSH) _____

7.4 Model Roll @ 0 Deg. & Red Tagged _____
Test Director/Date _____

Facility Safety Head Approval/Date _____

Comments/Notes:

TABLE I. RUN SCHEDULE FOR 767 TEST PROGRAM

Run	Configuration	Trip	Rn No $\times 10^{-6}/ft$	Mach No	Temperature, F	AOA Schedule	Vortex Generators	Comments
1	WBTMNH	ON	7.5	0.60	120	A	OFF	
2	WBTMNH	ON	7.5	0.70	120	A	OFF	
3	WBTMNH	ON	7.5	0.75	120	A	OFF	
4	WBTMNH	ON	7.5	0.80	120	A	OFF	
5	WBTMNH	ON	7.5	0.82	120	A	OFF	
6	WBTMNH	ON	7.5	0.84	120	A	OFF	
7	WBTMNH	ON	7.5	0.86	120	A	OFF	
8	WBTMNH	ON	7.5	0.88	120	A	OFF	
9	WBTMNH	ON	7.5	0.60	120	B	OFF	Inverted
10	WBTMNH	ON	7.5	0.80	120	B	OFF	Inverted
11	WBTMNH	ON	7.5	0.88	120	B	OFF	Inverted
12	WBTMNH	OFF	35	0.80	-250	C	ON	
13	WBTMNH	OFF	40	0.80	-250	C	ON	
14	WBTMNH	OFF	45	0.80	-250	C	ON	
15	WBTMNH	OFF	50	0.80	-250	C	ON	
16	WBTMNH	OFF	55	0.80	-250	C	ON	
17	WBTMNH	OFF	60	0.80	-250	C	ON	
18	WBTMNH	OFF	67	0.80	-250	C	ON	
19	WBTMNH	OFF	35	0.80	-250	C	OFF	
20	WBTMNH	OFF	40	0.80	-250	C	OFF	
21	WBTMNH	OFF	45	0.80	-250	C	OFF	
22	WBTMNH	OFF	55	0.80	-250	C	OFF	
23	WBTMNH	OFF	60	0.80	-250	C	OFF	
24	WBTMNH	OFF	67	0.75	-250	D	OFF	
25	WBTMNH	OFF	67	0.82	-250	E	OFF	
26	WB	OFF	67	0.80	-250	C	OFF	
27	WB	OFF	35	0.80	-250	A	OFF	
28	WB	ON	7.5	0.80	120	A	OFF	

AOA SCHEDULES:

- A: -4 to 7 by 0.5
- B: -4 to 4 by 1
- C: 0, 2, 3, 3.5, 3.7, 3.8, 3.9, 4.9,
- D: 0, 2, 4, 4.7, 4.9, 5.0, 5.1, 5.2,
- E: 0, 1, 1.5, 1.6, 1.7, 1.8,

TABLE I. RUN SCHEDULE FOR 767 TEST PROGRAM (Continued)

Run	Configuration	Trip	Rn No $\times 10^{-6}/ft.$	Mach No	Temperature, F	AOA Schedule	Vortex Generators	Comments
30	WBTMNH	OFF	32.72	0.80	-250	C	OFF	Inverted, cold, VGs off
31	WBTMNH	OFF	32.72	0.80	-250	C	OFF	Upright, Reynolds number sweep, VGs off
32	WBTMNH	OFF	44.33	0.80	-250	D	OFF	
33	WBTMNH	OFF	49.61	0.80	-250	D	OFF	
34	WBTMNH	OFF	53.83	0.80	-250	D	OFF	
35	WBTMNH	OFF	59.11	0.80	-250	D	OFF	
36	WBTMNH	OFF	64.39	0.80	-250	D	OFF	
37	WBTMNH	OFF	67.55	0.80	-250	D	OFF	
38	WBTMNH	OFF	67.55	0.86	-250	G	OFF	Mach number sweep with VGs off
39	WBTMNH	OFF	67.55	0.82	-250	E	OFF	
40	WBTMNH	OFF	67.55	0.75	-250	F	OFF	
41	WBTMNH	OFF	67.55	0.70	-250	F	OFF	
42	WBTMNH	OFF	67.55	0.84	-250	H	OFF	
43	WBTMNH	OFF	67.55	0.80	-250	D	OFF	(repeat of run 37)
44	WB	OFF	67.55	0.80	-250	D	OFF	Wing-body for CFD analysis
45	WB	OFF	32.72	0.80	-250	C	OFF	
46	WB	ON	7.5	0.80	120	C	OFF	
THE FOLLOWING RUN GROUPINGS ARE "AS NEEDED" FOR INVESTIGATION OF THE MODEL DYNAMICS								
47	WBTMNH	OFF	59.11	0.80	-250	BUZZ*	OFF	R _n effect at constant q
48	WBTMNH	OFF	57.04	0.80	-245	BUZZ	OFF	
49	WBTMNH	OFF	55.1	0.80	-240	BUZZ	OFF	
50	WBTMNH	OFF	55.1	0.80	-222	BUZZ	OFF	q effect at constant R _n
51	WBTMNH	OFF	55.1	0.80	-215	BUZZ	OFF	
52	WBTMNH	OFF	55.1	0.80	-202	BUZZ	OFF	
53	WBTMNH	OFF	55.1	0.80	-190	BUZZ	OFF	
54	WBTMNH	OFF	55.1	0.80	-178	BUZZ	OFF	

*Note: Buzz and Roll
Buffet are Synonymous

TABLE II. SUMMARY OF MEASURED MODEL
SYSTEM PRIMARY STRUCTURAL MODES AND FREQUENCIES

<u>Mode Description</u>	<u>Frequency, Hz</u>
Sting Bending (Yaw Plane)	5.8
Sting Bending (Pitch Plane)	11
Pitch Motion (Balance)	17
Roll/Yaw (Balance)	19
Roll	23
Wing Bending (1st Mode Sym.)	55
Wing Bending (1st Mode Asym.)	77

TABLE III. CRITICAL LOADING/
FAILURE LOCATIONS FOR VARIOUS VIBRATION MODES

<u>Mode</u>	<u>Critical Area</u>
20 Hz Roll	Wing @ Sta 9.30 Aft Fastener Hole
55 Hz Bending	Wing @ Sta 9.30 Aft Fastener Hole
1st Wing (Sym)	Wing @ Sta 9.30 Aft Fastener Hole
1st Wing (Asym)	Wing @ Sta 9.30 Aft Fastener Hole
Loose Fasteners	Wing, Horizontal, Nacelles
Other Vibrations	Upper Swept Strut Blade

TABLE IV. WING STRESS CALCULATIONS (NORMALIZED)

<u>Loading Mode</u>	<u>Stress @ Nacelle Hole</u>	<u>Maximum Stress</u>	<u>Wing Tip Deflection 100 G</u>
Air (2700 Q)	30555 (73332)	45343	N/A
Air + 100 Gs @ 20 Hz	42000 (108000)	67553	5.5 "
Air + 100 Gs @ 50 Hz	50555 (121332)	81887	.88"
Air + 100 Gs @ 84 Hz	36050 (86520)	61545	.32"
Air + 100 Gs @ 86 Hz	35120 (84288)	56645	.31"

TABLE V. SUMMARY OF CRITICAL MODEL
COMPONENTS, FACTORS OF SAFETY, AND FAILURE ACCEPTABILITY
FOR 20 Hz ROLL MODE - 100 g's AT WING TIP

Component	Static & Dynamic Stress Level/F.S.			Failure Acceptable?
Wing	73332	108000	/2.38	No
Horizontal Tail	79688	97089	/2.60	No
Nacelle & Strut	17310	28043	/4.85	No
Sting (Blade)	50097	71305	/3.50	No
Balance Adaptor	97328	97330	/2.60	No
Body	10703	18524	/13.5	No
Flap Track Fairing Assy	<1200	12000	/20.8	Yes
Wing Bolts	1429 LBF	3261 LBF	/2.7	No
Nacelle Bolts	152 LBF	246 LBF	/3.35	No
Horizontal Bolts	1476 LBF	3228 LBF	/2.38	No
Vortex Generators	Low		Low	Yes
Balance	31462 In-lb		350% Overload	No

TABLE VI. UNDESIRE EVENTS & RISK ASSESSMENT

UNDESIRE EVENT	CONSEQUENCE	RISK	SAFEGARDS	RISK
Model component failure	Damage to tunnel Internals e.g. flow liners turning vanes, fan blades, Inlet guide vanes	LOW	<ul style="list-style-type: none"> • Install debris fence in turn #1 • Fence not designed for Impact loads • Location questionable for capturing model parts at high velocity 	HIGH
Loss of wing VG's	Amplitude of response grows without bounds resulting in model component failure and possible tunnel damage	HIGH	<ul style="list-style-type: none"> • Install catcher screen in front of turn #1 to protect fan blades due to model component break-up • Fabrication/Installation schedule beyond scope of 767 test - beyond 10 weeks 	LOW
System(s) will not failsafe on Interlock signal	Double order failure of both Pitch and IGV system to damage model or tunnel	LOW	<ul style="list-style-type: none"> • VG's painted for easy identification/Inspection prior to each run • Test terminated immediately Interlock initiated 	LOW
		LOW	<ul style="list-style-type: none"> • Defined Interlock requires two systems to decrease "Q" • Either IGV or Pitch system will unload model within 5 seconds 	LOW

TABLE VI. UNDESIRED EVENTS & RISK ASSESSMENT (Continued)

UNDESIRED EVENT	CONSEQUENCE	RISK	SAFEGARDS	RISK
Sudden onset of buffet	Amplitude of response grows without bounds resulting in model component failure and possible tunnel damage	HIGH	<ul style="list-style-type: none"> ● Model/Balance Monitoring System Interlocks ● Conservative Test Plan and Approach 	LOW
Loss of instrumentation	Loss of monitoring signal(s) at point(s) on model, balance or sting Dynamic limit loads could be exceeded	HIGH	<ul style="list-style-type: none"> ● Test terminated immediately Interlock initiated ● Problem corrected and condition analyzed before proceeding Interlock reset 	LOW
Dynamic response energy shifts to different mode(s) - e.g. from roll to pitch/yaw	Instrumentation/dynamic load limits configured for roll/wing bending response may not trip interlocks	HIGH	<ul style="list-style-type: none"> ● Previous test experience where buffet is pitch/yaw motion utilized balance load to limit response ● Model test instrumentation designed to detect this type of motion ● Conservative test approach will give indication of different energy mode(s) 	LOW
Maximum cyclic limits on model	Further testing could result in model/support system failure and damage to tunnel	HIGH	<ul style="list-style-type: none"> ● Instrumentation trip levels set to initiate interlocks ● Number of cycles entered to trip interlock 	LOW
Incorrect limits entered to trip interlock	Model, balance, sting and tunnel damage	HIGH	<ul style="list-style-type: none"> ● Special Procedures and FSH sign-off to change limit(s) 	LOW

L-91-3784


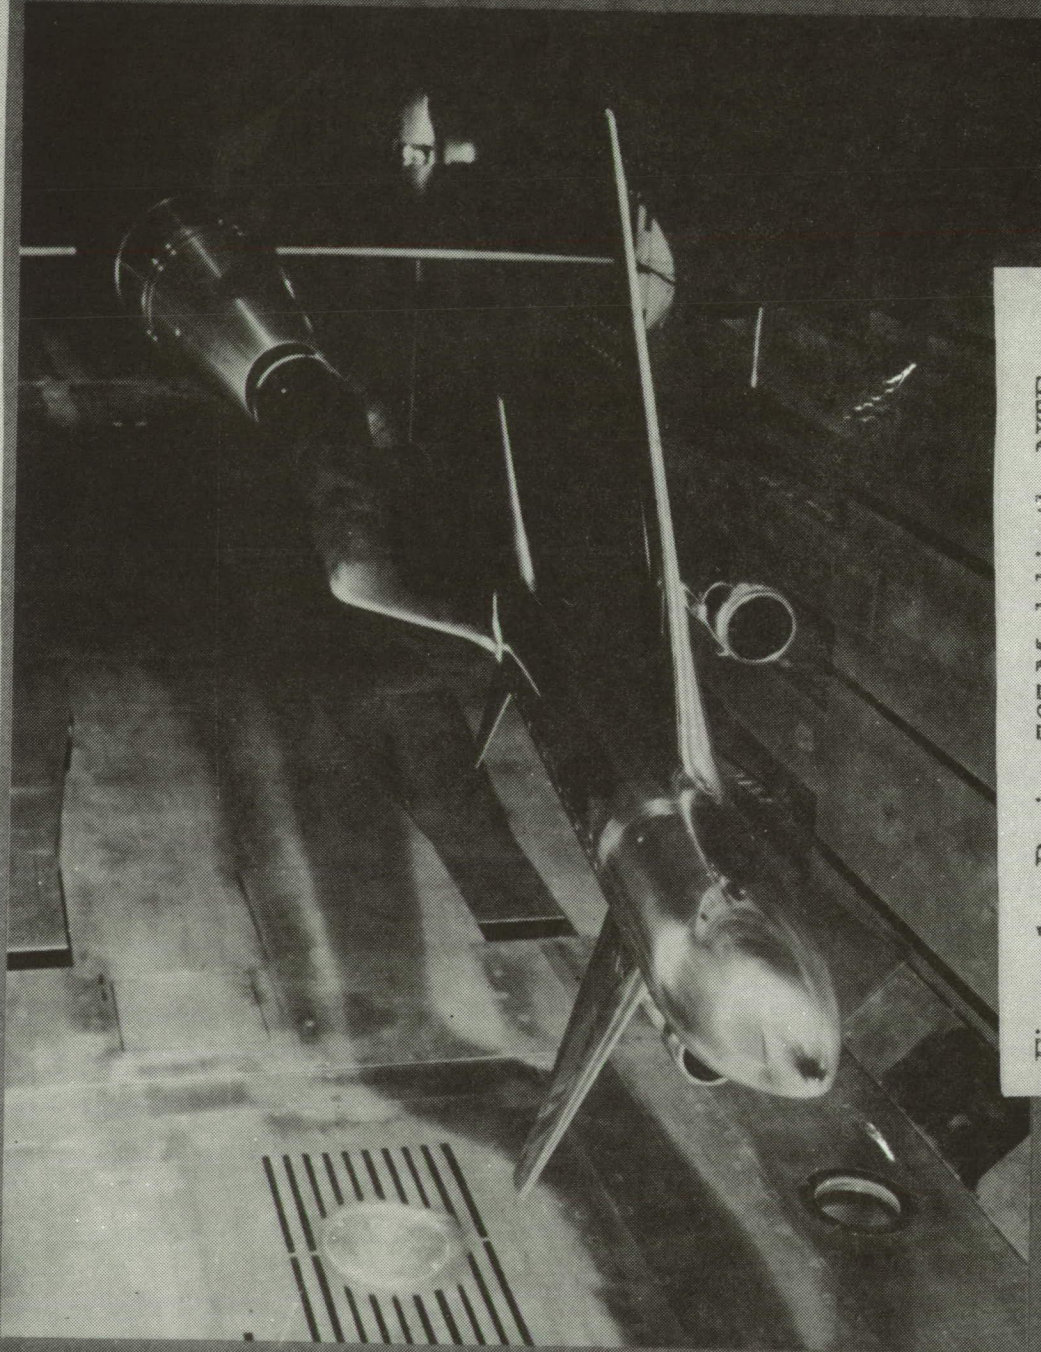


Figure 1. - Boeing 767 Model in the NTF

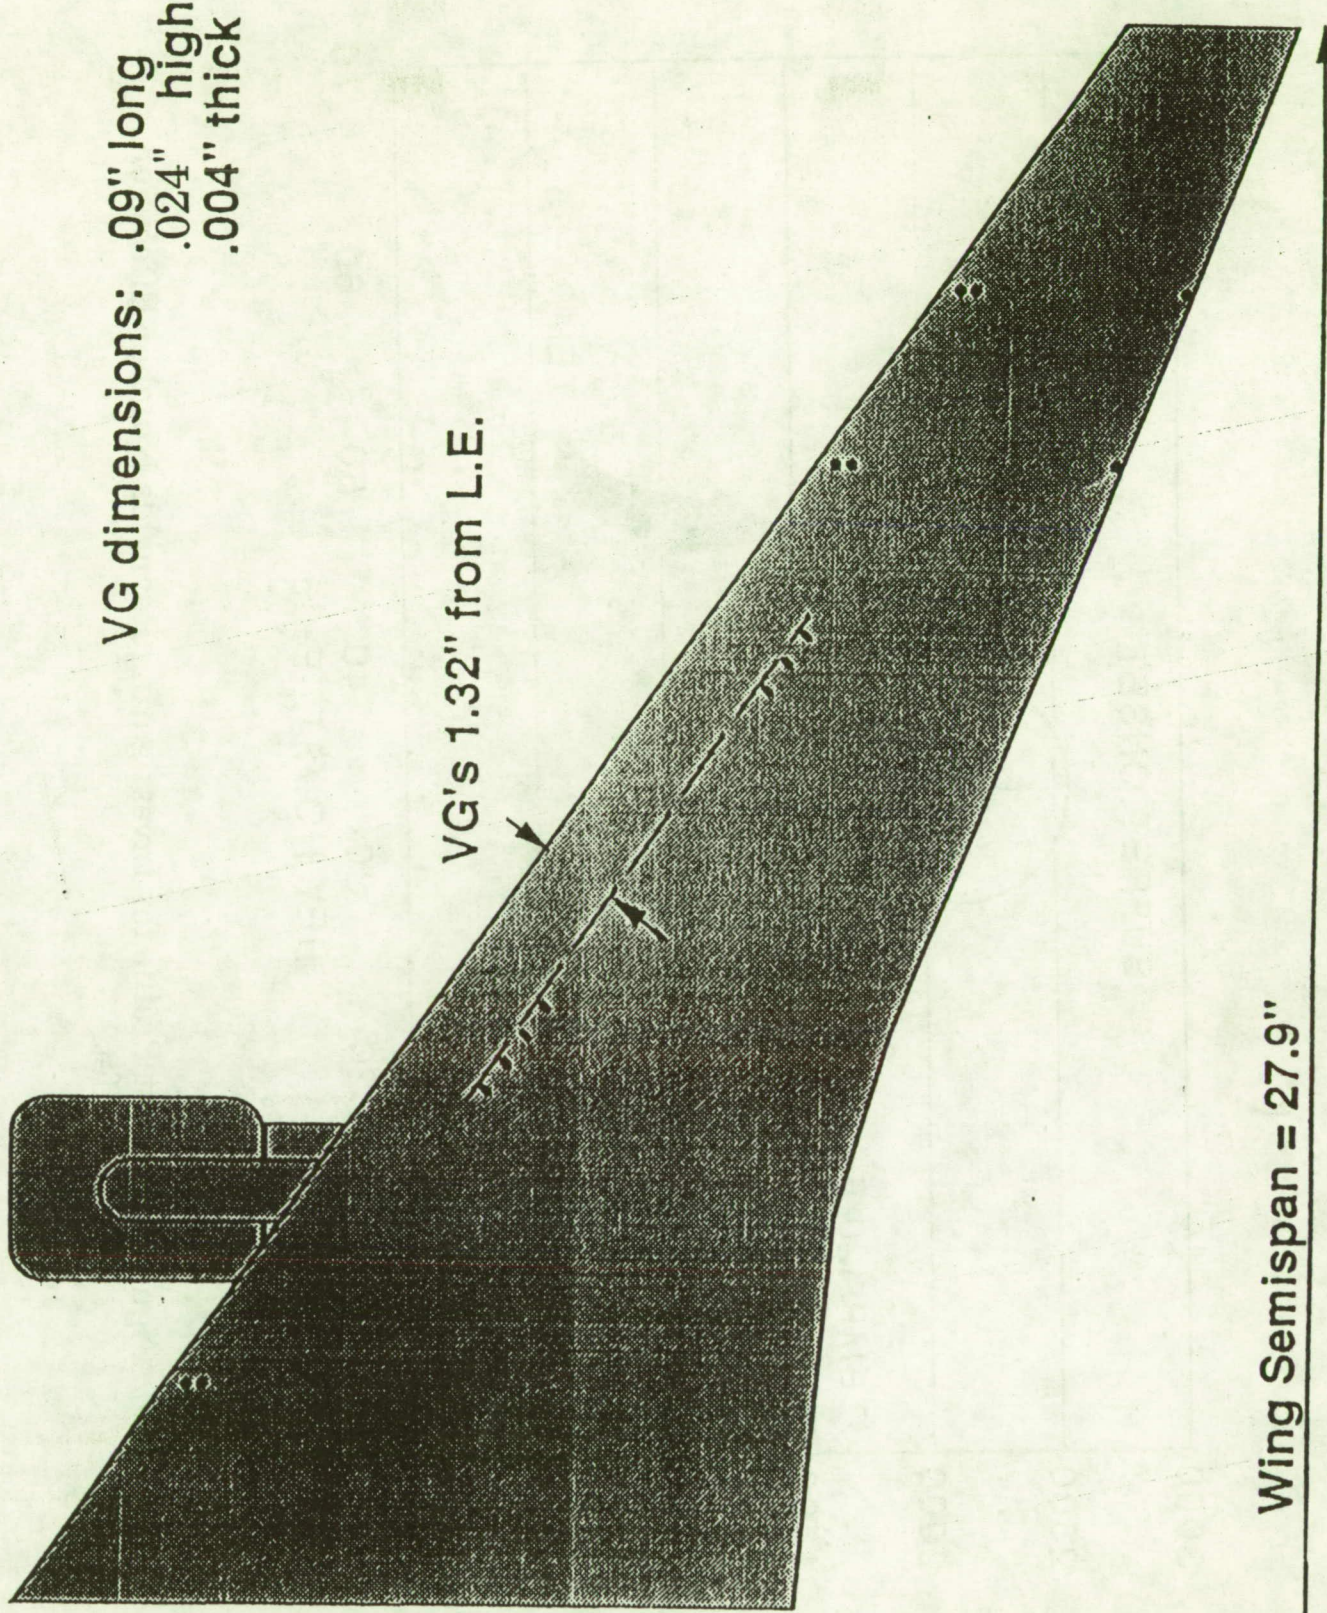

VG dimensions: .09" long
.024" high
.004" thick

VG's 1.32" from L.E.

Wing Semispan = 27.9"

Figure 2.- Vortex Generators Locations on Right Wing.

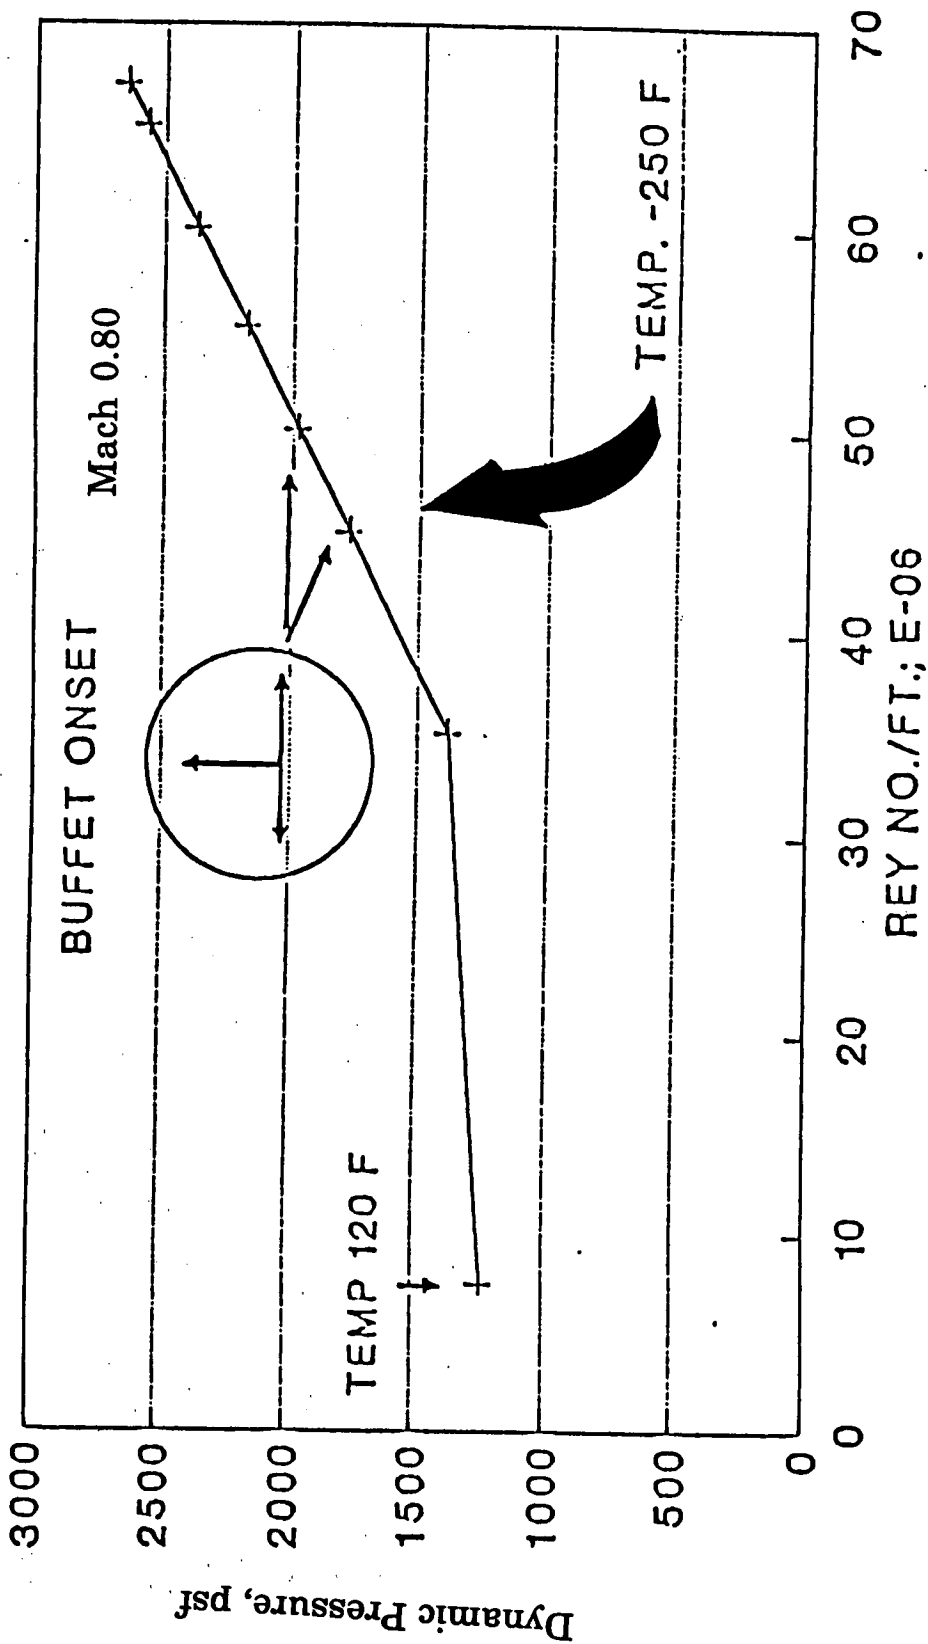


Figure 3. - Test Profile for Investigating Reynolds Number Effects on Buffet.

NASA
L-87-4168

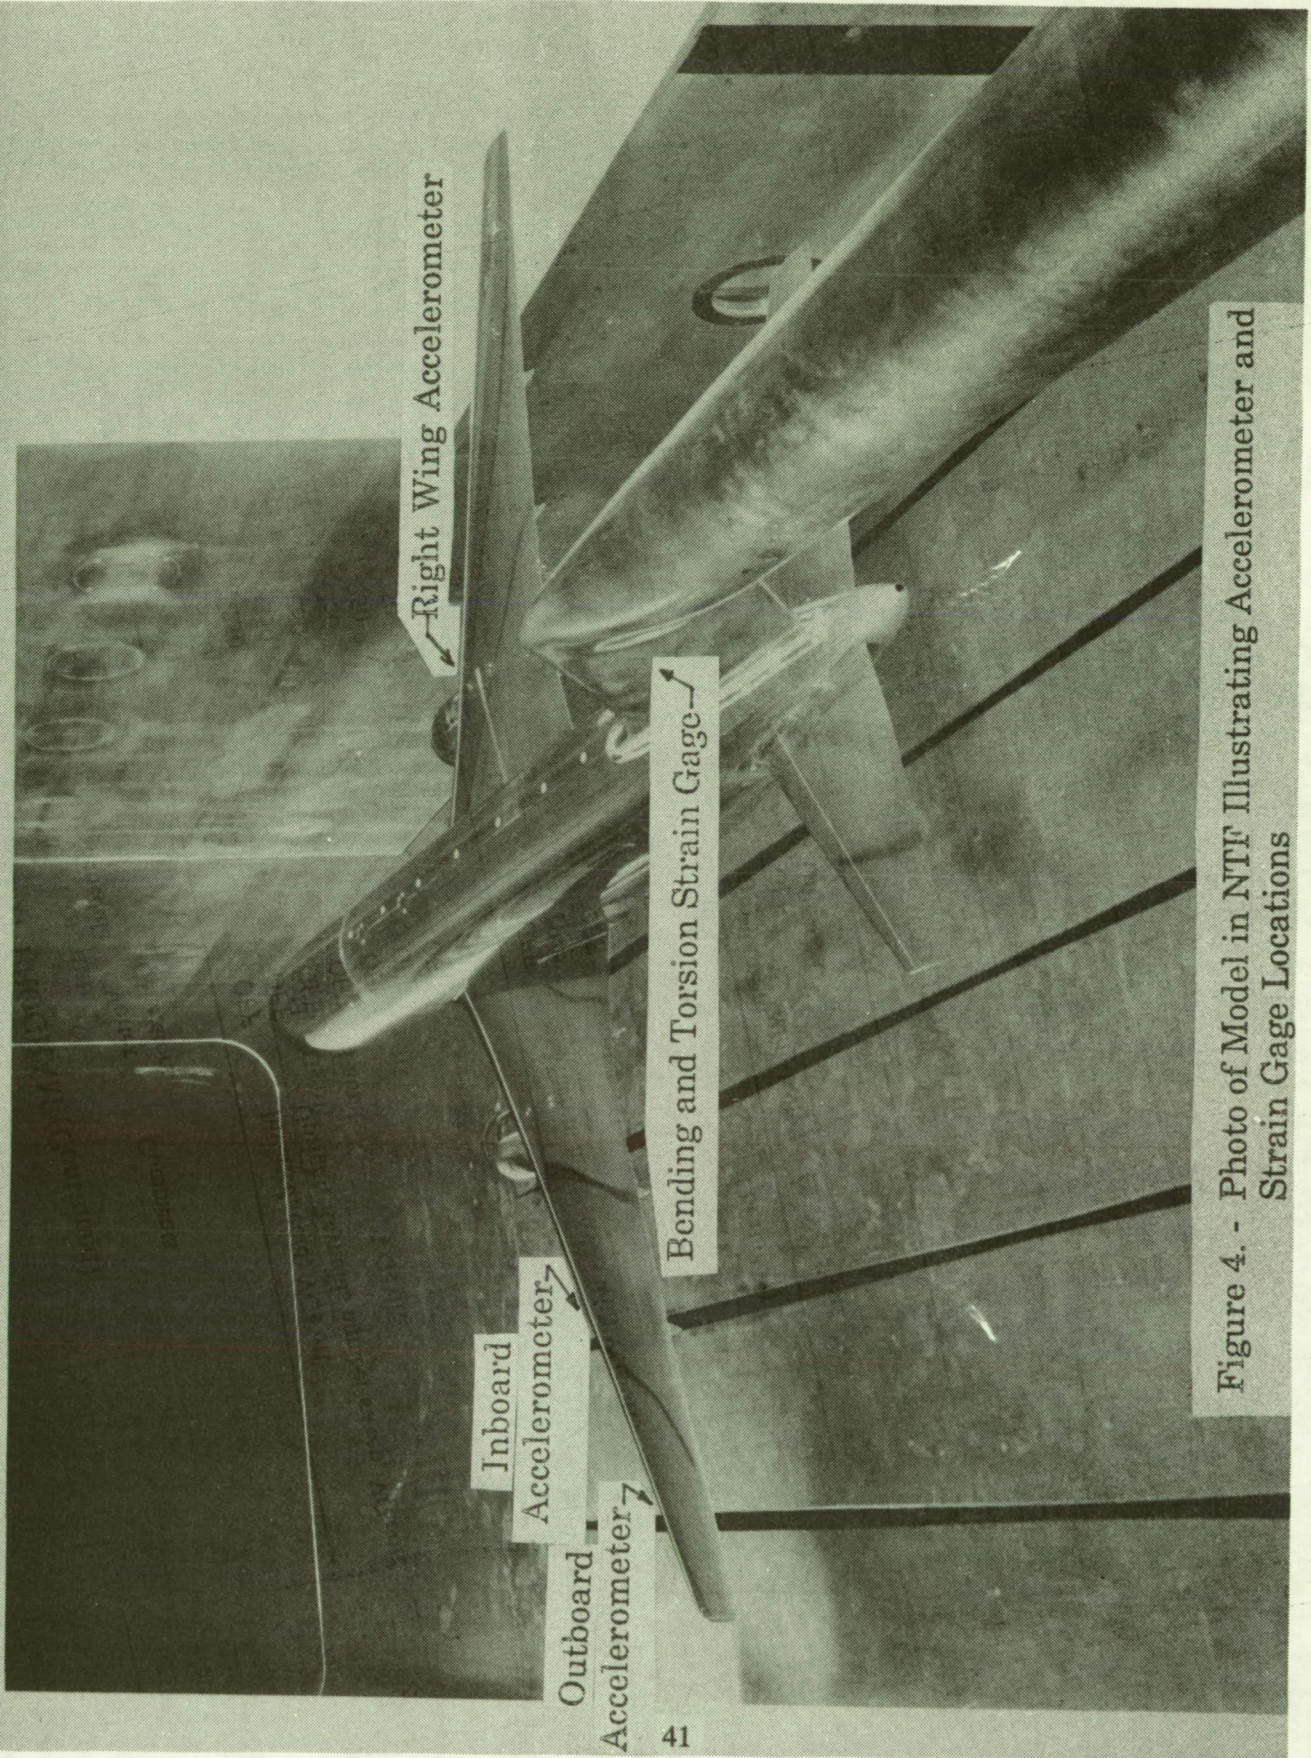


Figure 4. - Photo of Model in NTF Illustrating Accelerometer and Strain Gage Locations

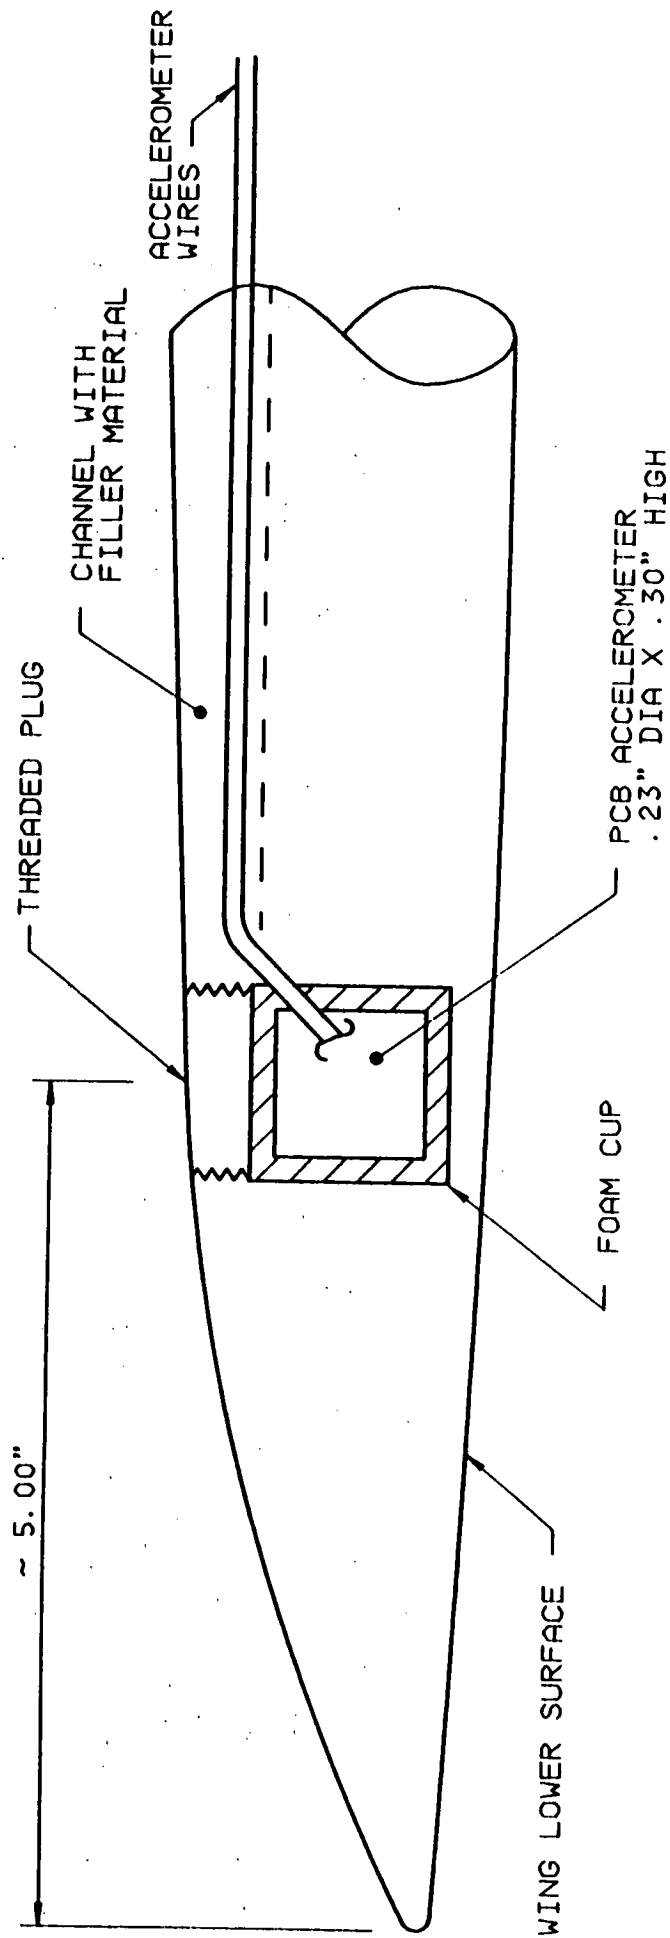


FIGURE 5. ILLUSTRATION OF PCB ACCELEROMETER INSTALLATION AT OUTBOARD LOCATION ON LEFT WING OF MODEL - VIEW LOOKING FORWARD - NOT TO SCALE

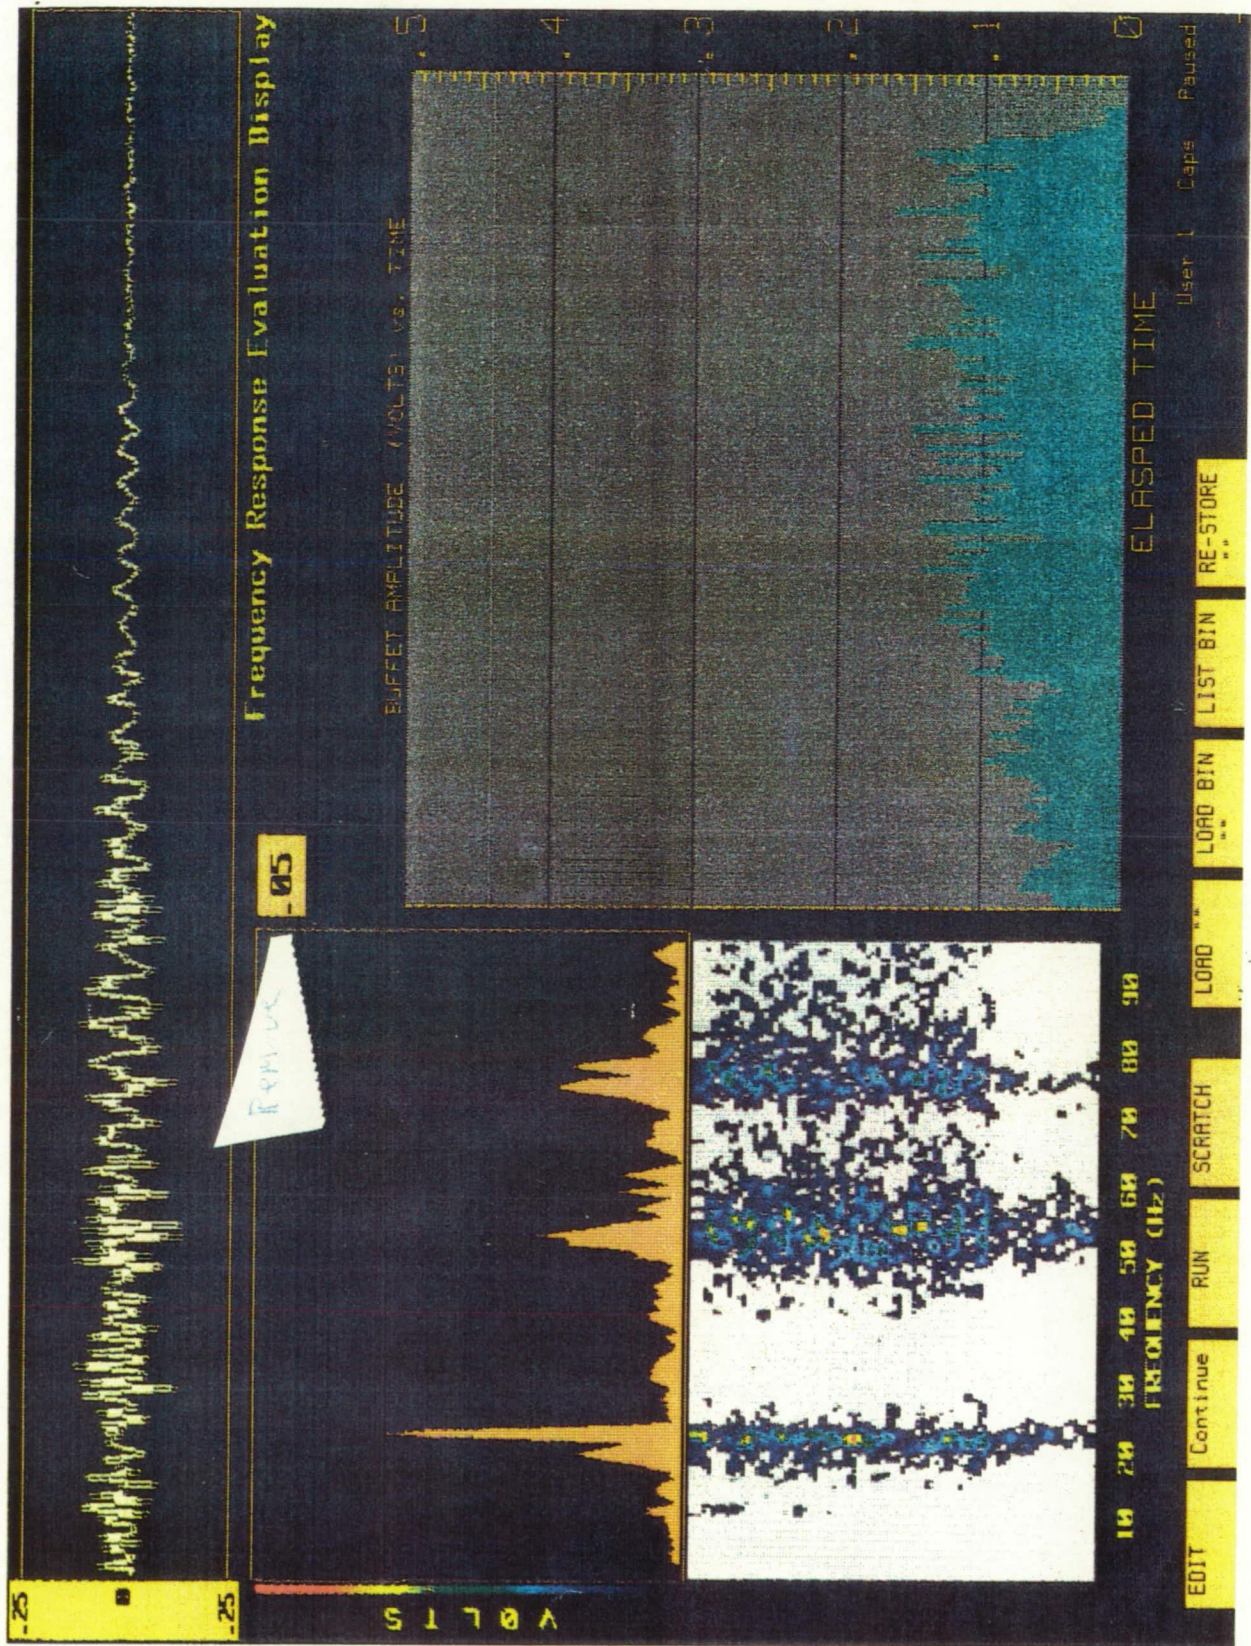


Figure 6. - Example of Colorgraphics Frequency and Time Domain Display for Roll Buffet Condition.

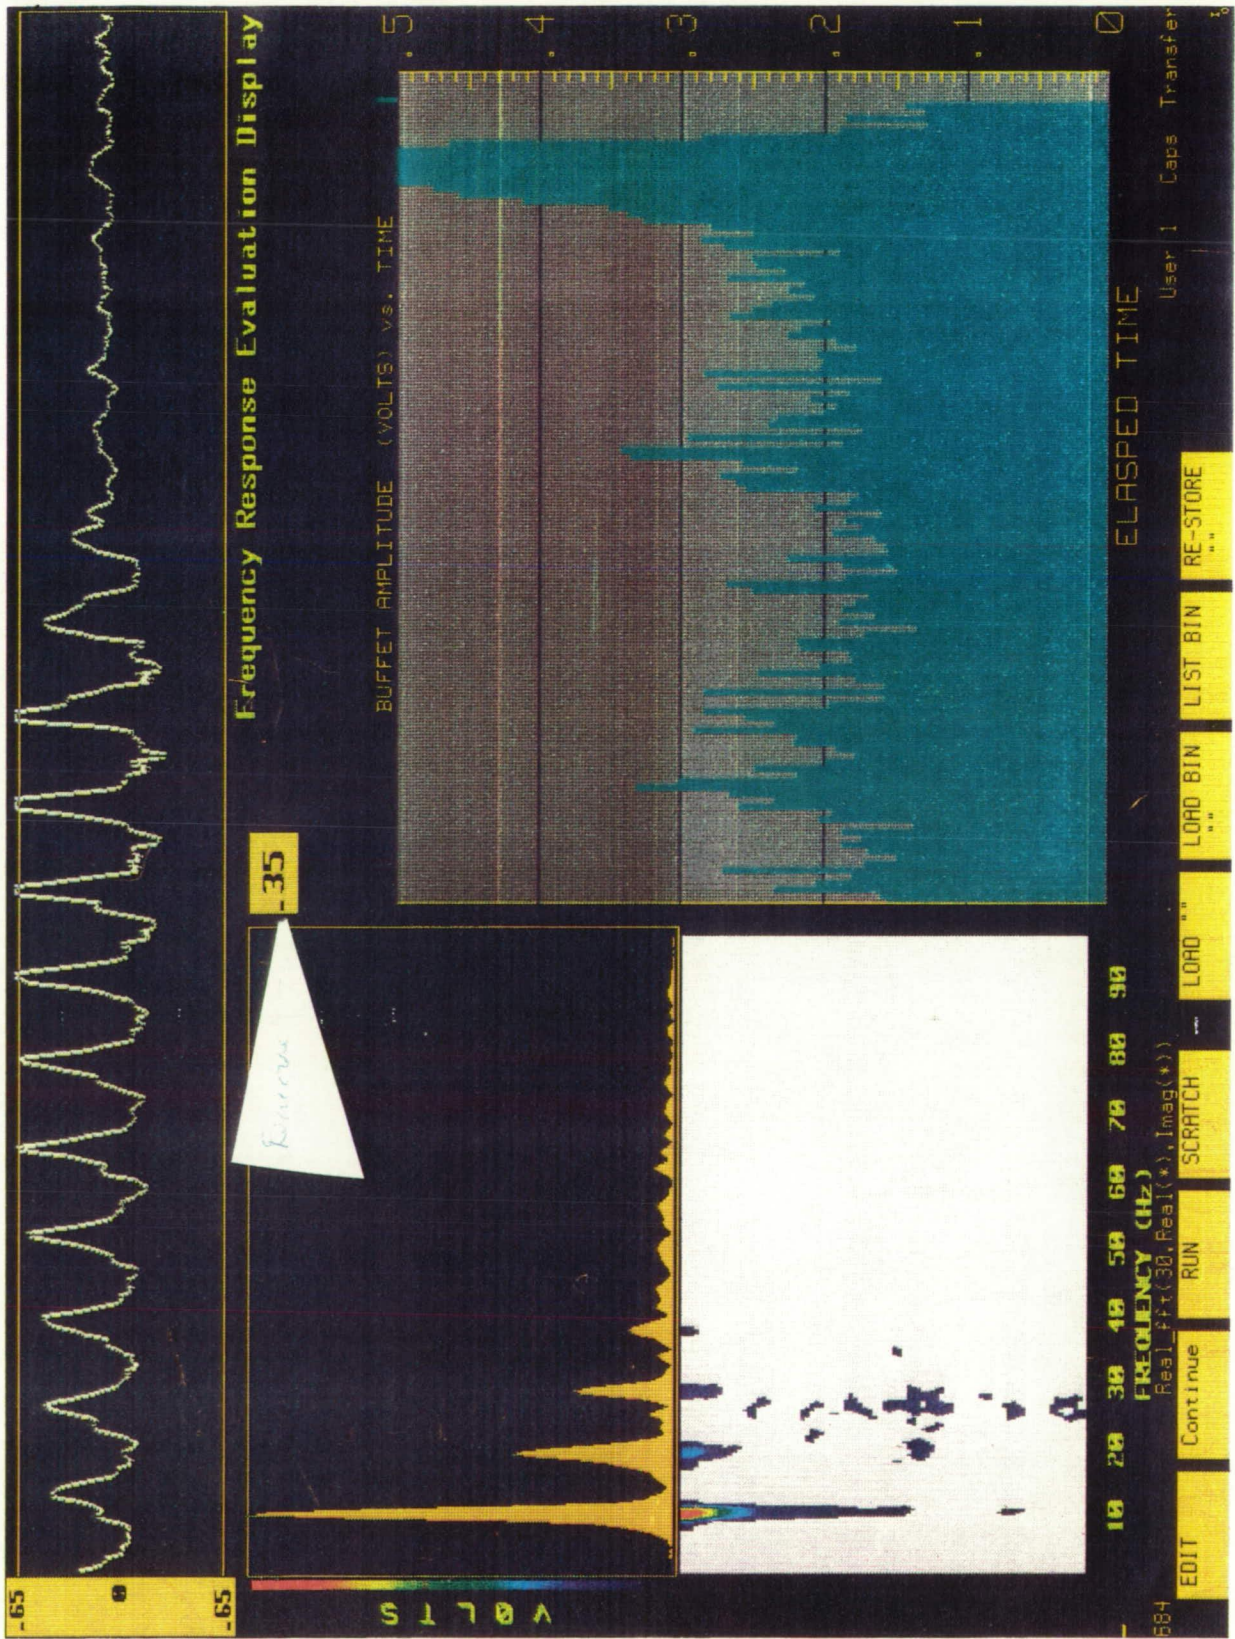


Figure 7. - Example of Colorgraphics Frequency and Time Domain Display for Pitch Buffet Condition.


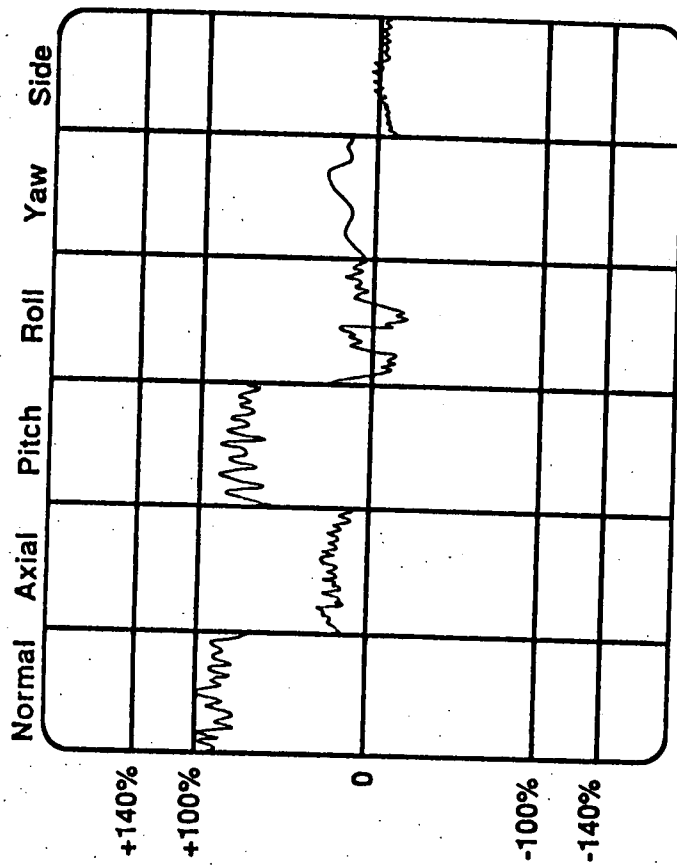


Figure 8. - Typical BDDU Display.

TO SECOND FLOOR
OFFICE SPACE AND
TEST SECTION

TO FIRST FLOOR
AND TEST SECTION

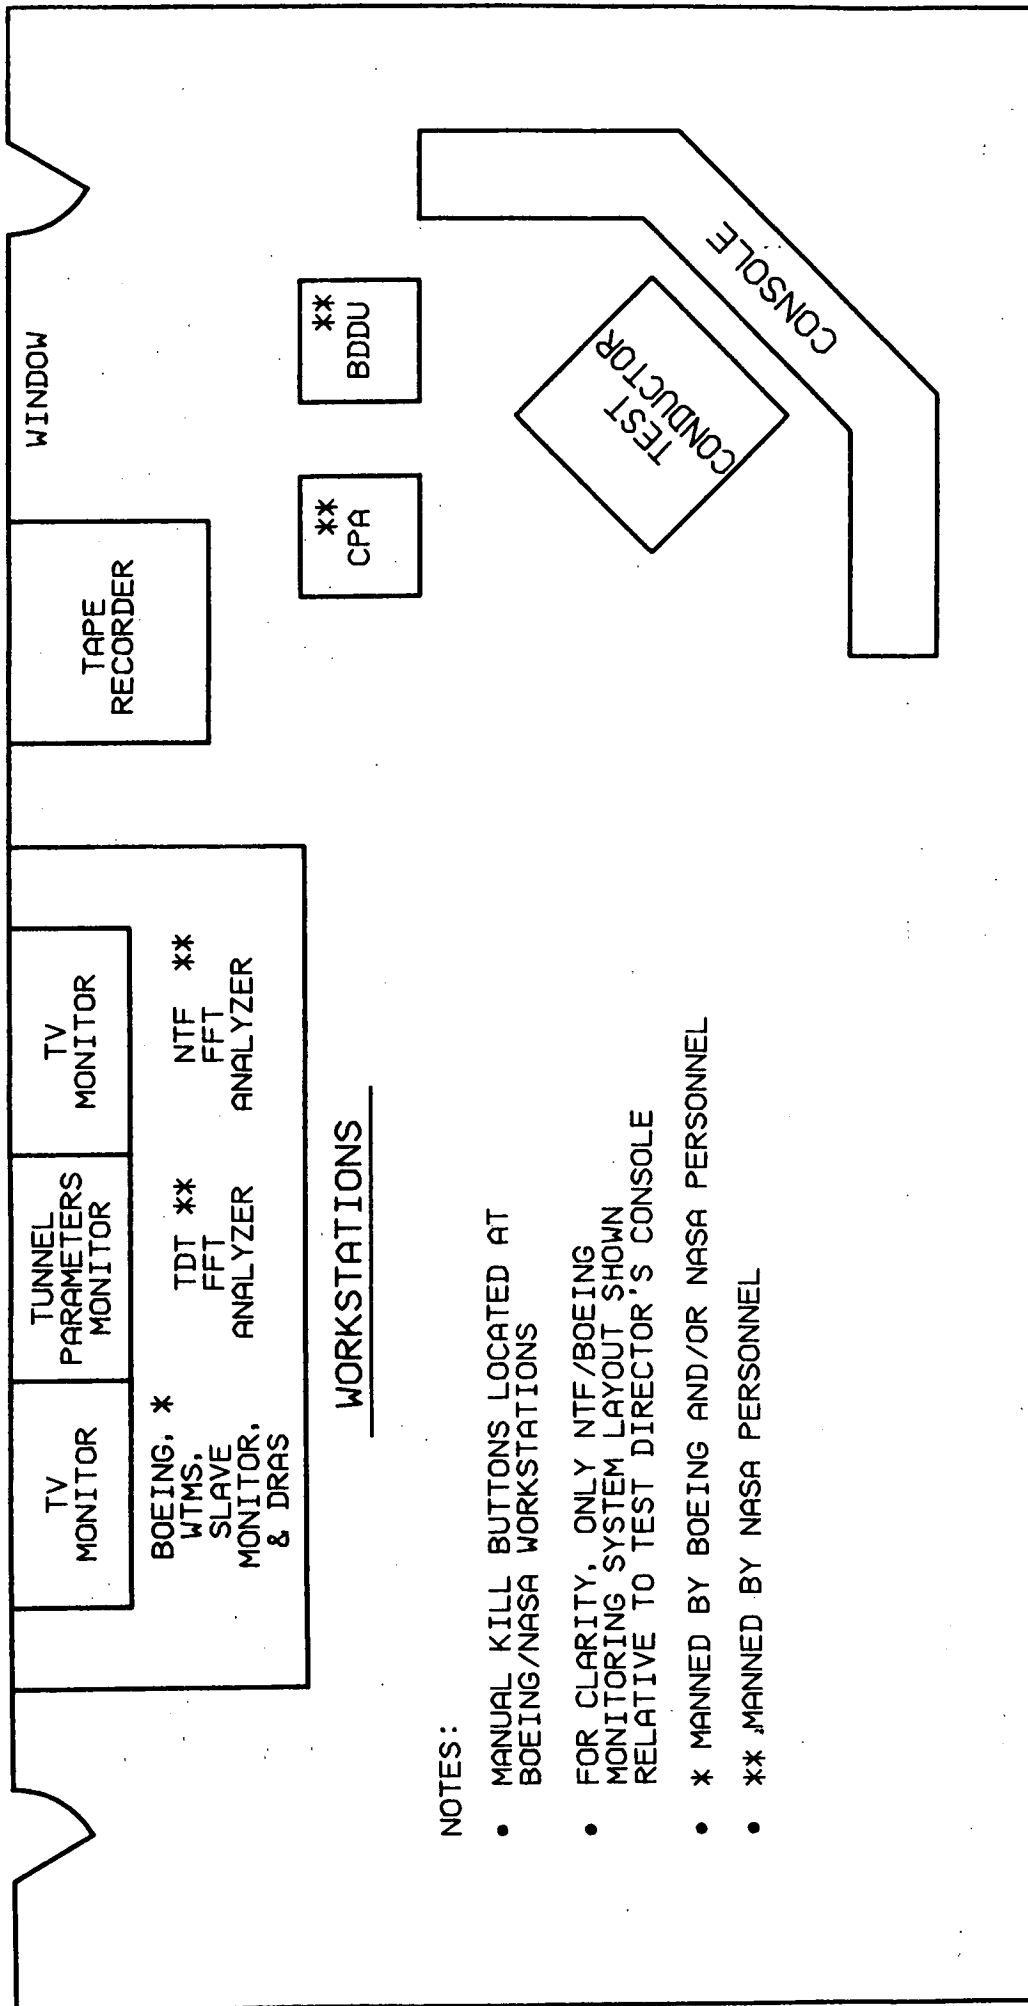

WORKSTATIONS

NOTES:

- MANUAL KILL BUTTONS LOCATED AT BOEING/NASA WORKSTATIONS
- FOR CLARITY, ONLY NTF/BOEING MONITORING SYSTEM LAYOUT SHOWN RELATIVE TO TEST DIRECTOR'S CONSOLE
- * MANNED BY BOEING AND/OR NASA PERSONNEL
- ** MANNED BY NASA PERSONNEL

Figure 9. - Monitoring Systems Location in Control Room.

BOEING

NASA

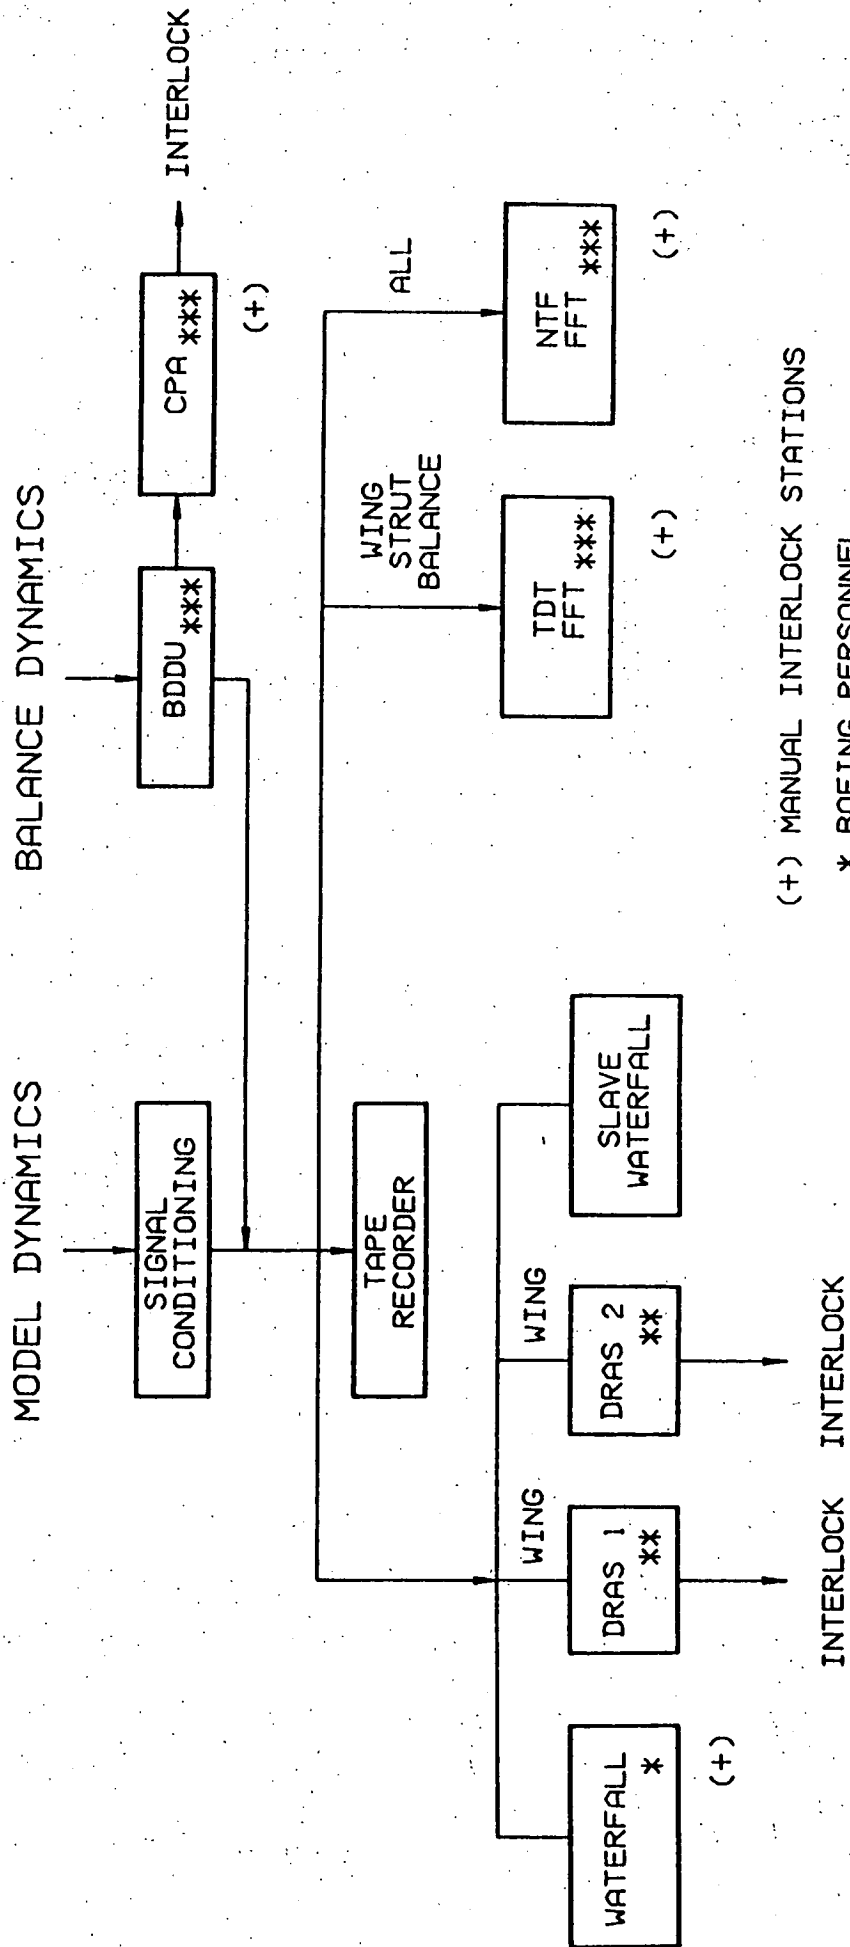


Figure 10. - Monitoring and Shutdown System Schematic.

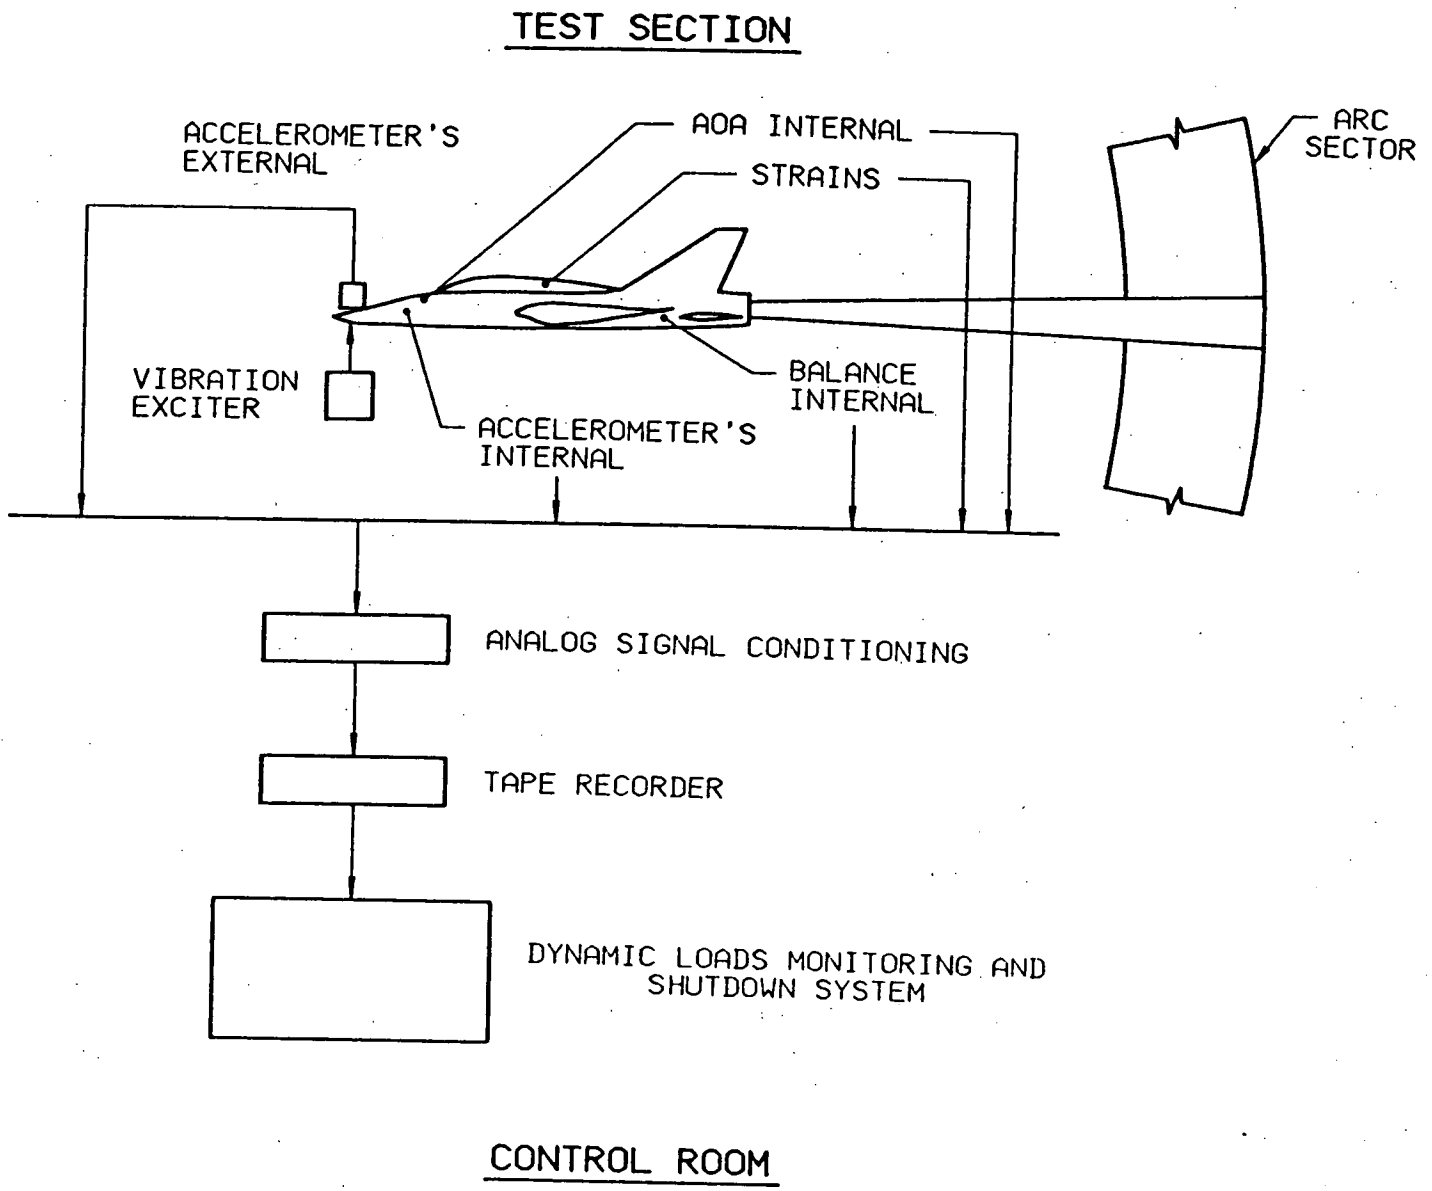


Figure 11. - Setup for Dynamic Loads Monitoring and Shutdown Systems Checkout.



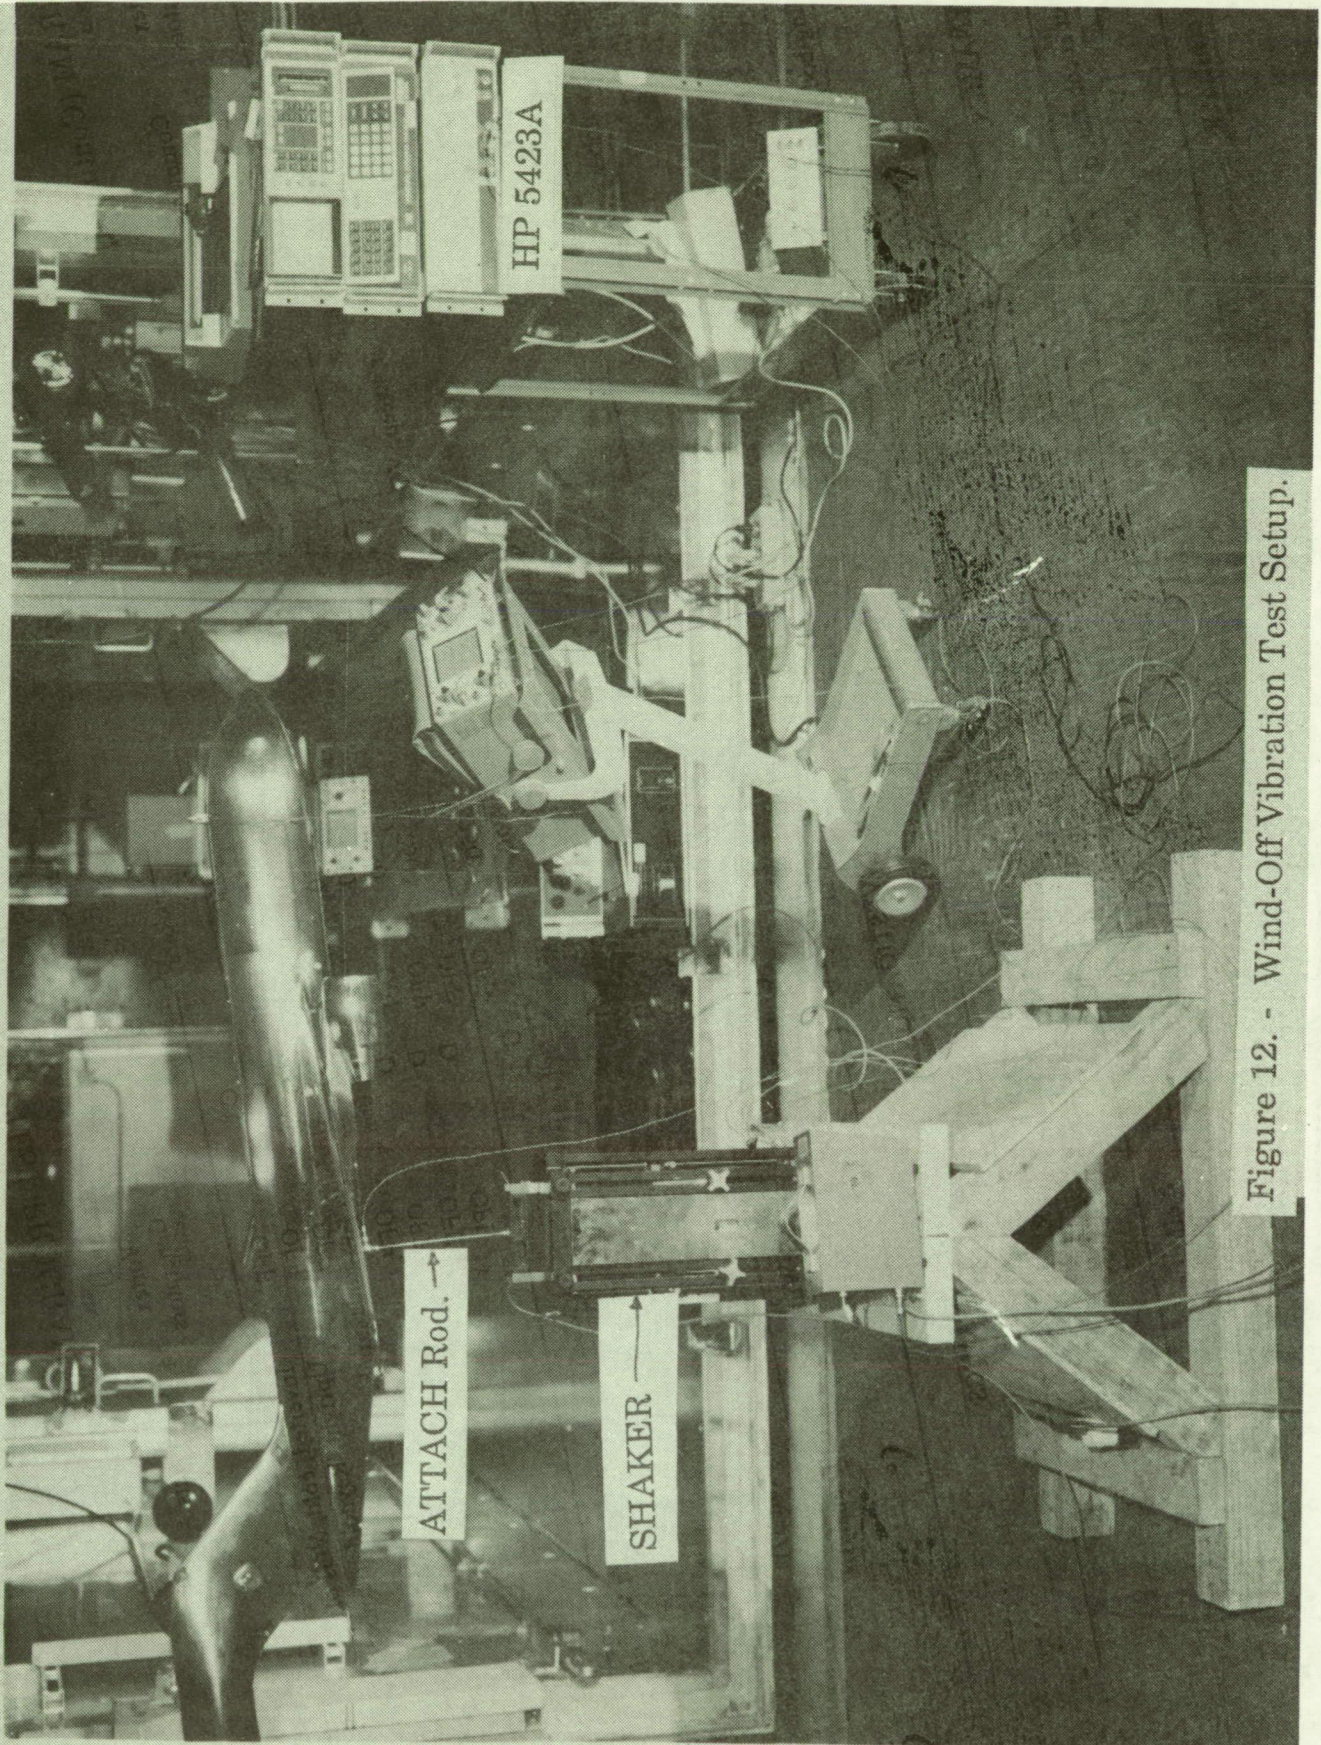



Figure 12. - Wind-Off Vibration Test Setup.

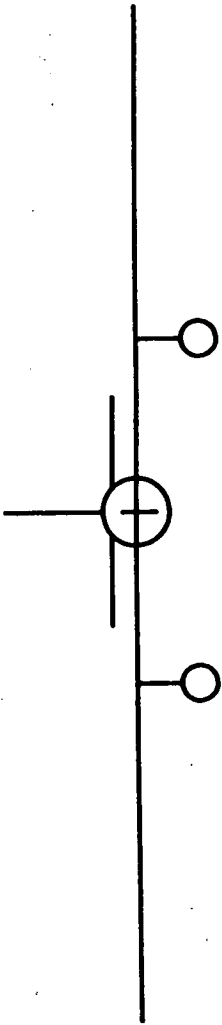

19 HZ ROLL-PITCH-YAW
23 HZ ROLL

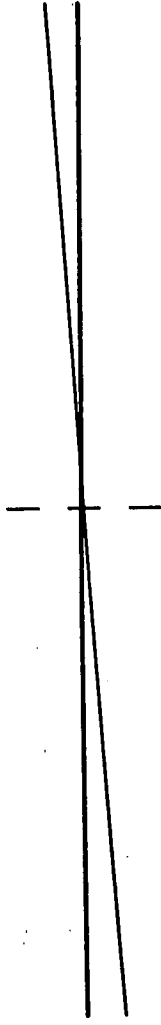

55 HZ MODE FIRST WING
BENDING (SYMMETRIC)

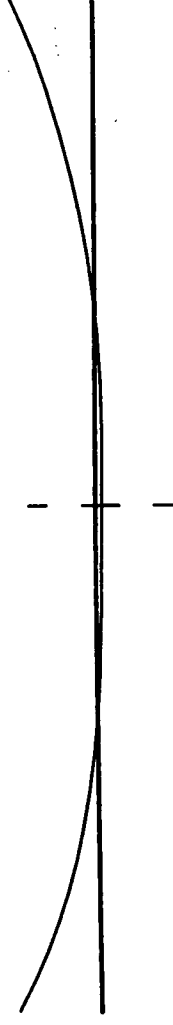

77 HZ MODE FIRST WING
BENDING (ASYMMETRIC)

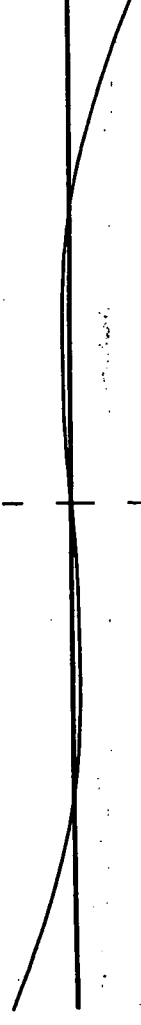


Figure 13. - Vibration Modes of Primary Interest for Buffet Test.

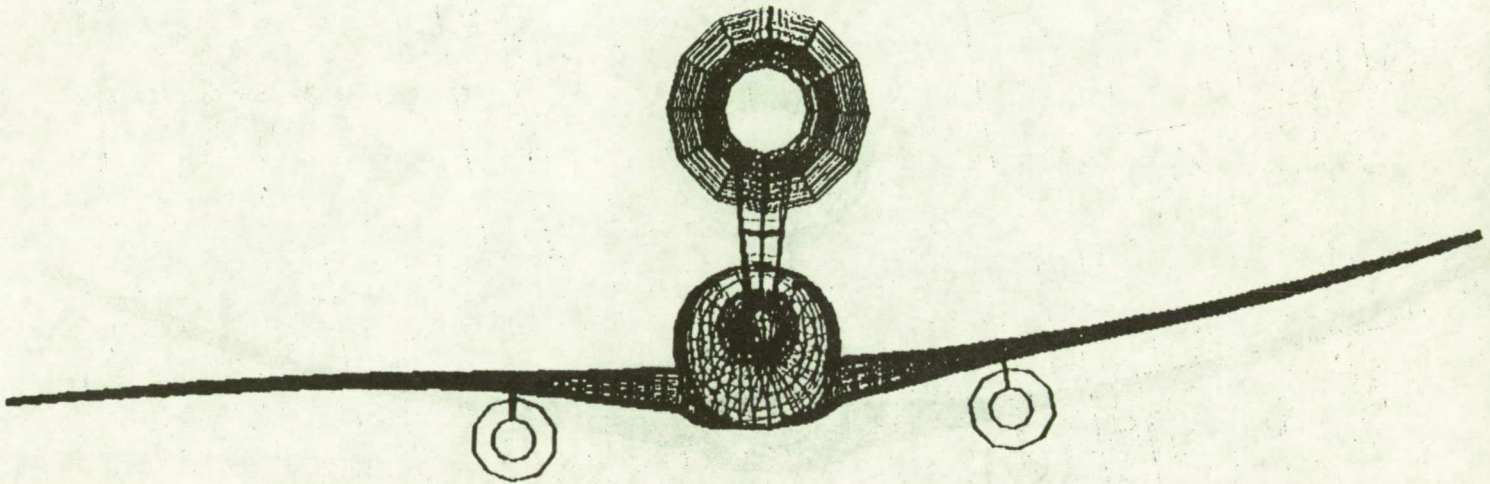


Figure 14. - Finite Element Model of Pure Roll Mode. (20 HZ)

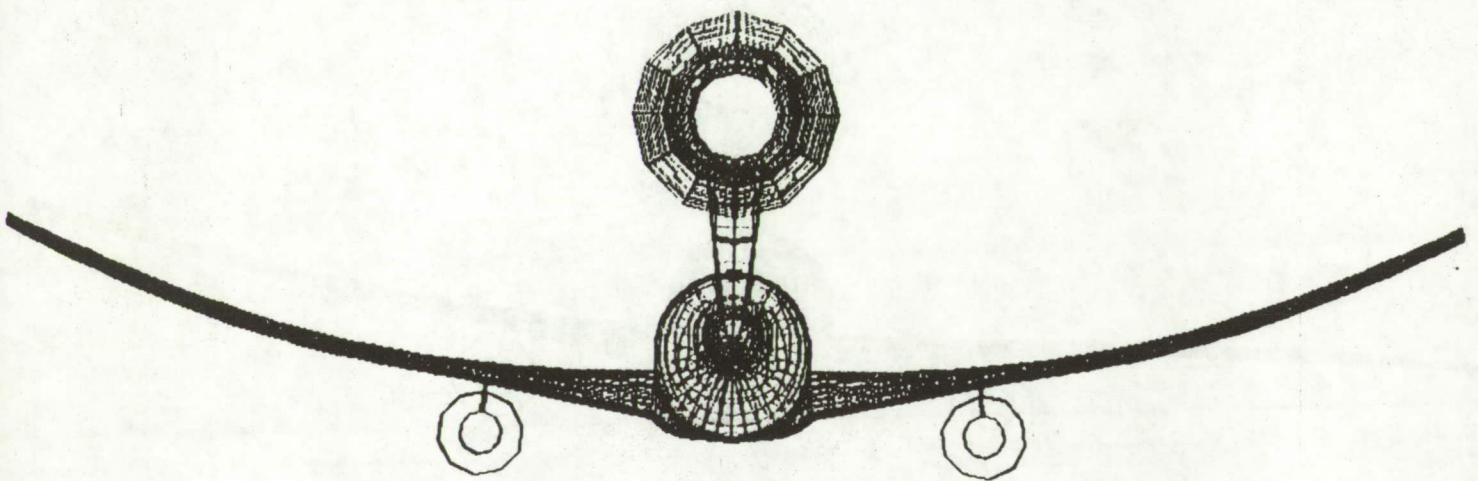


Figure 15.- Finite Element Model of First Wing Bending Symmetric Mode. (55 HZ)

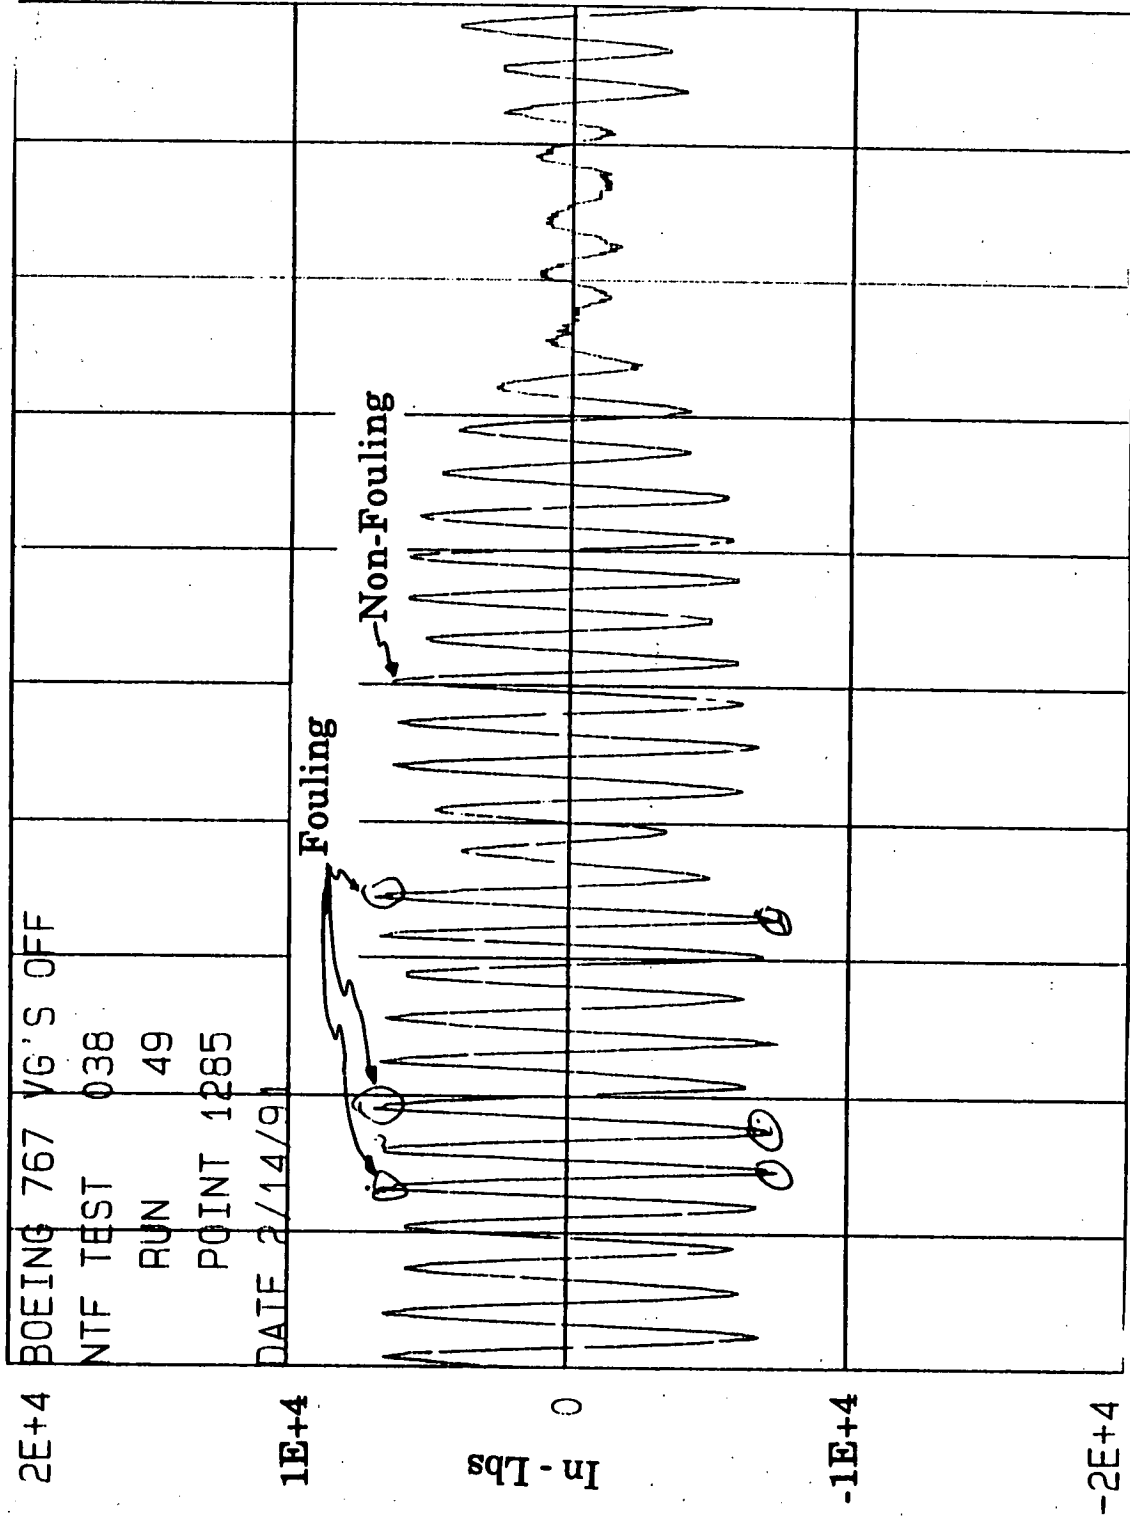


Figure 16.- Balance Yaw Moment Response Showing Evidence of
 Fouling Between Aft Fuselage and Swept Strut. (At
 Mach 0.80, Re No. 67 million/ft., $\alpha = 4.4^\circ$)

767 Test 101B Balance-Shaking Model 10 Jan 1991

Plot of Yaw & Side Balance Channels



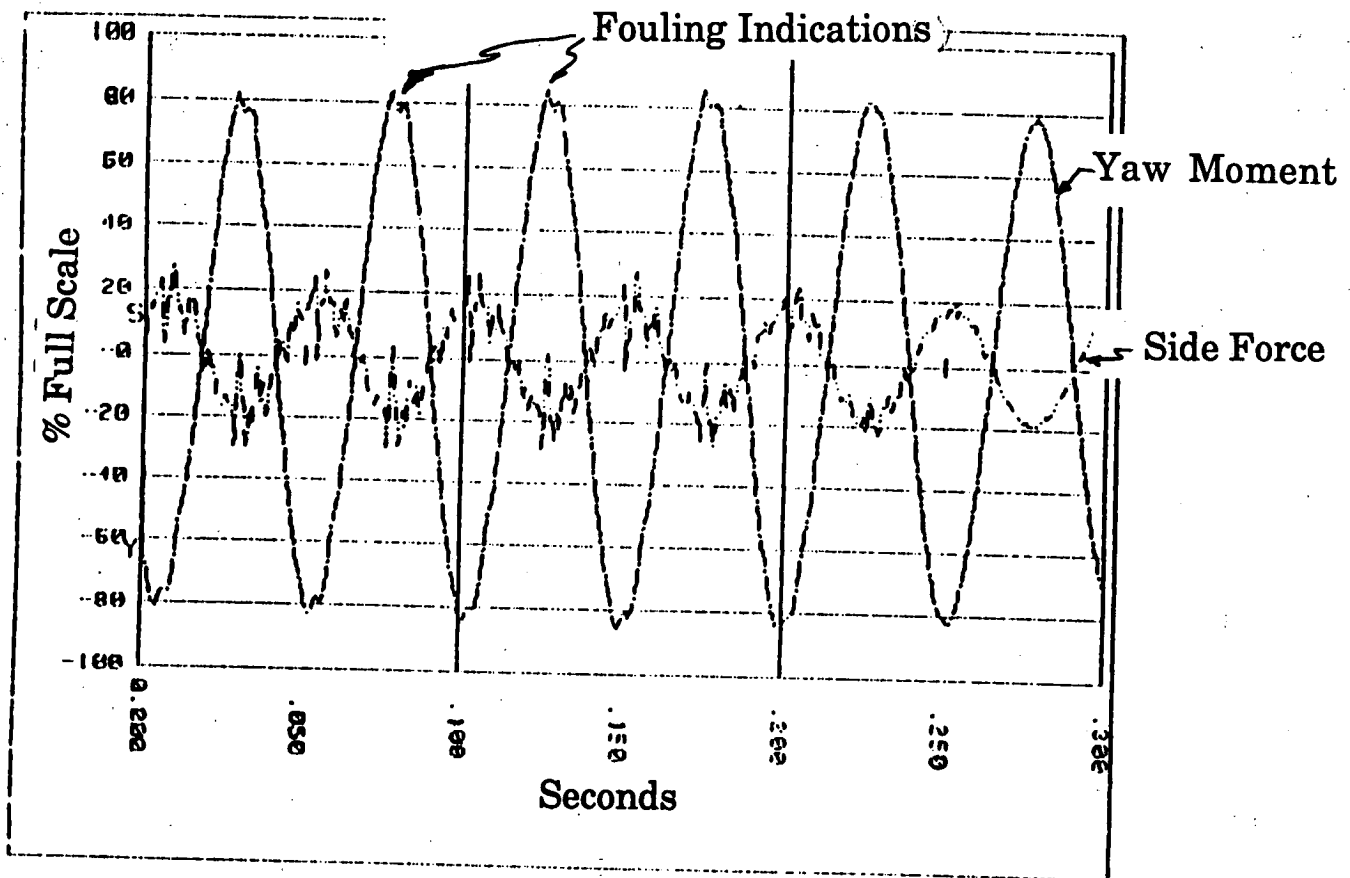


Figure 17.- Balance Yaw Moment and Side Force Response from Forced Vibration Tests Illustrating Fouling Between Aft Fuselage and Swept Strut.

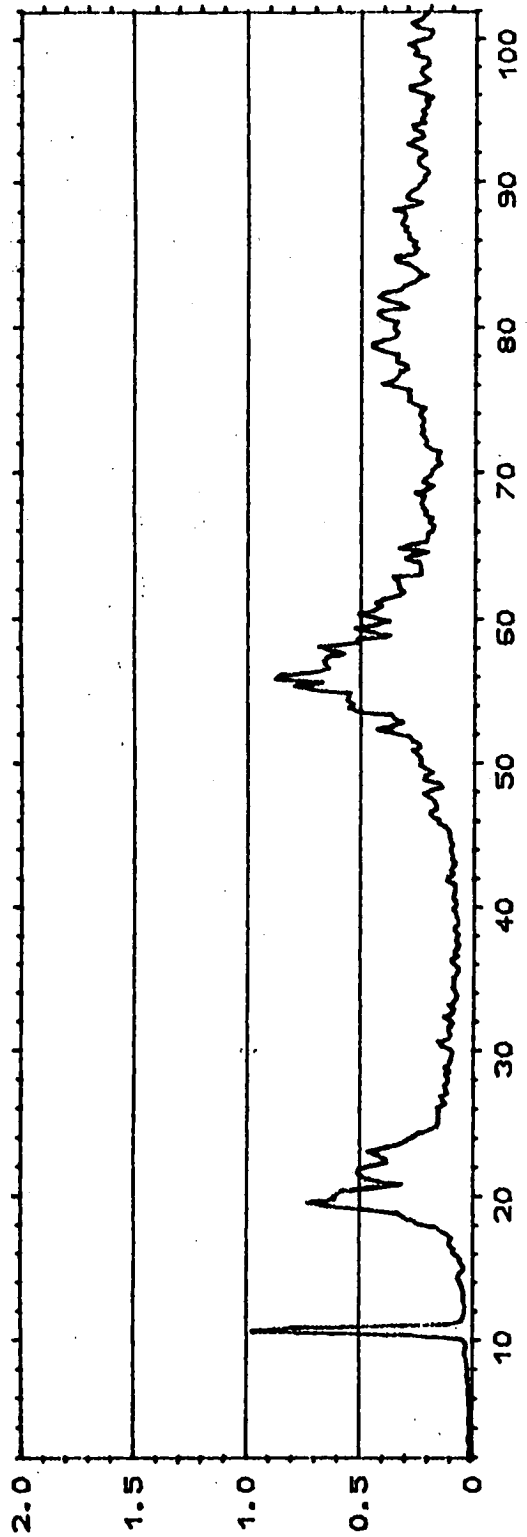

Wing Tip
Accelerometer,
Amplitude
g's

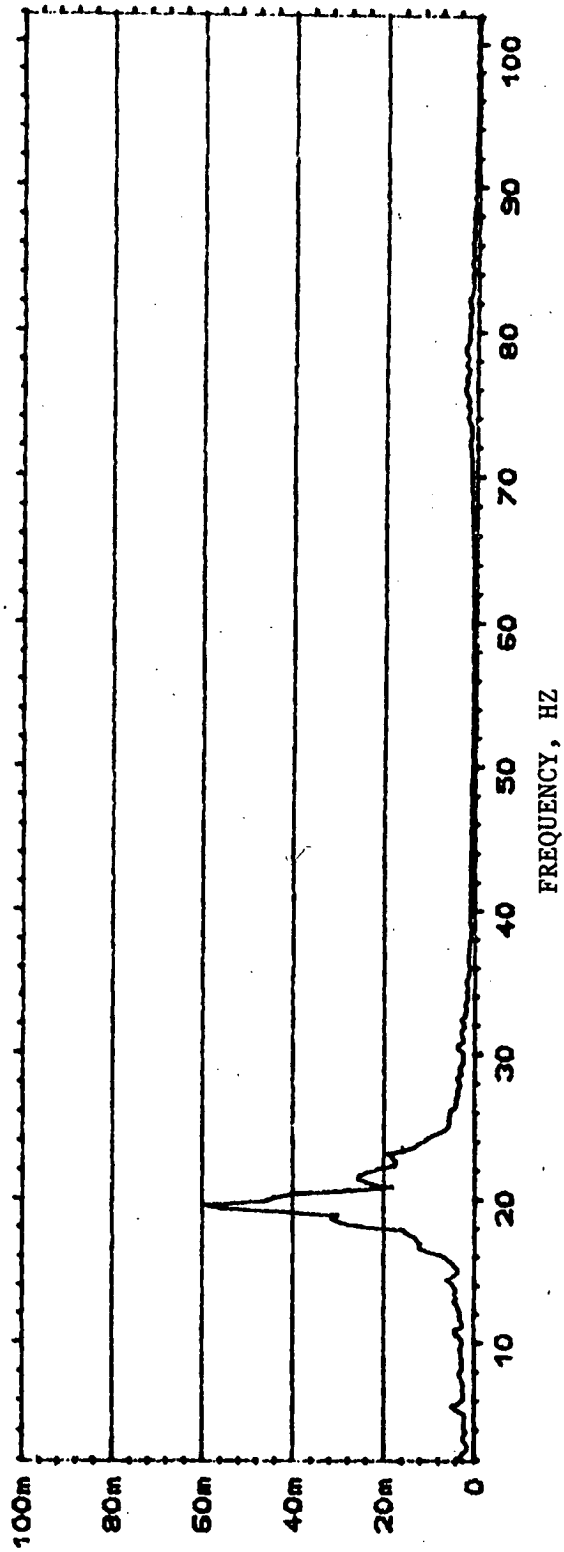

Balance
Roll Moment,
Millivolts

Figure 18.- Example Frequency Spectrum for Outboard Wing Accelerometer and Balance Roll Moment

M=0.8, 20Hz Mode, VG's On

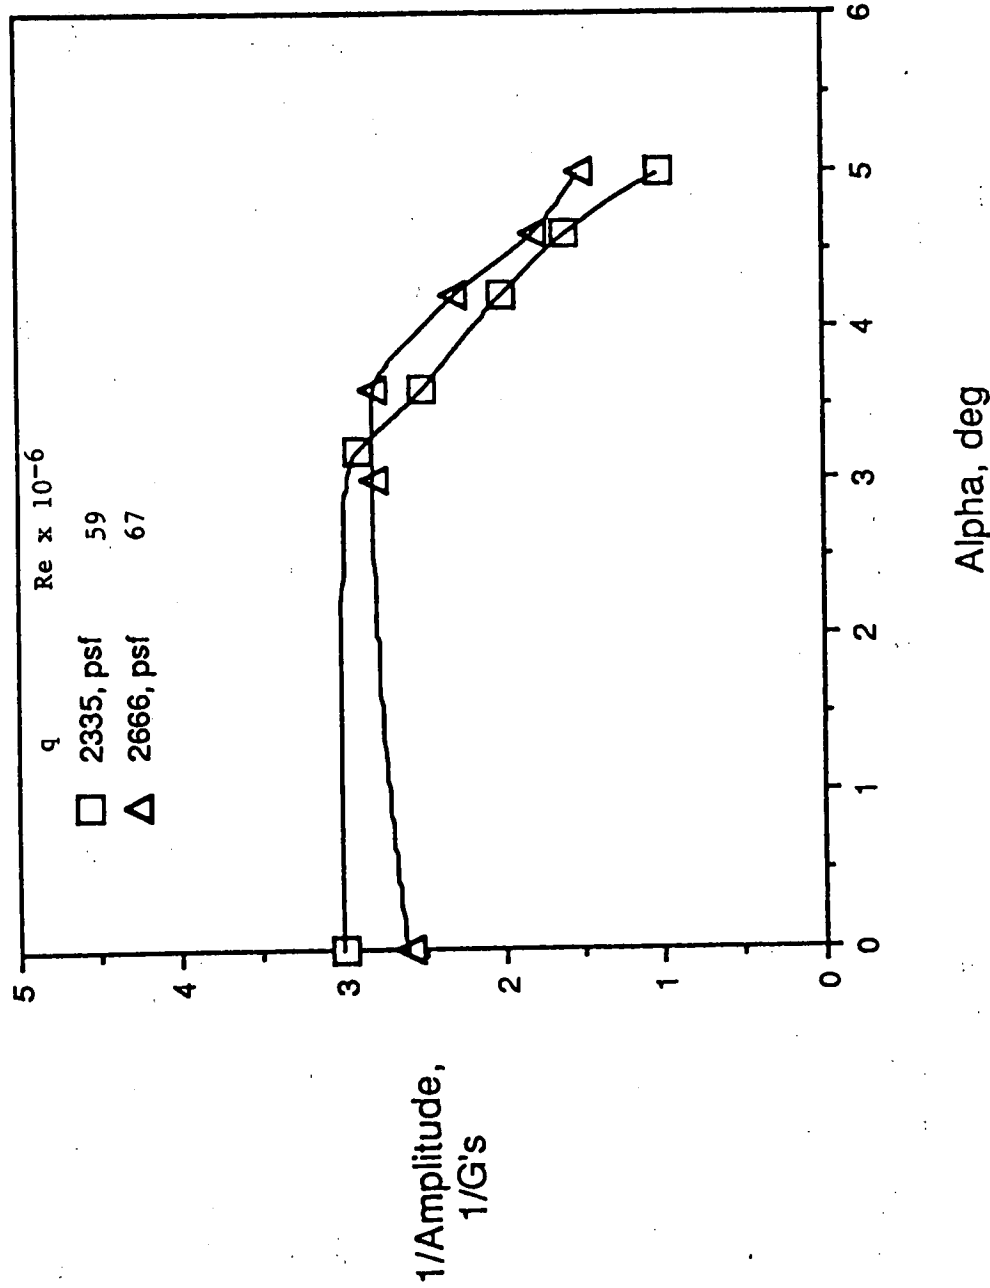


Figure 19. - Roll Buffet Stability Index Versus Angle of Attack for Variable Reynolds Number and With VG's Installed

M=0.8, 20 Hz Mode, VG's Off

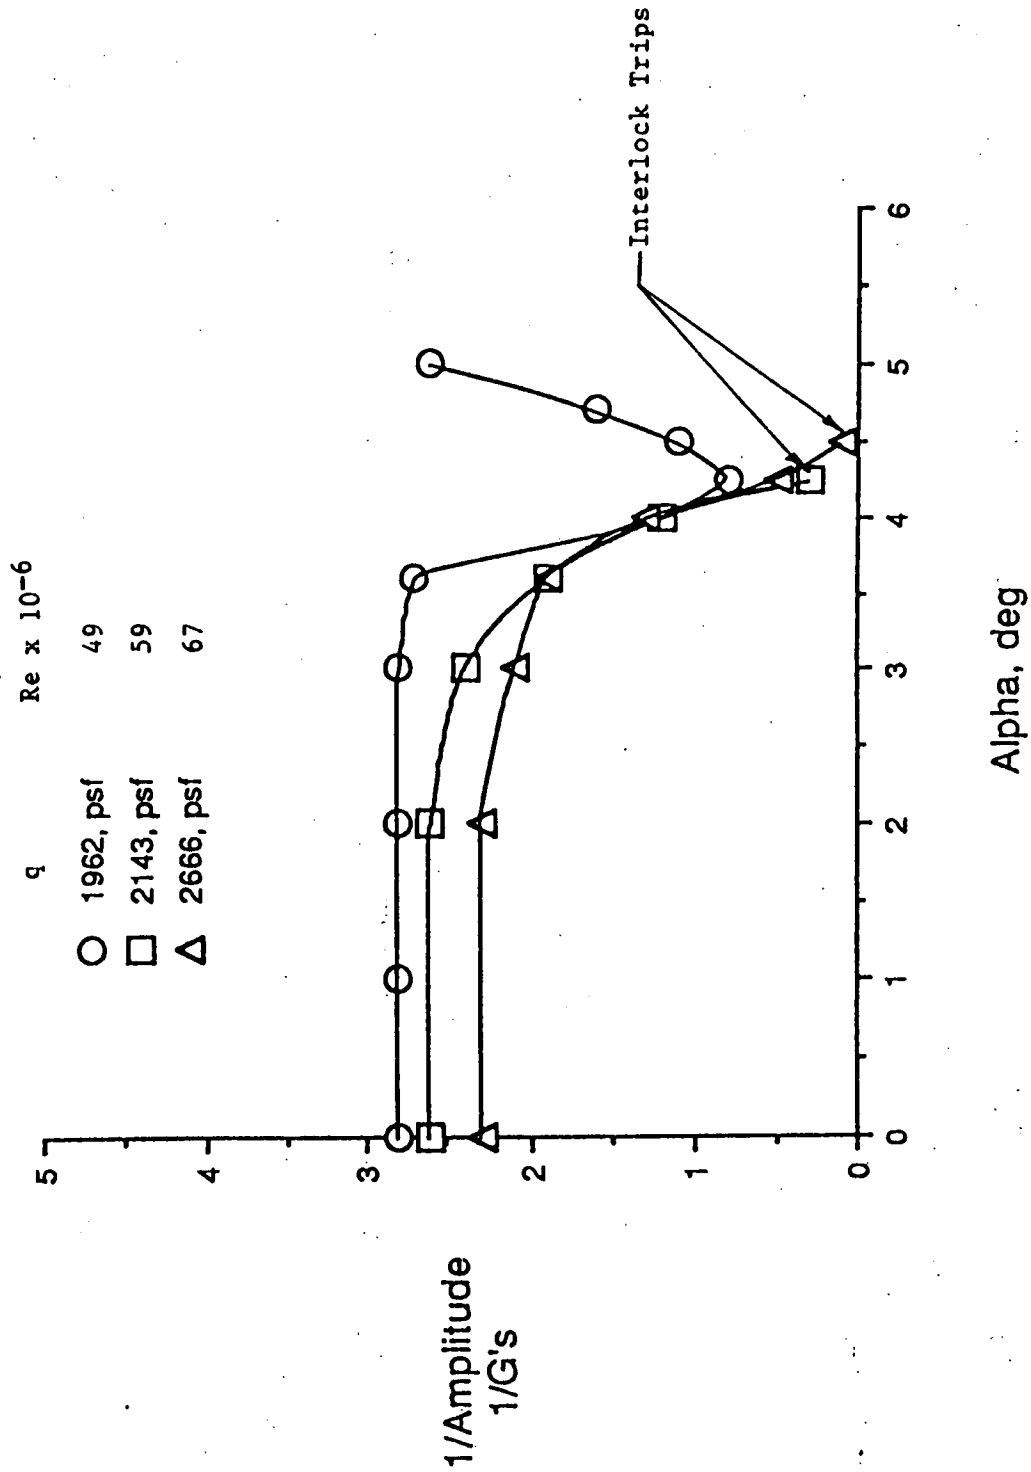


Figure 20. - Roll Buffet Stability Index Versus Angle of Attack for Variable Reynolds Number and With VG's Removed

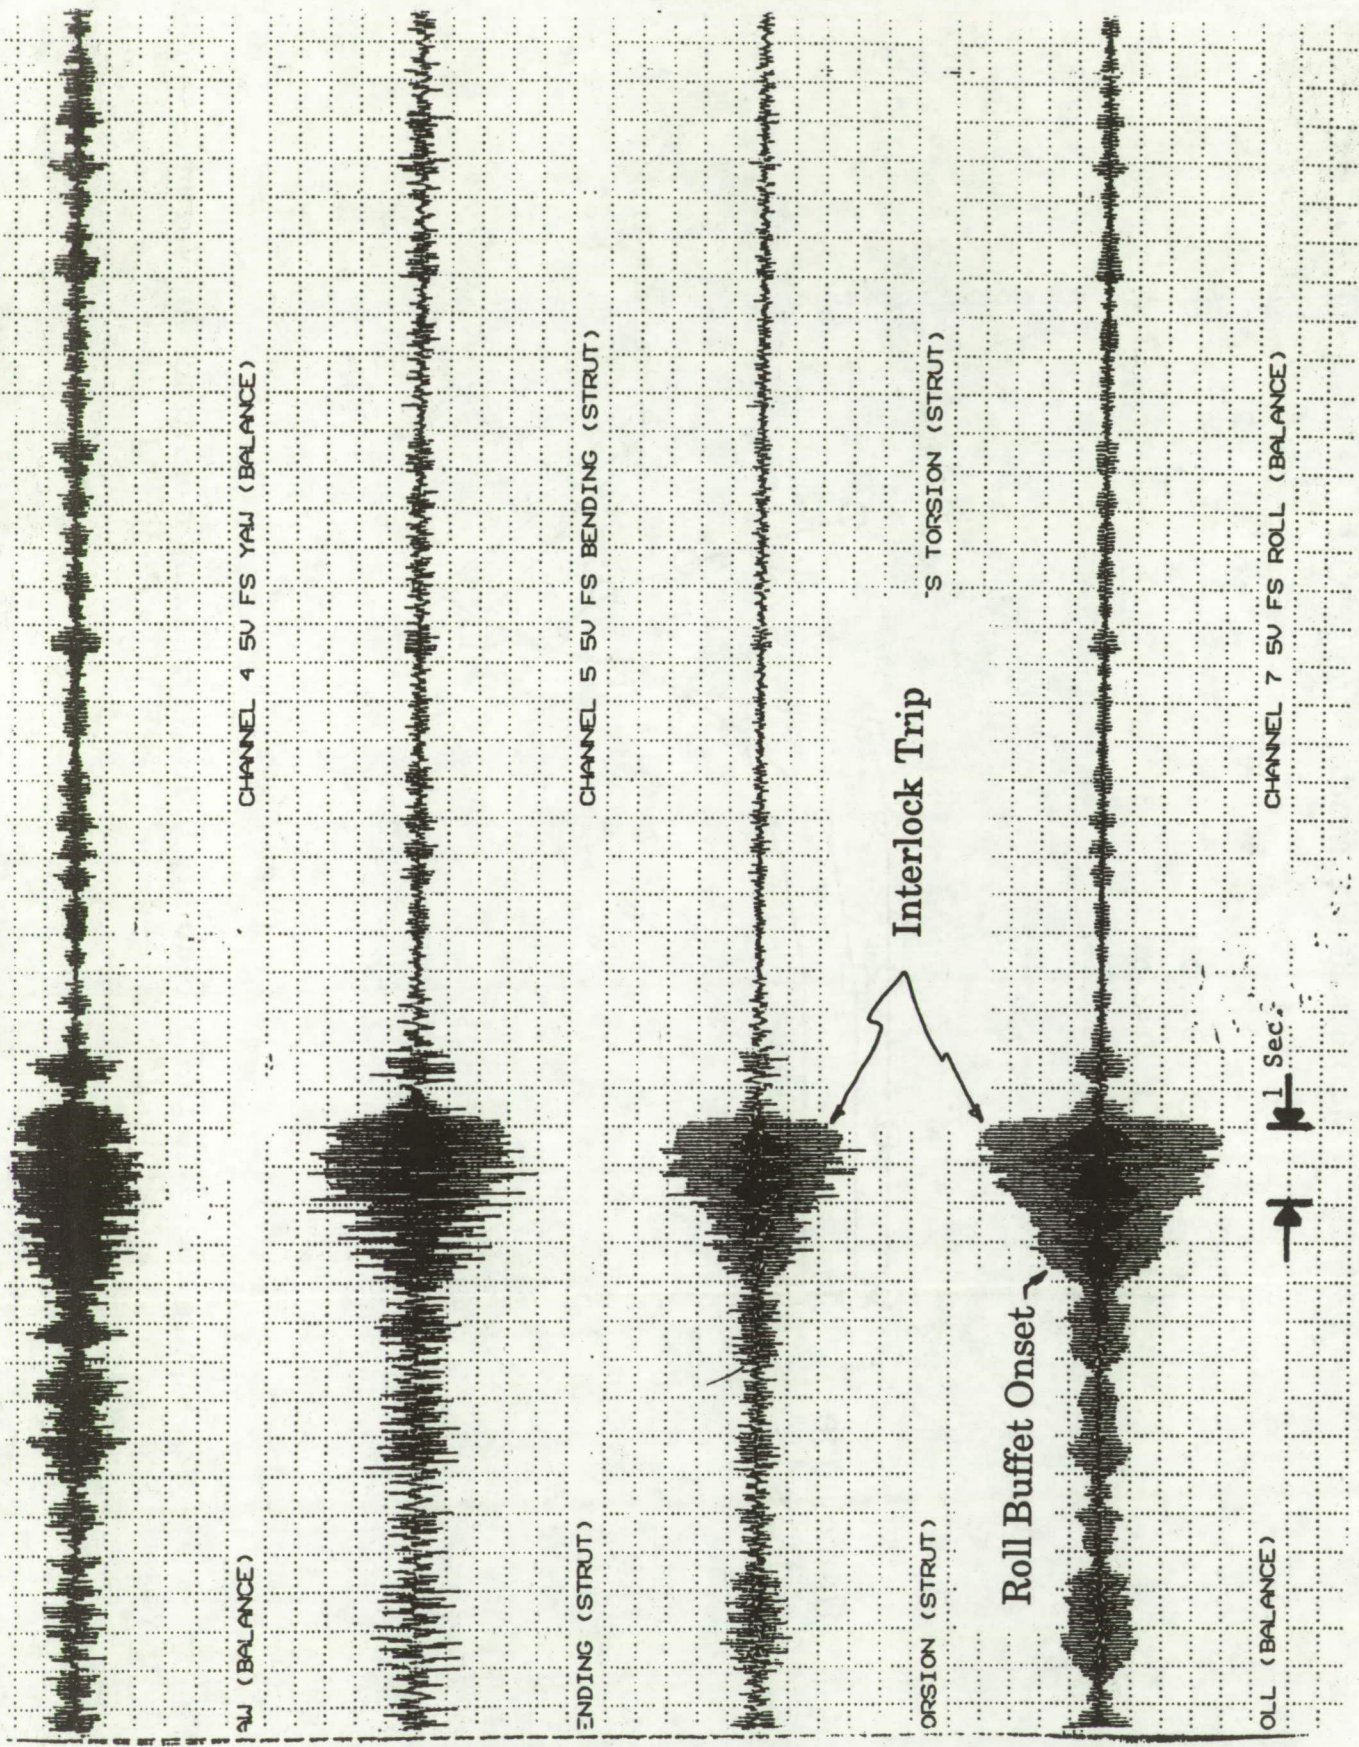


Figure 21.- Force Balance and Strain Gage Response Due to Roll Buffet.

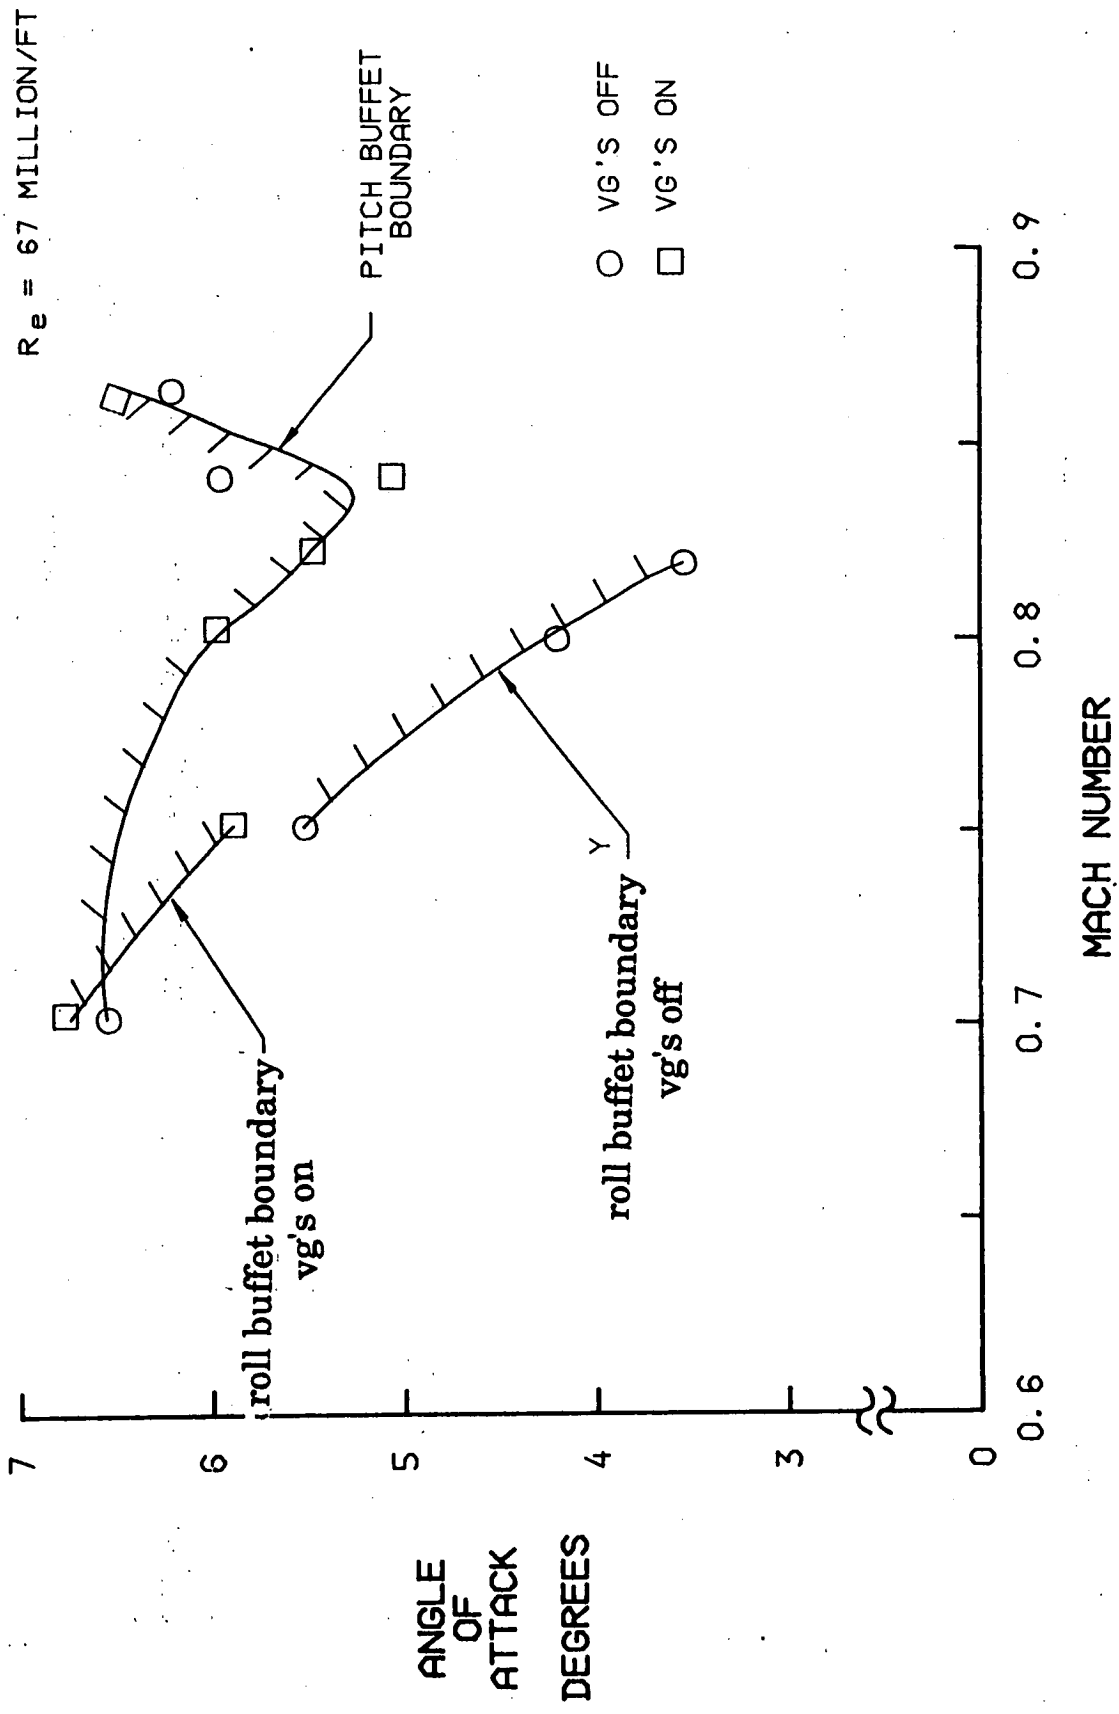


Figure 22. - Model Dynamic Response Boundaries at Reynolds Number of 67 Million/Ft.

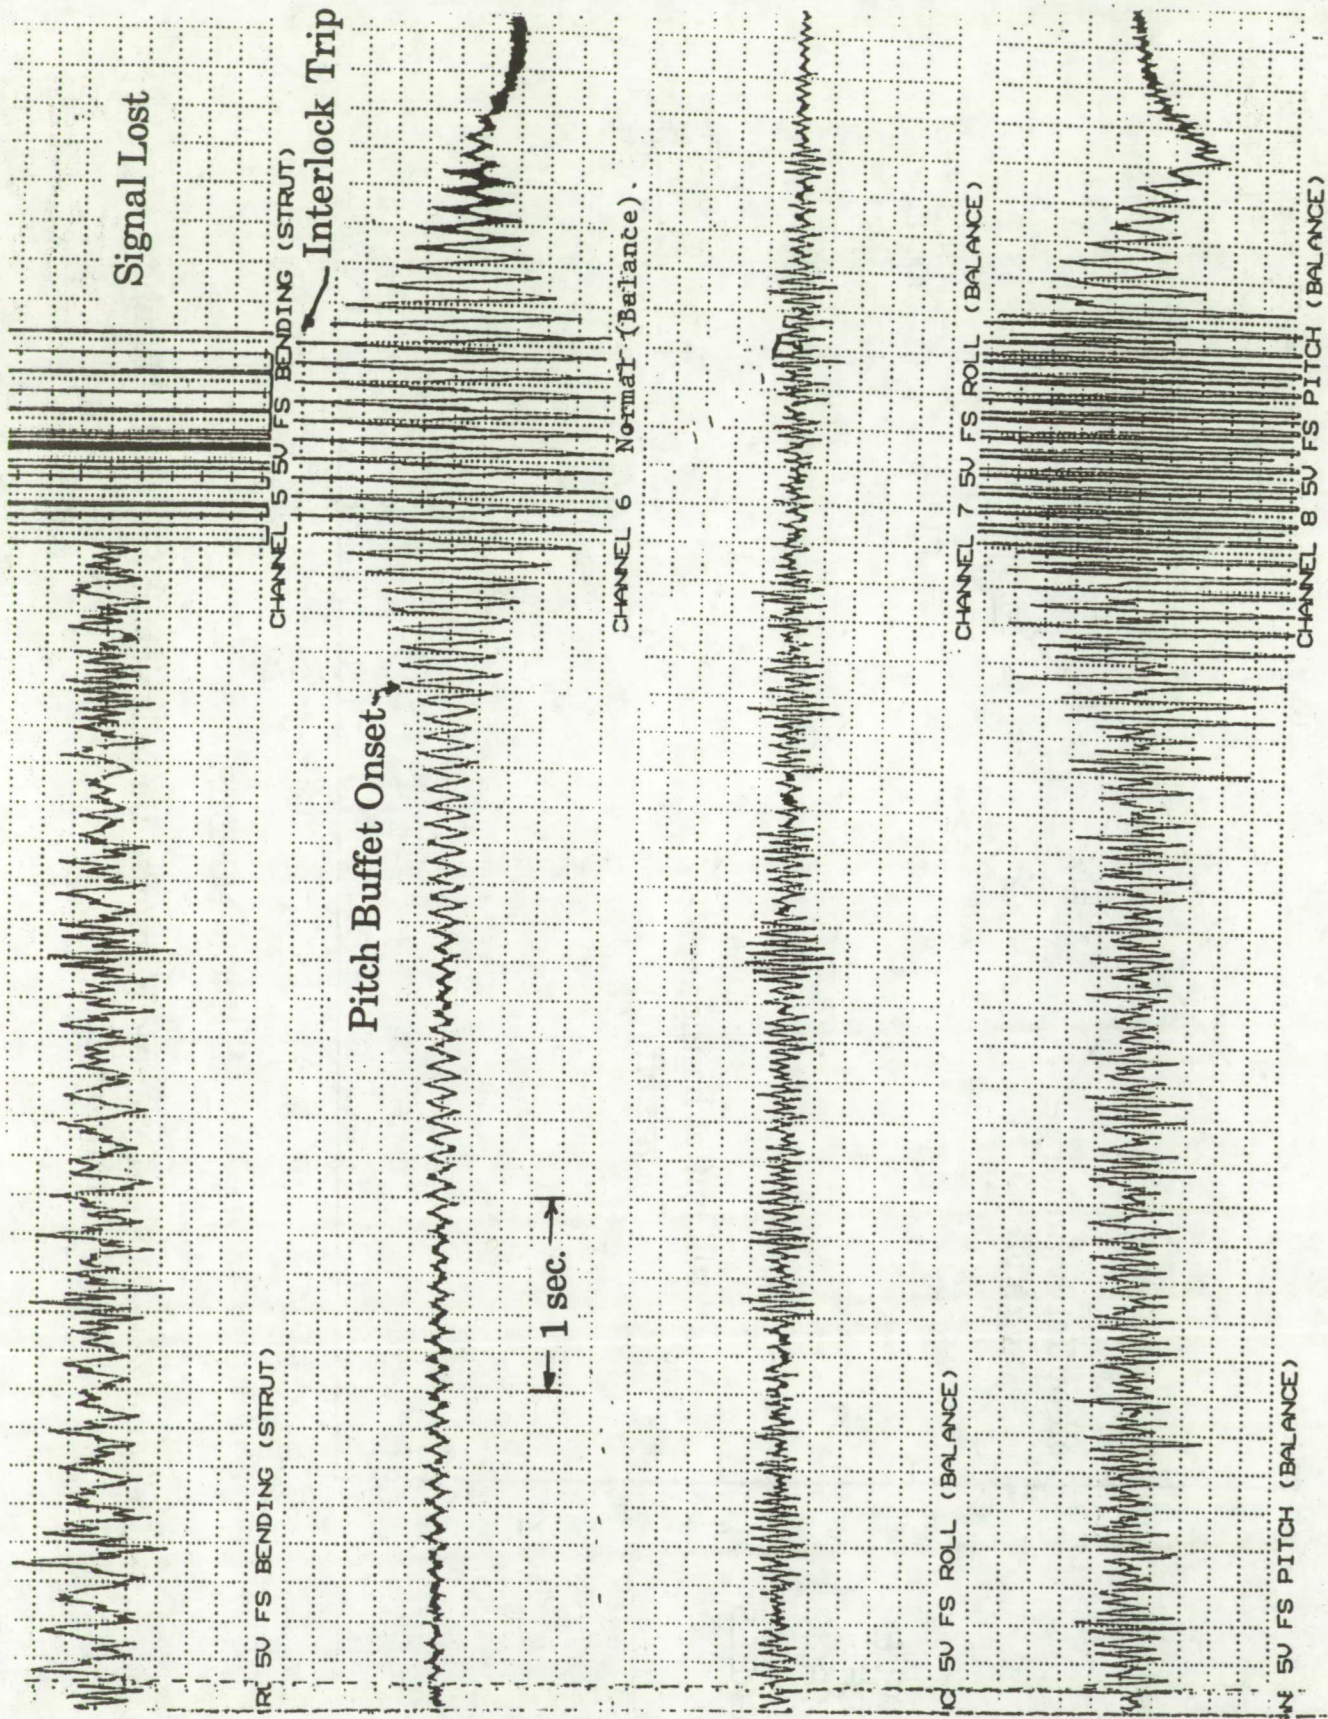


Figure 23. - Force Balance and Strain Gage Response Due to Pitch Buffet.

REPORT DOCUMENTATION PAGE

Form Approved
OMB No. 0704-0188

Public reporting burden for this collection of information is estimated to average 1 hour per response, including the time for reviewing instructions, searching existing data sources, gathering and maintaining the data needed, and completing and reviewing the collection of information. Send comments regarding this burden estimate or any other aspect of this collection of information, including suggestions for reducing this burden, to Washington Headquarters Services, Directorate for Information Operations and Reports, 1215 Jefferson Davis Highway, Suite 1204, Arlington, VA 22202-4302, and to the Office of Management and Budget, Paperwork Reduction Project (0704-0188), Washington, DC 20503.

1. AGENCY USE ONLY (Leave blank)		2. REPORT DATE July 1992	3. REPORT TYPE AND DATES COVERED Contractor Report	
4. TITLE AND SUBTITLE Buffet Test in the National Transonic Facility			5. FUNDING NUMBERS NCC1-141 505-59-85-01	
6. AUTHOR(S) Clarence P. Young, Jr., Dennis W. Hergert, Thomas W. Butler, and Fred M. Herring				
7. PERFORMING ORGANIZATION NAME(S) AND ADDRESS(ES) North Carolina State University Raleigh, North Carolina 27695-7910 and The Boeing Company Seattle, Washington 98124			8. PERFORMING ORGANIZATION REPORT NUMBER	
9. SPONSORING/MONITORING AGENCY NAME(S) AND ADDRESS(ES) National Aeronautics and Space Administration Langley Research Center Hampton, VA 23665-5225			10. SPONSORING/MONITORING AGENCY REPORT NUMBER NASA CR-189595	
11. SUPPLEMENTARY NOTES Langley Technical Monitor: Blair B. Gloss Final Report				
12a. DISTRIBUTION/AVAILABILITY STATEMENT Unclassified-Unlimited Subject Category 09			12b. DISTRIBUTION CODE	
13. ABSTRACT (Maximum 200 words) A buffet test of a commercial transport model was accomplished in the National Transonic Facility at the NASA Langley Research Center. This aeroelastic test was unprecedented for this wind tunnel and posed a high risk to the facility. This paper presents the test results from a structural dynamics and aeroelastic response point of view and describes the activities required for the safety analysis and risk assessment. The test was conducted in the same manner as a flutter test and employed on-board dynamic instrumentation, real time dynamic data monitoring, automatic, and manual tunnel interlock systems for protecting the model. The procedures and test techniques employed for this test are expected to serve as the basis for future aeroelastic testing in the National Transonic Facility. This test program was a cooperative effort between the Boeing Commercial Airplane Company and the NASA Langley Research Center.				
14. SUBJECT TERMS Buffet Testing; Test Techniques; Real Time Dynamic Data Monitoring; Cryogenic Wind Tunnel Testing			15. NUMBER OF PAGES 66	
			16. PRICE CODE A04	
17. SECURITY CLASSIFICATION OF REPORT Unclassified	18. SECURITY CLASSIFICATION OF THIS PAGE Unclassified	19. SECURITY CLASSIFICATION OF ABSTRACT Unclassified	20. LIMITATION OF ABSTRACT	