# Design A System and Database for Automated Machining Feature Recognition

Chen Wong Keong Department of Mechanical Engineering, Polytechnic Kuching Sarawak Email: **wongk@poliku.edu.my** 

Associate Professor Dr. Yusri Bin Yusof Department of Manufacturing and Industry Engineering, Faculty Mechanical & Manufacturing Engineering, Universiti Tun Hussein Onn Malaysia. E-mail: yusri@uthm.edu.my

#### Abstract

Computer aided design (CAD) is the earliest stage of the product cycle in a computerised manufacturing environment. CAD has the greatest role in helping to visualise the initial concept of a design with presenting the idea in a graphical view. The advanced of digital computer has eased the work of design drawing with generating the most complete design in 2D (two dimensional) and 3D (three dimensional) views. The generated drawing from CAD is not the end of the cycle of the product manufacturing process. The selected drawing will be sent to the manufacturing department for manufacturing process. The drawing created by CAD is just the description of geometrical features of the design component. This type of data cannot be used directly for the manufacturing process and normally intervention of human effort is needed to define all the manufacturing features from the component drawing again. As a result, a new system and database will be proposed. This system which has the ability to extract geometrical features from drawings and identify all the manufacturing features which is useful for manufacturing process. A neutral drawing format (ISO 10303-203) is as the input of the system. Then, a mechanism which consists of manufacturing feature extraction and feature recognition will be implemented and lastly, a new form of manufacturing feature-based data, ISO 10303-224 will be acquired for the subsequent manufacturing process.

Keywords: Automated machining feature recognition, Database, ISO 10303 AP224

## 1 Introduction

Computer-aided design system has played a significant role in the process of model design. However, (Xu, 2009) stressed that at present CAD does little in helping a designer in a more creative and intuitive way such as generation of possible design solutions, or in those aspects that involve complex reasoning about the design – for example in assessing, by visual examination of drawing, whether a component may be (easily) made, or whether it matches the specifications. These aspects are, however, subjects of consideration current research. In practicing concurrent engineering, there is a pressing need for CAD systems to interface or integrate design with all the down-stream activities, e.g. manufacturing and marketing.

Over the years, CAD has been undergoing fundamental changes toward the direction of feature-based design or design by features. Commercial implementation of feature-based design (FBD) technique became available in the late 1980's (Xu, 2009). One of the main benefits of adopting feature-based approach is the fact that feature can convey and encapsulate designer's intents in a natural way. However, such a featurebased design system, though capable of generating feature models as its end result, lacks the necessary link to a CAPP system, simply because the design features do not always carry the manufacturing information which is essential for process planning activities. From conventional CAD models, it only provides pure geometry and topology for mechanical designs such as vertices, edges, faces, simple primitives, and the relationship among them. Feature recognition is then required to interpret this low-level part information into high-level and domainspecific features such as machining features (Xu, 2009). In essence, feature recognition has become the first task of computer-aided process planning (CAPP) system. It serves as an automatic and intelligent interpreter to link CAD with CAM, regardless of the CAD output being a pure geometric model or a feature model from FBD system (Xu, 2009). To be specific, the goal of feature recognition system is to bridge the gap between a CAD database and a CAPP system, and based on the recognized feature, to drive the CAPP system which produces process plans for manufacturing the part. Human interpretation of translating CAD data into technological information required by a CAPP system is thus minimized if not eliminated. The input of an automatic feature recognition system is often a conventional description of the geometry of a part, i.e. a geometric model. The output is a list of recognized instances of features with necessary technological parameters and their proper organisation (Xu, 2009).

Many attempts have been made to classify feature recognition systems. One of the most common ways to classify them based upon the actual techniques used by the systems. Some of these techniques are known as, syntactic pattern recognition approach, geometric decomposition approach, expert system rule/ logic approach and graph-based approach. In the manufacturing domain, feature recognition approaches can also be classified for recognising rotational (turning) features and approaches for recognising non-rotational (milling) features. In the shape domain, feature recognition approaches can be classified as prismatic, rotational, flat and uniform cross section features as shown in table 1.

(Shah & Mantyla, 1995) classified automatic feature recognition techniques into two groups, there are machining region recognition and pre-defined feature recognition as shown in figure 1. Sectioning, convex hull and decomposition are the three methods for machining region recognition. Meanwhile, pre-defined feature recognition can be further classified into boundary based and volume based feature recognition. Syntactic, rule, graph-based and neural net are normally methods adopted for boundary based pre-defined automatic feature recognition.

### 2 Feature Creation Techniques

It is convenient to look at the total feature-based model as consisting of two interrelated components, namely a feature model and a geometric model as shown in figure 2. Even if there is no physical separation between the two models, we can view the data conceptually as being of two types. The geometric model contains a boundary representation, CSG, or other geometric representation of the object. The feature model contains the clustering information, feature properties, relationships of interest, and other higher level data (Shah & Mantyla, 1995).

Many alternative techniques have been devised for creating feature-based models. these techniques can be divided into two main categories based on whether features are extracted from geometry (FfG), or on whether geometry is created from the feature (GfF). Traditionally the FfG methods are called feature recognition, while GfF methods are called design by features. FfG may be automated by means of computer algorithms, or it may be necessary for the user to perform the task. The formers is labelled automatic feature recognition, while the latter is called human-assisted (or interactive) feature recognition (Shah & Mantyla, 1995).

The procedure followed in creating feature models, in each of the above cases, can be described as follows:

- i. Interactive feature recognition. A geometric model is created first, then features are created by human users, such as by picking entities in an image of the part (Figure 3). User1 and User2 may be the same person.
- ii. Automatic feature recognition. A geometric model is created first, then a computer program process the resulting model to automatically find features (Figure 4).
- iii. Design by features. The part geometry is created directly in terms of features; geometric models are created from the features (Figure 5).

#### **2.1 Interactive Feature Creation**

Although the interactive feature creation approach was originally developed to provide feature data for process planning before the availability of design by feature systems, it continues to find uses because of its simplicity. In this approach the geometric model is created first, using a solid (or two-dimensional drafting-type) geometric modeler. After exiting the geometric modeler, the geometric model file is sent to an interactive graphics program that renders an image of the part in order to let a user view the geometry and create features on it. The user can interactively pick entities (vertices, edges, faces) needed to create a feature. This information is sometimes augmented with attributes such as tolerances, finish or high-level nominal parameters (e.g., hole diameter) (Shah & Mantyla, 1995).

In its simplest form, interactive feature creation can be just adhoc grouping of geometric entities by the user, with some user-specified data added; the resulting model is aimed specifically for use by some application program. It is entirely the user's responsibility to ensure that the feature model is valid and complete. All that is needed to implement such a system is to record pointers to the entities picked and associate them with a feature name and other data, specified by the user. Such representation may be specially geared to a specific application program (Shah & Mantyla, 1995).

### 2.2 Automatic Feature Recognition

Various techniques have been developed to provide, without any human intervention, the product data input needed by applications such as process planning, NC part programming, and inspection planning. This is popularly referred to as feature recognition, although the output of some techniques is not in the form of features but rather as machining volumes. These latter methods typically assume that all machining will be done by milling, so it is not necessary to know the specifics of a feature other than its boundaries corresponding to find machined surfaces. For example, it does not matter if a machining volume is a rectangular pocket or an L-shaped slot because tool paths can be generated without this distinction. For this reason we classify these methods into two groups: machining region recognition and pre-defined feature recognition (Shah & Mantyla, 1995).

### 2.3 Machining Region Recognition

Machining region recognition methods were devised for generating NC tool paths directly from CAD databases. The objective of these algorithms is to determine volumes that need to be removed by machining, usually by end milling. There is no comparison made to pre-defined shapes. Machining region recognition techniques may be classified into three categories (Shah & Mantyla, 1995):

- i. Sectioning
- ii. Convex hull decomposition
- iii. Cell decomposition

Sectioning is typically used to generate feature boundaries corresponding to material removal regions at each z-level in 2  $\frac{1}{2}$  D milling. The part is oriented such that its principal feature directions coincide with the three milling axes. The part volume is sliced with planes parallel to x-y plane at fixed  $\Delta z$  values, representing a series of tool positions. This results in one or more intersection profiles, representing the part's boundaries. These profiles are classified as "material" or "void", and offset curves are generated to form the basis for generating NC tool paths (Shah & Mantyla, 1995).

Convex hull decomposition is used to decompose a volume into convex machining volumes. The part is first subtracted from its convex hull, and the process is repeated until each volume is equal to its own convex hull (Shah & Mantyla, 1995).

### 3 An Integrated, STEP-Compliant Manufacturing Environment

STEP, the Standard for the Exchange of Product Model Data, is a large and powerful set of International Organisation for Standardisation (ISO) standards, all under ISO 10303. The overall objective of STEP is to provide a mechanism that describes a complete and unambiguous product definition throughout the life cycle of a product. STEP provides both broadly useful data modelling methods and data models focused on specific industrial uses. The STEP standards contain several dozen separate documents (Kramer & Xu, 2009).

STEP-based manufacturing is currently a hot topic to discuss. The first major challenge in STEP-based manufacturing system is to establish a concurrent engineering environment across all manufacturing activities. A key element in this environment is feature which allows integration between CAD (as in AP203) and CAPP (as in AP224 and AP238) data. However, recognizing AP224 features from an AP203 model is still being research (Zhao, Habeeb, & Xu, 2009).

Figure 6 shows an integrated STEP-compliant manufacturing system. The geometric representation data described in AP203 or other formats are translated into machining features defined in AP224. The machining feature definitions are used as inputs to macro process planning applications (Examples: AP240 for machining, AP223 for casting, and AP229 for forging). Micro process planning for machining (AP238) and inspection (AP219) are then carried out for each of the aforementioned application processes. In such a system, the need for data conversion is eliminated (Zhao, et al., 2009).

STEP AP203 is just one of the neutral data format which is always used in intergrading between different CAD systems that shown in figure 1. Besides, IGES and ACIS have also the similar functions as STEP AP203. However, these types of neutral format cannot be used directly for further manufacturing process without translating them to a more meaningful high level data. Feature technology is the solution for translating these geometrical format data to manufacturing feature-based data, which is defined in AP240, which is useful for manufacturing process.

AP224 was developed to bridge the gap between CAD and CAPP by providing machine part information that ensure the design information is at the same time 100-percent complete, accurate, computer-interpretable and reusable. Thus, automated process planning from product data in a digital format is made possible (Xu, 2009). The AP224 standard provides the mechanism to define the digital data that contains the information necessary to manufacture a required part (Xu, 2009). This includes information such as,

- i. CAD geometry and topology;
- ii. Machining feature information (e.g. hole, boss, slot, groove, pocket, chamfer, and fillet);
- iii. Dimensional and geometric tolerances;

- iv. Material properties and process properties;
- v. Administrative information (e.g. approval, part name and ID, delivery date and quantity).

More specifically, AP224 defines the implicit information about machining feature and other APs (such as AP203) define the explicit geometry using boundary representation (B-rep). Therefore, the dimensional and geometric tolerances defined in AP224 can reference either the B-rep geometry, or the implicit feature definition. AP224 also defines part, process, material and surface properties that can reference B-rep geometry or the implicit feature definitions (Xu, 2009).

Based on figure 7, the first challenge in STEP-based manufacturing system is established a concurrent engineering environment across all manufacturing activities. A key element in this environment is feature which allows integration between CAD (as in AP203) and (as in AP224 and 238) data. However, recognizing AP224 features from an AP203 model is still being under development (Zhao, et al., 2009).

### 4 Project Framework

The proposed project framework is shown in figure 8, which consists of several important steps. Start from various kinds of 3-D geometric model design which is created in Autodesk Inventor, they are converted to STEP neutral data format, ISO 10303 AP203. AP203 is in a text file format and it is geometrical and topological rich data format, such as vertices, lines and surfaces is shown in figure 9. Then, these types of data will be extracted to a format which is useful for manufacturing feature extraction and recognition modules through a STEP feature-based system. Raw stock determination and subtraction of model from stock are the two important steps before implementing the manufacturing feature extraction and recognition process. Graph-based and rule-based approaches are proposed as the main automatic manufacturing feature recognition methods. Lastly, the recognized manufacturing features will be generated in ISO 10303 AP224 in text file, which is useful for subsequent manufacturing processes. Figure 10 shows the expected result and steps in developing feature-based system for automated machining feature recognition of ISO 10303 AP 224 for prismatic components. The proposed algorithm for manufacturing feature extraction and recognition modules will be implemented by using Microsoft Office Access Database and running on Microsoft Window system.

#### 5 Initial Result

This project is still under development and some of the initial result can be referred in figure 11 until figure 18 in appendix. Figure 11 shows the geometric model of a designed object from Autodesk Inventor. The designed object which is in geometry and topological rich data format was converted to STEP neutral data format, ISO 10303 AP203 as shown in figure 9. Then, this data will be extracted and categorized into a format which is more useful in subsequent manufacturing feature recognition process by using all the append queries, update queries and select queries in Microsoft Access as shown in figure 12 until figure 18. Some of the queries have been used to extract the geometry and topological data are select query, union query, append query and also update query. At this stage, all of the important geometry and topological data have been extracted and categorized in close\_shell table, advanced\_face table, oriented\_edge table, edge\_curve table, face\_bound table, edge\_curve table, edge\_loop table, plane table, vector table, vertex table, cartesian\_point table, direction table and axis2\_placement table. These geometry and topological data are important for manufacturing feature recognition process. Before any manufacturing feature will be recognized, there is a convexity test will be implemented on the geometry and topological data. This convexity test will determine the types of every edge in this data, whether it is convex or concave. This pattern of convexity of the edges will be become an important data in mapping the manufacturing feature known as graph based approach and helping in manufacturing feature recognition with rule based feature recognition approach. Lastly, the manufacturing recognized features will be converted to AP224 format data which is useful for CAPP and subsequent manufacturing process CAM. As a result, AP224 format data will close the gap between CAD and CAPP.

### 6 Summary

In conclusion, this paper is a continuous effort in integrating CAD and CAM through feature recognition technology. Microsoft Access has been proposed as the main solution in creating the system and database of manufacturing feature mechanism since it is a user friendly software in creating a system and database used in processing the text file format from AP203. AP224 text file is the output format for the subsequent use of macro process planning for manufacturing process.

#### References

Kramer, T., & Xu, X. (2009). STEP in a Nutshell

Advanced Design and Manufacturing Based on STEP. In X. Xu & A. Y. C. Nee (Eds.), (pp. 1-22): Springer London.

Shah, J. J., & Mantyla, M. (1995). *Parametric and Feature Based CAD/Cam: Concepts, Techniques, and Applications*: John Wiley \\& Sons, Inc.

Xu, X. (2009). Integrating Advanced Computer-Aided Design, Manufacturing, and Numerical Control: Principles and Implementations: Information Science Reference - Imprint of: IGI Publishing.

Zhao, Y. F., Habeeb, S., & Xu, X. (2009). Research into integrated design and manufacturing based on STEP. *Int J Adv Manuf Technol*, *44*, 606–624.

# Appendix

Table 1: Classification of feature recognition system (Shah & Mantyla, 1995)

1990)		
Product Type	Applications	Shape
Sheet metal features	Design	Prismatic
Composite panel	Finite Element	Rotational
feature	Analysis	
Machined features	Process Planning	Flat
Injection molding	Inspection	Uniform Cross section
features		

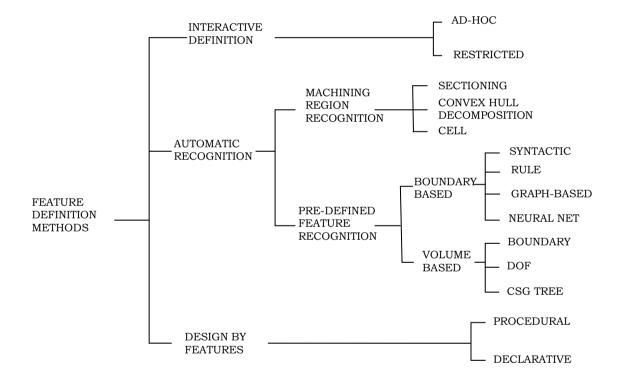


Figure 1. Classification Of feature creation methods (Shah & Mantyla, 1995)

FEATURE MODEL

Shape Definition Dimension Attributes Feature Position Geometric Constraints Non-geom. Attributes GEOMETRIC MODEL

Topological Entities Topological Graph Geometric Entities Topo-Geom. Pointers

Figure 2. Relationship between feature and geometry (Shah & Mantyla, 1995)

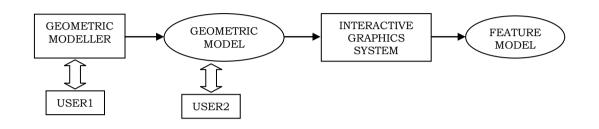


Figure 3. Interactive feature definition (FfG) (Shah & Mantyla, 1995)

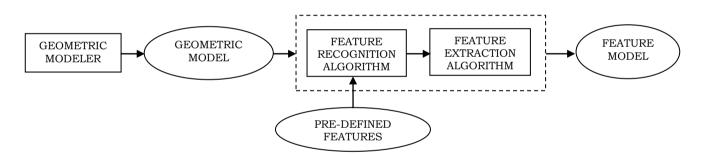


Figure 4. Automatic feature recognition (FfG) (Shah & Mantyla, 1995)

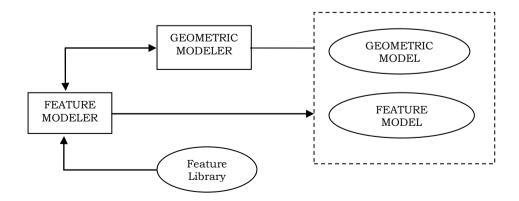


Figure 5. Design by features (GIF) (Shah & Mantyla, 1995)

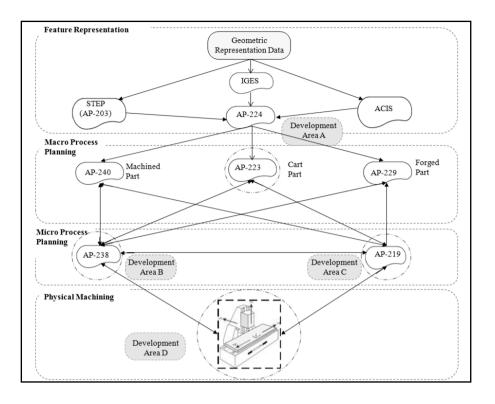


Figure 6. An integrated STEP-compliant manufacturing system (Zhao, et al., 2009)

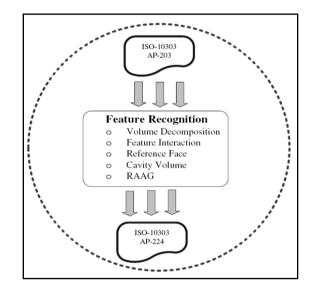


Figure 7. One of the areas of research in an integrated STEP-compliant manufacturing system (Zhao, et al., 2009)

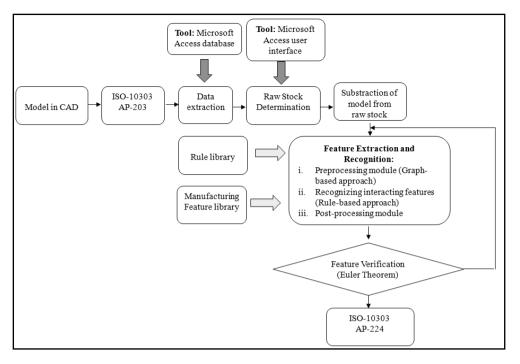


Figure 8. Proposed project framework

```
#243=ADVANCED_FACE(",(#242),#208,.T.);
#244=CARTESIAN_POINT(",(-8.881784E-015,30.0,0.0));
#245=DIRECTION(",(0.0,1.0,0.0));
#246=DIRECTION(",(0.0,0.0,1.0));
#247=AXIS2_PLACEMENT_3D(",#244,#245,#246);
#248=PLANE(",#247);
#249=CARTESIAN POINT(",(49,999999999999993,30.0,20.0));
#250=VERTEX POINT(",#249);
#251=CARTESIAN POINT(",(-7.105427E-015,30.0,20.0));
#252=DIRECTION(",(1.0,0.0,0.0));
#253=VECTOR(",#252,50.0);
#254=LINE(",#251,#253);
#255=EDGE_CURVE(",#212,#250,#254,.T.);
#256=ORIENTED EDGE(",*,*,#255,.T.);
#257=CARTESIAN_POINT(",(49.999999999999993,30.0,0.0));
#258=VERTEX_POINT(",#257);
#259=CARTESIAN POINT(",(49.999999999999993,30.0.0.0));
#260=DIRECTION(",(0.0,0.0,1.0));
#261=VECTOR(",#260,20.0);
#262=LINE(",#259,#261);
#263=EDGE CURVE(",#258,#250,#262,.T.);
#264=ORIENTED_EDGE(",*,*,#263,.F.);
#265=CARTESIAN POINT(",(49.999999999999993,30.0,0.0));
#266=DIRECTION('',(-1.0,0.0,0.0));
#267=VECTOR(",#266,50.0);
#268=LINE(",#265,#267);
#269=EDGE_CURVE(",#258,#220,#268,.T.);
#270=ORIENTED_EDGE(",*,*,#269,.T.);
```

#271=ORIENTED\_EDGE(",\*,\*,#225,.T.); #272=EDGE LOOP(",(#256,#264,#270,#271)); #273=FACE OUTER BOUND(",#272,.T.); #274=ADVANCED\_FACE(",(#273),#248,.T.); #275=CARTESIAN\_POINT(",(49.999999999999993,30.0,0.0)); #276=DIRECTION(",(1.0,0.0,0.0)); #277=DIRECTION('',(0.0,0.0,-1.0)); #278=AXIS2\_PLACEMENT\_3D(",#275,#276,#277); #279=PLANE(",#278); #280=CARTESIAN POINT(",(50.0,0.0,20.0)); #281=VERTEX\_POINT('',#280); #282=CARTESIAN\_POINT(",(49.999999999999993,30.0,20.0)); #283=DIRECTION(",(0.0,-1.0,0.0)); #284=VECTOR(",#283,30.0); #285=LINE(",#282,#284); #286=EDGE\_CURVE(",#250,#281,#285,.T.); #287=ORIENTED EDGE(",\*,\*,#286,.T.); #288=CARTESIAN POINT(",(50.0,0.0,0.0)); #289=VERTEX POINT('',#288); #290=CARTESIAN\_POINT(",(50.0,0.0,0.0)); #291=DIRECTION(",(0.0,0.0,1.0)); #292=VECTOR(",#291,20.0); #293=LINE(",#290,#292); #294=EDGE\_CURVE(",#289,#281,#293,.T.); #295=ORIENTED\_EDGE(",\*,\*,#294,.F.); #296=CARTESIAN\_POINT(",(50.0,0.0,0.0)); #297=DIRECTION(",(0.0,1.0,0.0)); #298=VECTOR(",#297,30.0); #299=LINE(",#296,#298); #300=EDGE\_CURVE(",#289,#258,#299,.T.); #301=ORIENTED\_EDGE(",\*,\*,#300,.T.); #302=ORIENTED\_EDGE(",\*,\*,#263,.T.); #303=EDGE LOOP(",(#287,#295,#301,#302)); #304=FACE\_OUTER\_BOUND(",#303,.T.); #305=ADVANCED\_FACE(",(#304),#279,.T.); #306=CARTESIAN\_POINT('',(50.0,0.0,0.0)); #307=DIRECTION(",(0.0,-1.0,0.0)); #308=DIRECTION(",(0.0,0.0,-1.0)); #309=AXIS2\_PLACEMENT\_3D(",#306,#307,#308); #310=PLANE(",#309); #311=CARTESIAN POINT(",(50.0,0.0,20.0)); #312=DIRECTION(",(-1.0,0.0,0.0)); #313=VECTOR(",#312,50.0); #314=LINE(",#311,#313); #315=EDGE\_CURVE(",#281,#210,#314,.T.); #316=ORIENTED\_EDGE(",\*,\*,#315,.T.); #317=ORIENTED EDGE(",\*,\*,#239,.F.); #318=CARTESIAN\_POINT(",(0.0,0.0,0.0)); #319=DIRECTION(",(1.0,0.0,0.0));

```
#320=VECTOR('',#319,50.0);
#321=LINE(",#318,#320);
#322=EDGE_CURVE(",#228,#289,#321,.T.);
#323=ORIENTED EDGE(",*,*,#322,.T.);
#324=ORIENTED_EDGE(",*,*,#294,.T.);
#325=EDGE_LOOP(",(#316,#317,#323,#324));
#326=FACE_OUTER_BOUND('',#325,.T.);
#327=ADVANCED_FACE('',(#326),#310,.T.);
#328=CARTESIAN POINT(",(25.0,15.0,0.0));
#329=DIRECTION(",(0.0,0.0,1.0));
#330=DIRECTION(",(1.0,0.0,0.0));
#331=AXIS2_PLACEMENT_3D(",#328,#329,#330);
#332=PLANE(",#331);
#333=ORIENTED EDGE(",*,*,#322,.F.);
#334=ORIENTED_EDGE('',*,*,#233,.F.);
#335=ORIENTED_EDGE('',*,*,#269,.F.);
```

Figure 9. Example of ISO 10303 AP203 in text file

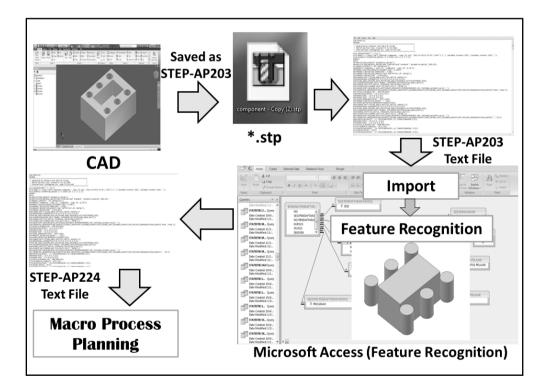


Figure 10. Steps in developing a feature-based system for automated machining feature recognition (ISO 10303 AP 224) of prismatic components

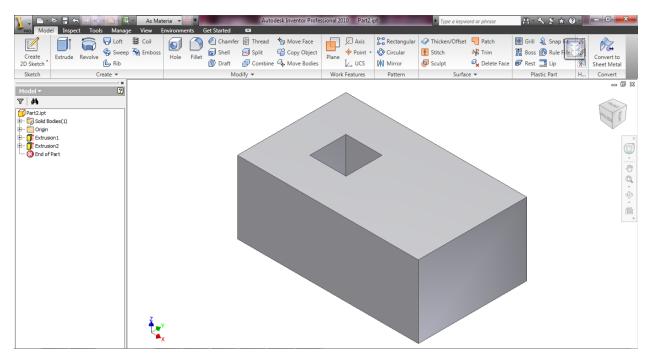


Figure 11. Geometric model designed by using Autodesk Inventor

<b>C</b> )	(x) ∃ ") * (2 → x]) ÷	Contract of the local division of the local	projek4 : D	atabase (Access 2007) - Microsof	t Access	and the second s		- 0 ×
	Home Create External Dat	a Database Tools						0
View Views	A Cut Paste ✓ Format Painter Clipboard		1= := ab2 - Ret	C New ∑ Totals Save ♥ Spelling ↓ Delete ▼ More * Records	2↓     ✓     Selection ~       ▲↓     Filter     ▲       ▲↓     Filter     ✓       ★↓     ✓     Toggle Filter       Sort & Filter     ✓	Find Find Find Find		
Custor	n 👻	<b>«</b>						
유 종 종 종 종 종 종 종 종 종 종 종 종 종 종 종 종 종 종 종	IAW_DATA_ORIENTED_EDGE IAW_DATA_PLANE CIRCLE IAW_DATA_VECTOR IAW_DATA_VERTEX							
	enting penting enting penting penting							
Ready	naan oo ah ahtii maanaan oo ah	×					Cap	Lock Num Lock

Figure 12. Running the Append Queries to input the data into specific tables, i.e. closed\_shell table, advanced\_face table, face\_bound table etc.

(a) Solution (a) - (b) - (b		Query Tools	projek4 : D	atabase (Access 2007) - Mic	rosoft Access				- 0 <b>- X</b>
Home Create External Data	Database To	ols Design							0
View Run Results	te Crosstab De Query Type	<u> </u> Data Definitio	n Show Delete Row Table Builder Que	: ' ' Insert Columns s 说 Delete Columns @ Return: All ~ ity Setup	Totals				
Custom 💿 «	┥ 🛄 RA	W_DATA_EDGE_CURVE	RAW_DATA_PLANE CI	RCLE I RAW_DATA_A	IS2_PLACEMENT 🛛 🖽 RAW	_DATA_DIRECTION	DIRECTION SEPERATOR		×
Tes     ADVANCED_CLOSED SHEL2     ADVANCED_FACE SEPERATOR     ADVANCED_FACE SEPERATOR     AUS2_PLACEMENT_3D SEPERATOR     CLOSED_SHELL SEPERATOR     PC CLOSED_SHELL SEPERATOR     PDRECTION SEPERATOR     PEDGE_CURVE SEPERATOR     PEDGE_CURVE SEPERATOR     PEDGE_CURVE SEPERATOR	(	NDEX Field1 Field2 Field3 Field4 Field4 Field4							
FACE_OUTER BOUND SEPERATOR									-
	<b>▲</b>								•
LIST_EDGE_LOOP1	Field:		Field2 Field3		INDEX				
Image: Provide the second	Table: Sort:	Import text	Import text Impo	t text Import text	Import text				
Image: Plane seperator         Image: Plane seperat	Append To: Criteria: or:	DATA Like "*DIRECTION*"	X Y	Z	INDEX				
penting penting									
penting penting penting									
Query3									
CLOSED_SHELL SEPERATOR1		∢							•
LIST_EDGE_LOOP     Query2									
Ready								Caps Lock N	Num Lock 🛛 🗊 sou 🕌

Figure 13. Design view of Append Queries

	(≤) ; = = + (□ - → □) =		division of		projek	4 : Database (Access 20	107) - Microsof	t Access	-	Company's a strengt	Ref. al		
9	Home Create Exter	nal Data	Database Tools										0
Views	Paste Format Painter	B Z	- U <u>A</u> - <u>A</u> - H		課 課 ▶11	Refresh All - X Delete Records	∑ Totals	20	ter Toggle Filter	Find Contract Contra			
		• «	Font	19	Rich Text	Records			Sort & Filter	Find			
Custon		× ×											
	ST_EDGE_LOOP												
00 Q													
	DVANCED_FACE UPDATE												
	DVANCED_FACE1- UPDATE												
	XIS2_PLACEMENT_3D UPDATE												
	ARTESIAN_POINT UPDATE												
28, 33, 222	LOSED_SHELL UPDATE												
	IRECTION UPDATE												
	DGE_LOOP UPDATE	DIREC	TION UPDATE										
	ACE_OUTER_BOUND UPDATE												
	Inction												
	ndex												
82 <u>- 3</u> 3 - 68	IDEX SEPERATOR		1										
	NE UPDATE												
	RIENTED_EDGE UPDATE												
	LANE UPDATE												
	ERTEX_POINT UPDATE	=											
Pt x	an a												
Pt y													
r z													
	opy Of SEPARATOR												
Ready	1.4090 (9.11.9.40 <sup>1</sup> .757) (9.143) (9.167) (9.1	*										Constant	Num Lask
Reauy												Caps Loo	k Num Lock

Figure 14. Running the Update Queries to modify the data into the desired format

<b>(</b> ) 🐼 🚽 🤊 🗠	- → <b>)</b> ÷		-	Query Tools	projek4 : Databa	se (Access 2007) - Micr	osoft Access			- 0 <b>- X</b>
Home Crea	ate External Da	ata	Database To	Design						0
View Run Results			Contract of the local division of the local	OD Union Pass-Through A Data Definition	Hard Show Table A Builder Query Set	Delete Columns Return:				
Custom		• «	4 💷 RA	W_DATA_EDGE_CURVE	RAW_DATA_PLANE CIRCLE	RAW_DATA_AX	S2_PLACEMENT	RAW_DATA_DIRECTION		×
VECTOR SEPERATOR     VERTEX_POINT SEP     Penting pending penting penting penting penting penting	ERATOR enting ERATOR1 JPDATE	•			RAW_DATA_EDGE_C TOP DATA FUNCTION START POINT END POINT LINE CIRCLE	JRVE				
AXIS2_PLACEMENT_			4 📖							•
CARTESIAN_POINT U CLOSED_SHELL UPD CLOSED_SHELL UPD DIRECTION UPDATE	UPDATE		Table:	FUNCTION RAW_DATA_EDGE_CURVI Mid([DATA],InStr(1, [DATA]	E  , "= ")+1, InStr(1, [DATA], "(")-InStr(	,[DATA], "= "]-1)				
EDGE_CURVE UPDA	ATE									
EDGE_LOOP UPDAT     FACE_OUTER_BOUN     function										
Index				•						•
CRIENTED_EDGE UP	PDATE	•								
Ready									Caps Lock	Num Lock 🔲 sqL 🕌

Figure 15. Design view of Update Queries

			able Tools	projek	4 : Database (Access 200	7) - Microsof	t Access					0 X
Home Create Extern	nal Data	Database Tools	Datasheet									0
Cut	Calibri	- 11	• = = =		<u>a</u>	Σ Totals		Advanced -	Go To			
View Paste S Format Painter	BI	<u>u</u> 🔺 - 🖄 - 🌐	-	i≡ :≡ ab2 -	Refresh All - X Delete -	More -	A Filt	ter 🛛 Toggle Filter	Find Select	-		
Views Clipboard 🕞		Font	G	Rich Text	Records			Sort & Filter	Find			
Custom	•	Import text	RAW_DATA_ADV	ANCED_FACE								×
Custom Group 1	×			DATA	•	FUN	ICTION	<ul> <li>PLANI</li> </ul>	E CIRCLE 🔹	FACE BOUND	✓ Add New Field	
Unassigned Objects	*	#107	#107=ADVANCE			ADVANCE	-	#106		#72		
BOX		#138	#138=ADVANCE			ADVANCE		#137		#112		
Import text		#169	#169=ADVANCE			ADVANCE	-	#168		#143		
LIST_CLOSED_SHELL	-	#191	#191=ADVANCE			ADVANCE	_	#190 #202		#174		
LIST_EDGE_LOOP3		#203	#203=ADVANCE #215=ADVANCE			ADVANCE ADVANCE		#202		#196 #208		
RAW_DATA_ADVANCED_FACE		*	#213-ADVANCE	D_FACE(		ADVANCE	D_FACE	#214		#206		
RAW_DATA_AXIS2_PLACEMENT												
RAW_DATA_CARTESIAN_POINT												
RAW_DATA_CLOSED_SHELL												
RAW_DATA_DIRECTION												
RAW_DATA_EDGE_CURVE												
RAW_DATA_EDGE_LOOP												
RAW_DATA_FACE_BOUND												
RAW_DATA_LINE CIRCLE												
RAW_DATA_ORIENTED_EDGE												
RAW_DATA_PLANE CIRCLE												
RAW_DATA_VECTOR												
RAW_DATA_VERTEX												
III Tes												
ADVANCED_CLOSED SHELL2												
ADVANCED_FACE SEPERATOR												
AXIS2_PLACEMENT_3D SEPERATO	R .	Record: I I of 6	► H H≣ 🔆	No Filter Search								
Datasheet View										Ca	ps Lock Num Lock	0 8 C ¥

Figure 16. Advanced\_Face table

📭 🖻 🖬 🤊 - 🔍 📲 🔍		T	able Tools	orojek4 : Da	atabase (Access 20	07) - Microsoft Access			T		×
Home Create Extern	nal Data	Database Tools	Datasheet							J	
Views Clipboard	Calibri B I	- 11 <u>U</u> <u>A</u> - <u>A</u> - <u>E</u> Font		Refi	esh I Vew Records	More •	Filter Selection *	Image: Back Replace       ⇒ Go To ~       Find       Image: Select ~       Find			
Custom		Import text	RAW_DATA_FACE_BOUND	RAW_I	DATA_EDGE_LOOP	RAW_DATA_ADVA	NCED_FACE				×
Custom Group 1	* 🔺	INDEX -	DATA	•	FUNCTION	✓ EDGE_CURVE 1 →	EDGE_CURVE 2	<ul> <li>EDGE_CURVE 3</li> </ul>	▼ EDGE_CURVE 4 ▼	EDGE_CURVI	- EDGE
Unassigned Objects	*	#105	#105=EDGE_LOOP("		EDGE_LOOP	#82	#90	#98	#104		
вох		#136	#136=EDGE_LOOP("		EDGE_LOOP	#120	#128	#134	#135		
Import text		#167	#167=EDGE_LOOP("		EDGE_LOOP	#151	#159	#165	#166		
LIST_CLOSED_SHELL		#189	#189=EDGE_LOOP("		EDGE_LOOP	#180	#181	#187	#188		
LIST_EDGE_LOOP3		#201	#201=EDGE_LOOP("		EDGE_LOOP	#197	#198	#199	#200		
RAW DATA ADVANCED FACE		#213	#213=EDGE_LOOP("		EDGE_LOOP	#209	#210	#211	#212		
RAW DATA AXIS2 PLACEMENT		*									
RAW_DATA_CARTESIAN_POINT											
RAW_DATA_CLOSED_SHELL											
RAW_DATA_DIRECTION											
RAW_DATA_EDGE_CURVE											
RAW_DATA_EDGE_LOOP											
RAW_DATA_FACE_BOUND											
RAW_DATA_LINE CIRCLE											
RAW_DATA_ORIENTED_EDGE											
RAW_DATA_PLANE CIRCLE											
RAW_DATA_VECTOR											
RAW_DATA_VERTEX											
III Tes											
ADVANCED_CLOSED SHELL2											
ADVANCED_FACE SEPERATOR											
AXIS2_PLACEMENT_3D SEPERATOR	R 👻	Record: I4 4 1 of 6	🕨 🕨 😵 No Filter 🖇	earch	•	ш					•
Datasheet View									Caps Lock	Num Lock	6 (L ¥

Figure 17. Edge\_Loop table

💽 🗟 🚽 ଏ · ° · » 🗍 🔻	Table Tools	projek4 : Database (Access 2007) - Microso	oft Access		
Home Create External Data	Database Tools Datasheet				0
View Paste Format Painter	· <u>u A</u> · <u>A</u> · <u>H</u> · <u>H</u> ·	Image: Solution of the solu	A ZO Toggle Filter	Image: Apple of the second	
Views Clipboard 🕞	Font		Sort & Filter	Find	
Custom 🔍 🤇		LIST_CLOSED_SHELL I RAW_DATA_EDGE_LOOP			×
Custom Group 1 × Unassigned Objects *	#107				
BOX	#107				
Import text	#169				
LIST CLOSED SHELL	#191				
LIST_EDGE_LOOP3	#203				
RAW_DATA_ADVANCED_FACE	#215				
RAW_DATA_AXIS2_PLACEMENT	*				
RAW DATA CARTESIAN POINT					
RAW_DATA_CLOSED_SHELL					
RAW_DATA_DIRECTION					
RAW_DATA_EDGE_CURVE					
RAW_DATA_EDGE_LOOP					
RAW_DATA_FACE_BOUND					
RAW_DATA_LINE CIRCLE					
RAW_DATA_ORIENTED_EDGE					
RAW_DATA_PLANE CIRCLE					
RAW_DATA_VECTOR					
RAW_DATA_VERTEX					
Tes					
ADVANCED_CLOSED SHELL2					
ADVANCED FACE SEPERATOR					
	▼ Record: I4 4 of 6 + H H 🕱	No Filter Search			
Datasheet View					Caps Lock Num Lock 🛅 🏭 🏙 🕍

Figure 18. List of Closed\_Shell table