

River–floodplain hydrology of an embanked lowland Chalk river and initial response to embankment removal

H.M. Clilverd¹, J.R. Thompson¹, C.M. Heppell², C.D. Sayer¹ and J.C. Axmacher¹

¹*UCL Department of Geography, University College London, Pearson Building, Gower Street, London, WC1E 6BT, UK*
h.clilverd@ucl.ac.uk

²*Department of Geography, Queen Mary University of London, Mile End Road, London, E1 4NS, UK*

Received 30 August 2011; accepted 26 October 2012; open for discussion until 1 October 2013

Editor Z.W. Kundzewicz; Associate editor K. Heal

Citation Clilverd, H.M., Thompson, J.R., Heppell, C.M., Sayer, C.D., and Axmacher, J.C., 2013. River–floodplain hydrology of an embanked lowland Chalk river and initial response to embankment removal. *Hydrological Sciences Journal*, 58 (3), 627–650.

Abstract Rivers have been channelized, deepened and constrained by embankments for centuries to increase agricultural productivity and improve flood defences. This has decreased the hydrological connectivity between rivers and their floodplains. We quantified the hydrological regime of a wet grassland meadow prior to and after the removal of river embankments. River and groundwater chemistry were also monitored to examine hydrological controls on floodplain nutrient status. Prior to restoration, the highest river flows ($\sim 2 \text{ m}^3 \text{ s}^{-1}$) were retained by the embankments. Under these flow conditions the usual hydraulic gradient from the floodplain to the river was reversed so that subsurface flows were directed towards the floodplain. Groundwater was depleted in dissolved oxygen (mean: $0.6 \text{ mg O}_2 \text{ L}^{-1}$) and nitrate (mean: $0.5 \text{ mg NO}_3^- \text{ N L}^{-1}$) relative to river water (mean: $10.8 \text{ mg O}_2 \text{ L}^{-1}$ and $6.2 \text{ mg NO}_3^- \text{ N L}^{-1}$, respectively). Removal of the embankments has reduced the channel capacity by an average of 60%. This has facilitated over-bank flow which is likely to favour conditions for improved flood storage and removal of river nutrients by floodplain sediments.

Key words river restoration; surface–subsurface connectivity; floodplain; Chalk; nitrogen

Hydrologie du système rivière–lit majeur d’un cours d’eau endigué de plaine sur la craie et réponse initiale à la suppression des digues

Résumé Depuis des siècles, les cours d’eau ont été canalisés, sur-creusés, et endigués pour accroître la productivité agricole et améliorer la protection contre les crues. Il en a résulté une baisse de la connectivité hydrologique entre ces cours d’eau et leur lit majeur. Nous avons quantifié le régime hydrologique d’une prairie humide avant et après l’élimination de digues la séparant du cours d’eau adjacent. Les compositions chimiques du cours d’eau et de la nappe phréatique ont également été suivies afin de caractériser les interactions entre hydrologie et statut trophique du sol au niveau du lit majeur. Avant restauration, même les plus hauts débits ($\sim 2 \text{ m}^3 \text{ s}^{-1}$) étaient contenus dans le lit mineur par les digues. Dans ces conditions, le gradient hydraulique, dirigé habituellement du lit majeur vers le cours d’eau, s’inversait de telle manière que les écoulements souterrains s’effectuaient en direction du lit majeur. L’eau du sous-sol était plus pauvre en oxygène dissous (moyenne : $0,6 \text{ mg O}_2 \text{ L}^{-1}$) et en nitrates (moyenne: $0,5 \text{ mg NO}_3^- \text{ N L}^{-1}$) que le cours d’eau (moyenne: $10,8 \text{ mg O}_2 \text{ L}^{-1}$ et $6,2 \text{ mg NO}_3^- \text{ N L}^{-1}$, respectivement). L’effacement des digues a réduit la capacité du lit mineur de 60% en moyenne. En facilitant les débordements, les travaux de restauration devraient conduire à un stockage plus important en période de crue et à une épuration de la rivière par stockage des éléments minéraux dans les alluvions.

Mots clefs restauration de rivière; connectivité entre surface et souterrain; plaine inondable; craie; azote

INTRODUCTION

Pristine river floodplain ecosystems are strongly influenced by disturbance associated with regular flooding

events. They are characterised by high habitat heterogeneity, primary productivity and biodiversity (Grevilliot *et al.* 1998, Ward 1998, Gowing *et al.* 2002a, Woodcock *et al.* 2005). These conditions

are driven by the strong hydrological connectivity between rivers and their floodplains, which facilitates the exchange of water, sediments, organic matter and nutrients that are fundamental in shaping floodplain structure and function (Triska *et al.* 1989, Ward and Stanford 1995, Poff *et al.* 1997, Grevilliot *et al.* 1998, Pringle 2003). In floodplain habitats, fluctuations in the soil water regime, associated with strong hydrological connectivity, are important for the creation of a dynamic and varying physical environment (Poff *et al.* 1997, Robertson *et al.* 2001). This, in turn, exerts a strong influence upon species composition, and the creation and maintenance of high biodiversity in pristine floodplain habitats (Ward 1998, Freeman *et al.* 2007). In addition to the ecological benefits of river–floodplain connections, the importance of floodplains for flood water storage and downstream flood peak attenuation has also been widely documented (DeLaney 1995, Bullock and Acreman 2003, Acreman *et al.* 2007, Hammersmark *et al.* 2008).

Floodplains are prominently positioned in the landscape between hillslopes and streams and river channels. They function as a collection point for groundwater, runoff from upland areas and river water. The degree of hydrological exchange between rivers and their floodplains varies widely and is a function of river–floodplain geomorphology, the magnitude–frequency characteristics of river discharge and sediment porosity (Triska *et al.* 1993, Boulton *et al.* 1998, Dahm *et al.* 1998). Subsurface exchange of water between a river and floodplain sediments is a relatively slow, but constant water-transfer mechanism (generally in the order of cm d^{-1}). Under baseflow conditions, groundwater flow is typically directed from the floodplain towards the channel, discharging water into the river. Conversely, during periods of peak river discharge when river stage is above the floodplain water table, flow is directed from the river onto the floodplain (Dingman 1994, Burt *et al.* 2002). Floodplain storage can therefore sustain stream baseflows in inter-storm periods and attenuate downstream flood peak discharges during storm events (Gregory *et al.* 1991, DeLaney 1995, Hill 2000).

In permeable floodplain sediments, the focus of this paper, subsurface flow of water from the river towards the floodplain is an important mechanism that can facilitate removal of river nutrients via plant assimilation and denitrification. Likewise, floodplain interception of shallow subsurface flow from hillslopes can be important for the removal of agricultural fertilisers in groundwater (Vidon and

Hill 2004, Billy *et al.* 2010). The importance of these subsurface pathways for denitrification may be increased in permeable alluvial sediments due to a favourable balance between residence time (resulting in depleted dissolved oxygen conditions) and supply of nitrate and organic matter that is required to drive the process. Optimum conditions for denitrification are often reported to occur 1–2 m from the river channel in the hyporheic zone (the saturated region beneath and adjacent to streams and rivers that contains both groundwater and surface water), where a strong redox gradient exists and nitrate-rich river water or groundwater intersects with alluvium that is rich in organic matter (Triska *et al.* 1989, Jones and Holmes 1996, Hedin *et al.* 1998, Burt *et al.* 1999).

Over-bank flow forms a second, more episodic mechanism which can often inundate large areas of a floodplain. It substantially enhances the intrusion of river water and accompanying particles into floodplain sediments and the underlying groundwater, so that, even in permeable floodplain settings, over-bank flow may represent a major source of nutrients to floodplain plants and microbes. This can substantially increase the nutrient attenuation capacity of nitrate-limited floodplains (Venterink *et al.* 2003, Forshay and Stanley 2005, Clilverd *et al.* 2008), as well as nitrate-loaded floodplains where flooding increases substrate availability for denitrifying bacteria (Baker and Vervier 2004). Over-bank flow not only leads to greater potential for nutrient removal from the river ecosystem, but is also important for flood water storage (Schade *et al.* 2002, Forshay and Stanley 2005, Hammersmark *et al.* 2008).

However, many floodplains, where over-bank flow was historically a regular occurrence, no longer flood frequently due to alteration of the natural flow regime. Regulation of rivers and streams over past centuries has had a lasting impact on the hydrological characteristics of floodplain ecosystems. Many rivers worldwide have been channelized, constrained by embankments, and deepened to aid agricultural production and protect agricultural and urban developments from flooding (Buijse *et al.* 2002, Tockner and Stanford 2002). This has disabled or restricted the over-bank flow mechanism, therefore severely limiting the hydrological connectivity between rivers and their floodplains. As a consequence, the transfer of water, sediment and nutrients to floodplains has been strongly impeded (Tockner *et al.* 1999, Wyzga 2001, Antheunisse *et al.* 2006). Floodplain restoration, through embankment removal and the reconfiguration of river channels, is now being increasingly employed

to re-establish river–floodplain connections. The aims of these restoration works are often multifaceted and include enhanced floodplain biodiversity, improved nutrient-attenuation capacity and the provision of temporary storage of flood water (Muhar *et al.* 1995, Bernhardt *et al.* 2005). This study seeks to investigate the implications of river embankment removal on river–floodplain hydrological connectivity in a permeable, chalk setting.

Chalk aquifers are a major groundwater resource in northwestern Europe. They form an important contribution to river flow, maintaining stable flows of clear cool water in chalk rivers, even during extended periods of low rainfall (Sear *et al.* 1999, Allen *et al.* 2010). In pristine environments, these conditions are favourable for the development of diverse river macrophyte and faunal communities (Berrie

1992). However, chalk rivers are under increasing management pressures, including low-flow issues, due to enhanced groundwater abstraction. If river restoration is to be undertaken in these types of rivers, with the aim of enhancing river–floodplain interactions, then it is crucial that our understanding of hydrological connectivity is improved. This research studies river–floodplain hydrological connectivity both prior to and following a restoration scheme to remove river embankments on the River Glaven in north Norfolk, eastern England (Fig. 1). Two years of pre-restoration hydrological and chemical data, and 1.5 years of post-restoration hydrological data are reported here to address two research questions: (a) what is the hydrological and biogeochemical regime of an embanked-river floodplain; and (b) what is the initial response to embankment removal?

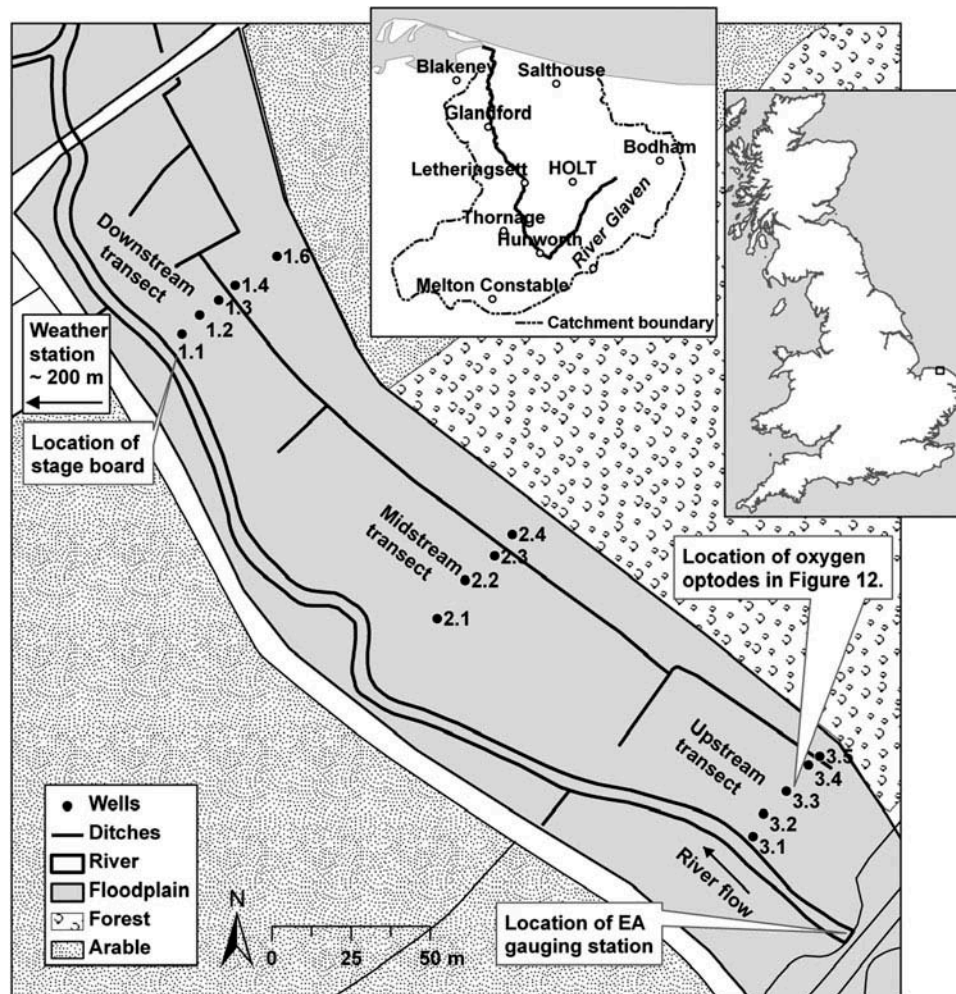


Fig. 1 The River Glaven restoration site at Hunworth, north Norfolk. The woodland and arable border along the northeast of the meadow delineates the base of a hillslope. Well 3.1 (upstream transect) was located on the river embankment; and Well 1.1 (downstream transect) behind the river embankment. The River Glaven catchment is shown inset, with the location of the study site at Hunworth.

METHODS

Study site

The study was conducted at Hunworth Meadow on the River Glaven, north Norfolk, approximately 34 km northwest of Norwich ($52^{\circ} 52' 55.53''$ N, $01^{\circ} 03' 55.45''$ E; elevation approx. 20 m). Average temperatures range from approx. 4°C in January to 17°C in July (date range 1950–2010, British Atmospheric Data Centre 2010). Mean annual precipitation is approx. 660 mm (date range 1950–2010), with highest rainfall typically occurring during the autumn and winter months (British Atmospheric Data Centre 2010). The River Glaven is 17 km in length, has a catchment area of 115 km² and flows southwest from headwaters in Lower Bodham before taking an acute turn at Hunworth to continue northwards to Blakeney Point, where it discharges into the North Sea (Fig. 1) (Pawley 2008, Jacklin *et al.* 2010).

The Glaven Valley consists of Upper Cretaceous Chalk bedrock, which is overlain by chalk-rich stony, sandy, silty, boulder clay (Lowestoft Formation) up to 40 m thick. The Lowestoft Formation outcrops extensively throughout the Glaven catchment, but is overlain by Quaternary glaciogenic sand and gravel deposits (Briton's Lane Sand Gravel Member) at the study site (Fig. 2). Hillwash (also known as Head), a poorly sorted mixture of clay, sand, silt and gravel, typically occurs as a veneer less than one metre thick on the valley slopes, and up to several metres thick at the base of steep slopes. Alluvium along the floodplain of the River Glaven is estimated to be a maximum of 2 m thick, and consists predominantly of unconsolidated layers of sand and silt, but also includes sediments that range from clay to coarse gravel (Moorlock *et al.* 2002). For much of its length, the river is classified as a chalk stream (Pawley 2008). Rivers of this type typically flow

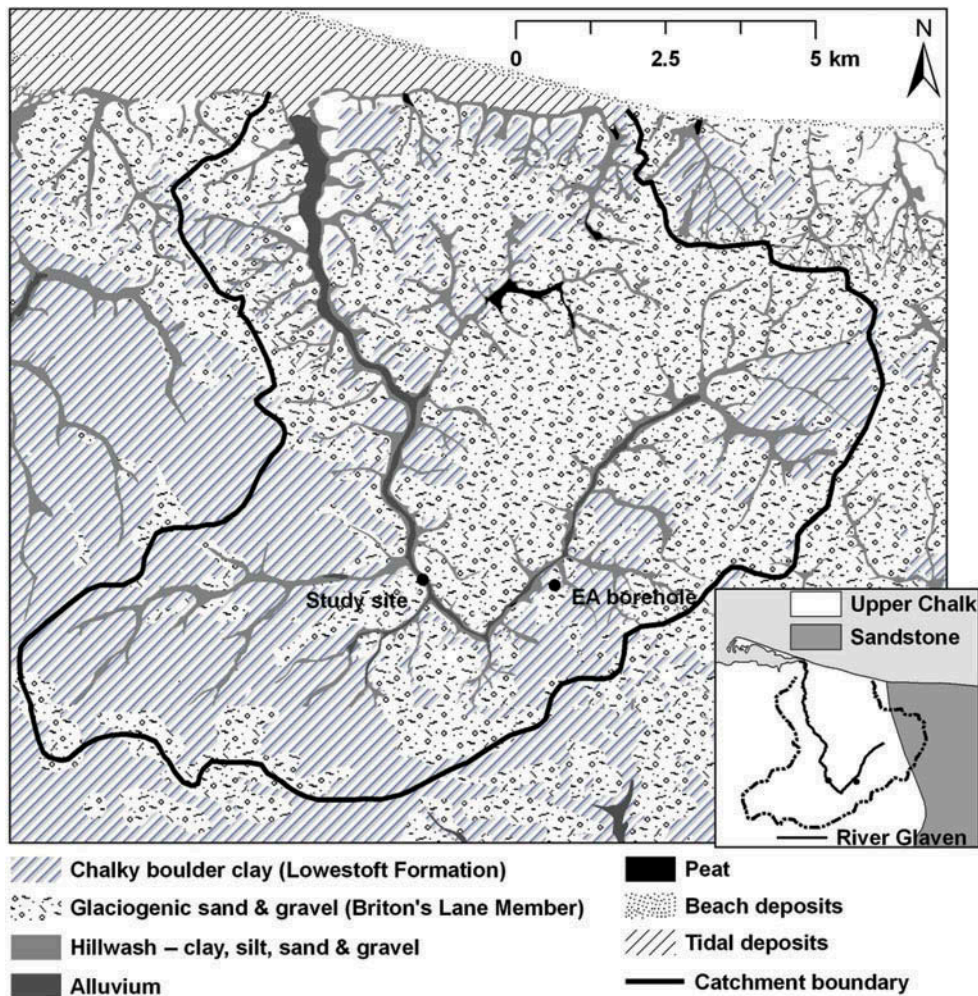


Fig. 2 Superficial geology of the River Glaven catchment, and regional bedrock geology (inset), based on British Geological Survey 1:50 000 map data.

through mixed geologies for some of their length and, although local hydraulic features are important, they often maintain some of the characteristics of a groundwater-dominated chalk system, e.g. high base-flow index, dampened discharge fluctuations, stable substratum dominated by gravel and relatively high alkalinity (Sear *et al.* 1999).

The River Glaven flows through arable land, coniferous plantations and grazing meadows. Many reaches have been subject to extensive alterations which have involved the deepening and straightening of the channel and the construction of embankments. In addition, some floodplain areas have been drained and the natural vegetation has been widely cleared and transformed for agriculture. The natural flow of the river has also been interrupted or diverted by numerous weirs and mills. At Hunworth, the River Glaven was constrained by embankments along the entire length of the meadow study site. The meadow is approximately 400 m long, 40–80 m wide and has an area of approximately 3 ha. It is bounded to the north-east by an arable and woodland hillslope (Fig. 1). An agricultural drainage ditch, which was installed sometime between 1950 and 1980, runs parallel to the river along the floodplain. This ditch has become blocked towards the downstream end of the meadow in recent years, impairing the site's drainage. The management history of Hunworth Meadow is known from 1992 onwards. The meadow was intensively grazed by cattle until 2000, after which a less intense grazing regime, using mainly cattle with some sheep, has been established. Low levels of inorganic fertiliser were used until 1997, but since then Hunworth Meadow has not received any fertiliser application (Ross Haddow, Stody Estate, personal communication, 9 October 2012).

The River Glaven was straightened and its channel relocated at various times in the past, most recently around 1800 during the reconstruction of Thornage Mill, located approximately 100 m downstream from the study site. The river channel was subsequently deepened and embanked for flood defence purposes during the 1960s and 1970s. Restoration of the river was undertaken in March 2009 and involved the removal of approximately 1400 Mg (megagrams) of soil from the embankments. The aim was to increase hydrological connectivity between the over-deepened, embanked river, and its long abandoned floodplain to improve flood storage, site drainage and ecological diversity within the floodplain (e.g. Leyer 2005, Acreman *et al.* 2007, Hammersmark *et al.* 2008).

Study design

Continuous observations of groundwater depth and river stage, measurements of groundwater chemistry and surveys of topography were collectively used to determine the hydrological impacts of river restoration. Groundwater wells were installed across the meadow in February 2007 in three transects approximately 33–39 m in length, each consisting of four or five wells (Fig. 1). Transects extended from the base of the arable and woodland hillslope to the river embankments and were aligned perpendicular to the river, i.e. parallel to the assumed main groundwater flow direction. The wells were installed at varying depths between 1.3 and 2.0 m, due to the presence of alluvial gravels which proved difficult to penetrate with a hand auger. The wells were constructed from polypropylene pipe (inside diameter = 3.0 cm), screened with 3 mm diameter holes and wrapped in geotextile cloth to prevent blockage by fine silts. The tops were covered with rubber caps between sampling dates. To prevent cattle trampling and damaging the wells, the top of the wells were approximately 1–2 cm below the soil surface, and covered with a protective concrete slab (approx. 30 cm × 30 cm).

Hydrological monitoring

To characterize fluctuations in groundwater elevation, Solinst combined pressure transducer-dataloggers (Levellogger Gold 3.0, Georgetown, ON, Canada) were installed in four wells at the upstream transect, one well at the midstream transect and five wells at the downstream transect. Groundwater elevation was recorded hourly from February 2007 to August 2010. Levellogger readings were checked during field visits with hand measurements of groundwater elevation along each well transect. The response of groundwater elevation relative to precipitation and river stage was determined using data from an automatic weather station (MiniMet SDL 5400, Skye, Powys, UK) that was located approximately 200 m from the site, and an Environment Agency (EA) gauging station (#034052) located immediately upstream of Hunworth Meadows (Fig. 1). The weather station was installed in May 2007 and stored precipitation data at 30-min intervals.

Mean daily river stage and discharge data were available for the Hunworth gauging station for the period 2001–2010. However, there were some gaps in the record, because seasonal macrophyte growth in the channel downstream of the gauging station caused

water to backup over the weir that impacted on the rating curve and reduced the accuracy of the data during these periods. This was manifested in a slow increase in baseflow through summer, despite low or no rainfall, upon which individual peaks associated with rainfall events were superimposed. Subsequently, this apparent elevated baseflow would decline during the autumn due to macrophyte dieback. The influence of the vegetation on discharge measurements was, in some cases, removed abruptly during flood events, possibly due to a devegetation of the river channel and relocation of sediment downstream. The influence of macrophyte growth on river discharge was easily identified in the discharge record when compared with precipitation data. The affected data are indicated in Fig. 3 within the current study and were excluded from quantitative analyses (baseflow index, flow duration).

The river baseflow index (BFI) was calculated for each full year of EA discharge data which included high-flow and low-flow years, using a baseflow separation program (BFI version 4.15) (Wahl and Wahl 2007) in order to characterise the regime of the river and, in particular, the likely influence of subsurface flows. The method employed follows the Institute of Hydrology (1980) baseflow separation procedure, in which the water year is divided into 5-day increments

to identify minimum flow. The baseflow index is calculated as the ratio of baseflow volume to the total volume of streamflow. High BFI values indicate groundwater dominance, which is broadly represented by a stable flow regime (Sear *et al.* 1999). A detailed description of the BFI calculation is given by Gustard *et al.* (1992).

The contribution of groundwater to total river flow was also investigated using flow exceedence values for Q10 (a high-flow threshold that is equalled or exceeded for 10% of the flow record) and Q95 (a low-flow threshold equalled or exceeded for 95% of the flow record), which were determined from the river flow duration curve, derived using the complete record of stream discharge but excluding suspect data resulting from the impact of macrophyte growth on the rating curve. The Q95, expressed as the percentage of mean annual river flow, and the comparison of Q10 and Q95 provide a measure of the variability (i.e. flashiness) of the flow regime (Gustard *et al.* 1992, Marsh and Hannaford 2008).

Daily values of Penman-Monteith potential evapotranspiration (Monteith 1965) were computed from meteorological data (temperature, net radiation, humidity, wind speed) provided by the on-site weather station. These data were supplemented by a nearby

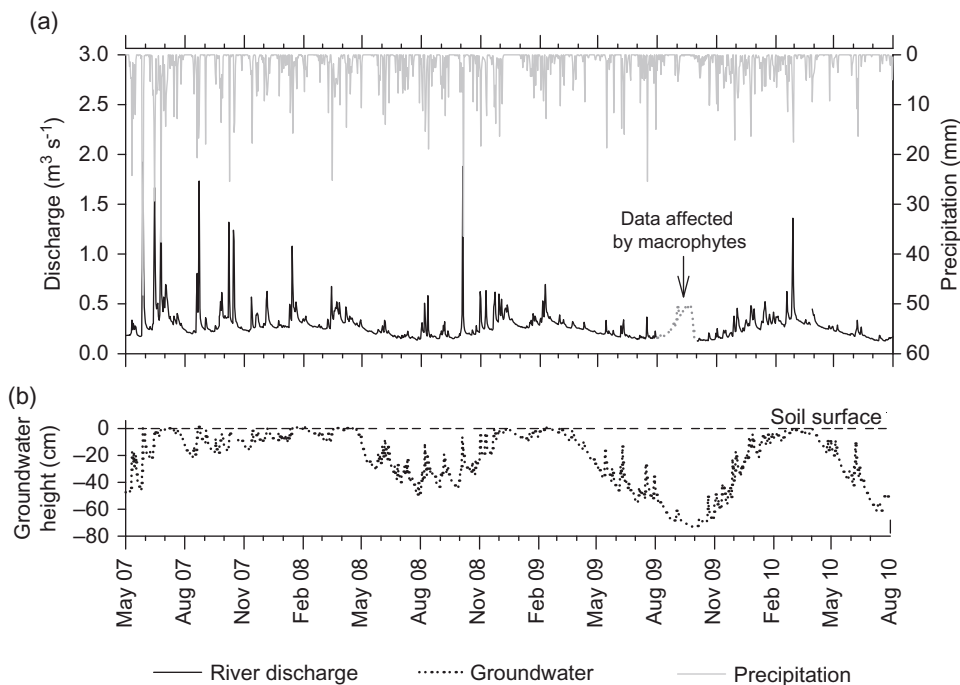


Fig. 3 Temporal variation in (a) mean daily river discharge and total daily precipitation, and (b) representative mean daily groundwater height (downstream Well 1.6) for the four study years (2007–2010). The river discharge data affected by aquatic macrophyte growth (August–October 2009) are highlighted in (a).

(<10 km) UK Met Office weather station (source ID: 24219, Mannington Hall). The reference formula for grasslands described by Allen (2000) was used, which assumes a constant grass height of 0.12 m throughout the year (see also Hough and Jones 1997), and a fixed surface resistance of 70 s m⁻¹ with an albedo of 0.23 (Allen 2000).

Physical soil properties

Bulk density and porosity were calculated from the difference in the volume of saturated and dry soil (Elliot *et al.* 1999) collected using bulk density rings from the top 0–20 cm of soil. Organic matter content was subsequently analysed by the Loss on Ignition approach (Heiri *et al.* 2001). Soil particle size was determined with optical laser diffraction using an LS 13320 Coulter Counter Particle Size Analyser (Beckman Coulter Corp., Hialeah, FL, USA). Prior to analysis, the soil samples were treated with hydrogen peroxide to remove organic matter and subsequently with sodium hexametaphosphate (Calgon^R) to disaggregate the soil particles (Chappell 1998).

Hydraulic conductivity

Hydraulic conductivity of the top 0.3–2 m of soil (assumed to be isotropic) was determined using piezometer slug tests ($n = 9$) following the approach of Surridge *et al.* (2005). Hydraulic conductivity of the organic topsoil was not measured because the slug tests were conducted during the summer when surface soils were dry. A Solinst 3.0 pressure transducer installed at the base of the piezometer recorded the recovery of the water table every 10 seconds after the slug; a sand ballast-filled PVC tube (outside diameter = 2.2 cm), sealed at both ends with rubber bungs, was removed from the piezometer. Hydraulic conductivity was calculated from the recovery in hydraulic head assuming Darcian flow as:

$$K = \frac{A}{FT} \quad (1)$$

where K is hydraulic conductivity (cm s⁻¹); T is the basic hydrostatic time lag (s); A is the inside cross-sectional area of the piezometer (cm²); and F is the shape factor of the piezometer intake (cm) (Hvorslev 1951, Baird *et al.* 2004, Surridge *et al.* 2005), calculated as:

$$F = \frac{2.4\pi l}{\log_e \left[\frac{1.2l}{d} + \sqrt{1 + \left(\frac{1.2l}{d}\right)^2} \right]} \quad (2)$$

where d is the outside diameter of the intake (cm); and l is the length (cm) (Brand and Premchitt 1980, Baird *et al.* 2004). The hydrostatic time lag (T) was solved by fitting equation (3) to the measured head recovery data using a least-squares minimisation with T as the fitted parameter:

$$\frac{h}{h_0} = e^{-t/T} \quad (3)$$

where h is the head difference at t (cm); h_0 is the initial head difference (cm); and t is time from the start of the test (s) (i.e. slug withdrawal) (Hvorslev 1951, Baird *et al.* 2004).

Subsurface flow rates assuming Darcian flow were calculated as:

$$v = K \frac{\Delta h}{\Delta l} / n_e \quad (4)$$

where v is flow rate (m d⁻¹); n_e is effective porosity; $\Delta h/\Delta l$ is the water table slope, which was obtained from hydraulic head measurements taken at each well along the transect; and K is hydraulic conductivity (m d⁻¹) (Domenico and Schwartz 1998). Mean values of K and $\Delta h/\Delta l$ for each well transect were used in this calculation.

River and groundwater chemistry

River water and floodplain groundwater (top 1–2 m of soil) samples were taken bimonthly from April 2007 to June 2008 to examine spatial and temporal variations in subsurface chemistry. Water samples were collected using a point-source bailer and stored in pre-washed 250 mL polyethylene bottles. Before acquiring samples, the wells were purged to introduce fresh groundwater and the collection bottles were rinsed with well water. Samples were stored in a cooler until return to the laboratory, refrigerated and then filtered through 0.45- μ m filter paper. Any samples that could not be analysed within two days were frozen.

Dissolved oxygen (DO), pH and electrical conductivity were measured in the field at the time of water sampling using a YSI-555A DO meter (YSI Hydrodata Ltd., Letchworth, UK), a Mettler Toledo MP120 pH meter and a Mettler Toledo

MC126 conductivity meter (Columbus, OH, USA), respectively. Measurements of DO in the soil profile were obtained at 30-min intervals from two Aanderaa 4175 DO optodes (Bergen, Norway) connected to Campbell Scientific CR1000 dataloggers (Loughborough, UK). To evaluate temporal fluctuations in DO concentration within the rooting zone, the DO optodes were installed at the upstream well transect (Fig. 1) from January 2009 to August 2010. Initially, the optodes were installed in wells at 10- and 30-cm depths. However, in January 2010 the 30-cm DO optode was moved from the well and buried directly in the soil at 10 cm below ground surface (b.g.s.). Although the optodes can remain *in situ* for more than one year without repeated calibration (Aanderaa 2006), the calibration was checked periodically using a zero-oxygen solution (sodium sulphite saturated in deionised water) and 100% saturated solution (deionised water bubbled with air).

In the laboratory, cations (Ca^{2+} , Mg^{2+} , K^+ , Na^+ , NH_4^+) and anions (SO_4^{2-} , Cl^- , NO_3^- , NO_2^- , PO_4^{3-}) were analysed by ion exchange chromatography (ICS-2500, Dionex Corp., CA, USA). Dissolved organic carbon (DOC) and total dissolved nitrogen (TDN) were determined using a HiPerTOC carbon analyser plumbed to an HIPER5000 Total Nitrogen chemoluminescent detector (Thermo Electron Corp., Delft, The Netherlands). Prior to analysis of DOC, inorganic carbon was removed with the addition of 1M hydrochloric acid. Groundwater chemistry data of the chalk aquifer were obtained from an EA borehole within the Glaven catchment, located approximately 2 km from the study site at Edgefield ($52^\circ 52' 49.36''$ N, $01^\circ 05' 52.91''$ E) (Fig. 1). The borehole was used to monitor water levels and chemistry in the chalk strata, and had a response zone of 38–41 m b.g.s. The data obtained from the EA borehole are assumed to be representative of the groundwater chemistry of the chalk underlying the study site. This is reasonable considering the close proximity of the EA borehole to the study site, and that the chalk is laterally continuous across the region (Fig. 2). Hence, throughout this paper, these borehole data refer to the regional groundwater.

Soil chemistry

To determine the soil fertility of Hunworth Meadow, floodplain soil samples were collected in April 2008 along the three well transects at depths of 10–20 cm ($n = 12$). Soil samples were stored in a cooler with ice until return to the laboratory, where

they were frozen pending analysis. In the laboratory, plant available nutrients were determined using standard extraction methods. For analysis of nitrate and ammonium, 100 ml of 1M potassium chloride was added to 10 g of soil (Robertson *et al.* 1999). Potassium, calcium, magnesium, sodium, aluminium and iron were extracted using 100 ml of 1M ammonium acetate solution added to 10 g soil (Hendershot *et al.* 2008). For analysis of total organic carbon (TOC), 100 ml of deionised water was added to 10 g of soil (method amended from Robertson *et al.* 1999). Phosphate was analysed using the Olsen *et al.* (1954) sodium bicarbonate extraction method (Schoenau and O'Halloran 2008).

The percentage moisture content was determined for each soil sample by drying triplicate 10-g subsamples of sieved field-moist soil at 105°C overnight (Robertson *et al.* 1999). This allowed the respective ion concentration for each extract to be corrected for dilution. Inorganic nitrogen species (NO_3^- , NO_2^- and NH_4^+) and phosphorus were analysed colorimetrically using an automated continuous flow analyser (SAN++, SKALAR, Delft, The Netherlands) following the standard San++ methods for preparation of reagents. Elemental metal analysis (K^+ , Ca^{2+} , Mg^{2+} , Na^+ , Al^+ , Fe^{3+}) was conducted using a Vista-PRO inductively coupled plasma optical emission spectrometer (ICP-OES) with a SPS3 autosampler (Varian, Eindhoven, The Netherlands). Total organic carbon was determined using a HiPerTOC carbon analyser (Thermo Electron Corp., Delft, The Netherlands). Exchangeable ions and TOC are expressed as element mass per dry mass of soil.

River and floodplain topography

Surface elevation of the meadow, river channel and, before their removal, the embankments were surveyed using a differential Global Positioning System (dGPS) (Leica Geosystems SR530 base station receiver and Series 1200 rover receiver, Milton Keynes, UK) in April 2008 prior to the restoration, and in July 2009 after the restoration. Each survey was conducted using the survey pole in static mode, which resulted in a 3D coordinate quality of 1–2 cm. The meadow was surveyed at intervals of approximately 10 m, whereas the river embankments and cross-sections were surveyed at a higher resolution using intervals of approximately 0.25–0.5 m. River channel cross-sections were surveyed at 32 transects along the study reach prior to the restoration and at 23 transects after the restoration. Digital elevation

models (DEMs) were created in ArcGIS using the kriging interpolation method, which estimates values from a statistically weighted average of nearby sample points (de Smith *et al.* 2007).

Bankfull capacity and the effects of aquatic macrophytes on river flows

The effects of embankment removal on the frequency of over-bank inundation were evaluated by estimating the change in bankfull capacity. A field-based method was used to relate bankfull elevation, measured before and after embankment removal using dGPS, to a stage board installed adjacent to the downstream well transect. Bankfull discharge was then predicted using a regression relationship between river stage in the Hunworth Meadows reach and discharge at the EA gauging station upstream of the meadows and approximately 0.3 km above the stage board (Figs 1 and 4). This method assumes that groundwater exchanges and runoff inputs do not significantly affect river discharge between the gauging station and stage board, which is reasonable considering their close proximity.

The regression relationship between river stage and discharge for spring/summer (April–September) follows a slightly lower trajectory than that for autumn/winter (October–March) ($p < 0.05$, $F = 35.41$) (Fig. 4). This can be attributed to the extensive growth of aquatic macrophytes, such as *Apium nodiflorum*, *Phalaris arundinaceae* and *Rorippa nasturtium-aquaticum*, within the channel

during the growing season. Seasonal in-stream vegetation growth can have a significant effect on the fluvial dynamics of streams by modifying flow velocities and sedimentation rates (Champion and Tanner 2000, Clarke 2002), resulting in a reduction in channel capacity during spring and summer. However, the effects are often diminished at high flows due to compression of the macrophyte stems, or even devegetation, which can substantially reduce flooding potential (Chambers *et al.* 1991, Wilcock *et al.* 1999, Champion and Tanner 2000). For example, Chambers *et al.* (1991) reported that, in slow-flowing rivers in western Canada, macrophyte biomass decreased with increasing flow velocities over a mean range of 0.2–0.7 m s⁻¹, with aquatic macrophytes typically absent at velocities above 1 m s⁻¹.

Macrophyte abundance on the River Glaven was observed to be substantially lower during high-flow summers (mean flow: 0.38 m³ s⁻¹) compared with low-flow summers (mean flow: 0.19 m³ s⁻¹), possibly due to devegetation at higher flows. As spring/summer river stage was only measured during periods of low river flows (0.15–0.24 m³ s⁻¹) (Fig. 4), and the effects of macrophyte abundance is likely reduced during high flow conditions, the spring/summer regression equation was not used to determine bankfull capacity. Instead, bankfull capacity was calculated using the autumn/winter regression equation (Fig. 4), which encompasses river stage measurements for a wider range of flows (0.25–1.9 m³ s⁻¹) during low macrophyte abundance.

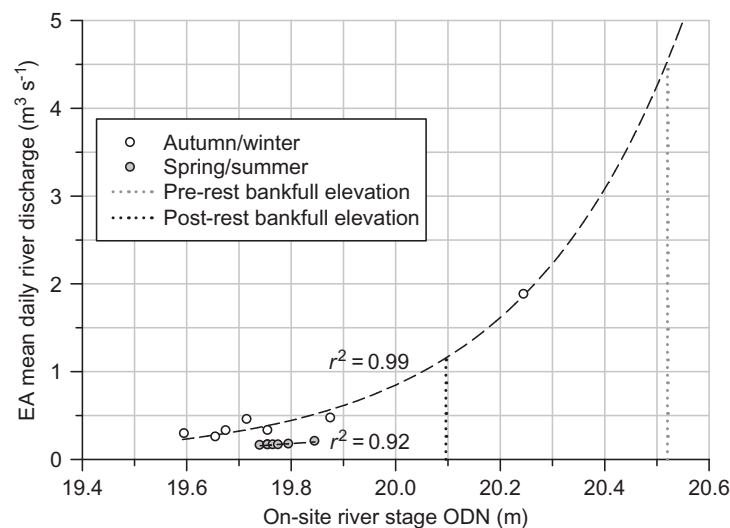


Fig. 4 Relationship between on-site river stage Ordnance Datum Newlyn (ODN) and mean daily river discharge used to determine bankfull capacity. Lines indicate statistically significant regression at $p < 0.05$, $y_{\text{autumn/winter}} = 7.6795 \times 10^{-29} e^{3.2285x}$, $y_{\text{spring/summer}} = 0.415x - 8.0379$.

Bankfull discharge was also determined by a semi-empirical method using the Manning's equation for uniform flow:

$$Q = \frac{1}{n} AR^{2/3} S^{1/3} \quad (5)$$

where Q is discharge ($\text{m}^3 \text{s}^{-1}$); n is Manning's roughness coefficient; A is bankfull cross-sectional area (m^2); R is hydraulic radius (m); and S is water surface slope (m/m) (Gordon *et al.* 2004). The value of Manning's n was estimated using the Rosgen (1996, 2007) stream classification method. This required the following river morphology parameters: bankfull width-to-depth ratio, entrenchment ratio (flood-prone width at $2 \times$ bankfull depth/bankfull width), water surface slope and channel sinuosity, which were obtained from dGPS-derived river channel cross-sections and measurements of river channel length in ArcGIS. The River Glaven most closely fits Rosgen type C4 or C5 streams, which correspond to average bankfull Manning's n values of approximately 0.04 and 0.056, respectively (Rosgen 2007). A range of bankfull discharge estimates were calculated by holding all other terms constant and varying Manning's n only between the two extremes of 0.04 and 0.056. The Manning's bankfull estimates were subsequently compared with the bankfull stage–discharge estimates.

Recurrence interval (return period in years) of bankfull discharge was computed using flood peaks over threshold (POT) data, which were extracted from discharge data measured at the on-site EA gauging station from 2001 to 2010. Discharge data were arranged into water years beginning on 1 October, and the threshold value was set at $0.6 \text{ m}^3 \text{ s}^{-1}$ so that, on average, five independent peaks per year were included in the series (Institute of Hydrology 1999, Cunderlik and Burn 2001). Aquatic macrophytes caused breaks in the river discharge record during some years; however, these years were included in the analysis where: (a) the gaps did not constitute a major portion of the record, and (b) precipitation data was available to confirm that large flood peaks were unlikely to have been missed.

Statistical analysis

Linear regression was used to evaluate relationships between river stage and mean daily river discharge for summer and winter periods. To test whether the summer and winter relationships differed, a full

and reduced F -test comparison was used. One-way analysis of variance (ANOVA) in combination with Tukey's *post hoc* tests was used to test for significant ($p < 0.05$) differences in groundwater chemistry along well transects. To meet the required assumptions for statistical inference, all data were tested for linearity, constant variance and normality. Regressions and diagnostics were computed using SAS 9.2 statistical software for Windows (SAS Institute Inc., North Carolina, USA), and Sigma Plot 10.0 (Systat Software Inc., London, UK).

RESULTS

River embankments

Prior to the restoration, the River Glaven was constrained by embankments that ranged from 0.4 to 1.1 m (mean = 0.6 m) above the meadow surface (Figs 5(a) and 6). The width and depth of the channel was fairly uniform along its length (Figs 5(a) and 6), indicative of a channelized and deepened river. Before restoration, channel depth (river bed to bank top) averaged 1.4 ± 0.1 m along the study reach. After the removal of the embankments, channel depth was reduced by approximately 44%, averaging 0.8 ± 0.1 m along the study reach (Fig. 6), and riverside elevation approximated that of the adjacent floodplain (Fig. 5(b)). Embankment removal reduced channel cross-sectional area by approximately 51%, from a mean of $6.5 \pm 0.6 \text{ m}^2$ to $3.2 \pm 0.7 \text{ m}^2$ along the study reach. Surface elevation on Hunworth Meadow is below river bankfull elevation and decreases with distance from the river, with the exception of a few local highs (Fig. 5(a) and (b)).

The restoration work was restricted to the removal of the river embankments and did not involve mechanical work in the channel. However, during the excavation of the embankments, some sediment was inadvertently dropped into the river and likely accumulated in the lower part of the study reach or further downstream. As a result, some reshaping and modification of the river bed geomorphology was evident immediately following the restoration (see river cross-section in Fig. 7).

Climate and hydrology

The mean River Glaven baseflow index (BFI) was 0.81 (range: 0.75–0.88), and Q95 (expressed as % of mean annual flow) was 51%, indicating high groundwater contributions to discharge (Table 1).

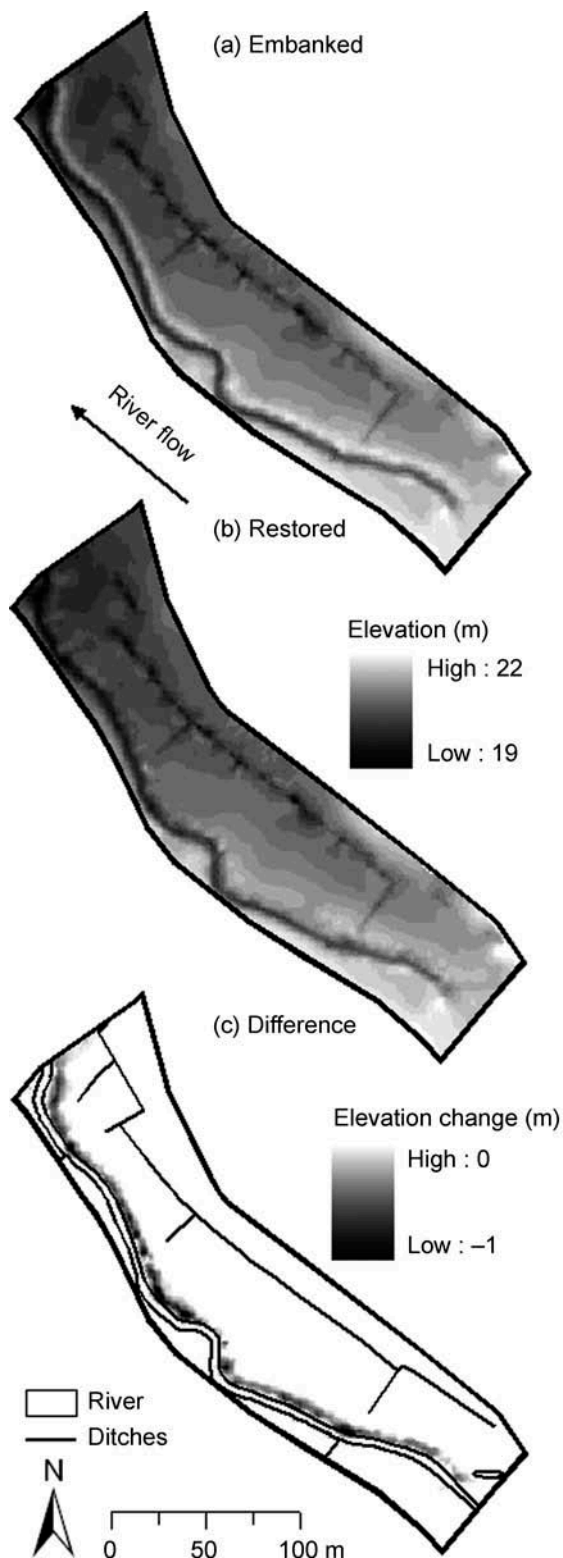


Fig. 5 Elevation of Hunworth Meadow study site showing (a) before and (b) after embankment removal, and (c) the difference in elevation. The DEMs were created using dGPS survey data collected in (a) June 2008 and (b) July 2009.

This is typical of permeable chalk streams, which average 0.83 BFI (range: 0.53–0.99) and >30% Q95 (Gustard *et al.* 1992, Sear *et al.* 1999). River flow at the study site, in general, followed the characteristic annual hydrograph of a chalk stream, with increased discharge over the winter from early December until March. However, some of the highest recorded river flows occurred during the summer (Fig. 3(a)).

Precipitation had a distinct effect on river discharge, with flood peaks coinciding with precipitation events (Fig. 3(a)). River response to precipitation was rapid, typically within one day, although some events characterised by low intensity rainfall, prolonged over a few days, resulted in a muted stream flow response (Fig. 3(a)). Similarly, groundwater elevation on the floodplain responded rapidly (<1 day) to precipitation and changing river levels, resulting in prolonged saturation of surface soils during winter/spring (November–April), with periodic saturation in summer/autumn (May–October) (Fig. 3(b)).

The period of observation prior to the restoration (2007–2008) was characterised by cooler, wetter spring/summers (Fig. 3(a) and Table 2). Summer (June–September) precipitation in 2007 and 2008 totalled 393 and 281 mm, respectively and exceeded potential evapotranspiration, which totalled 248 and 262 mm, respectively (Table 2). Summer precipitation in 2007 was highest of the four-year study period, which resulted in a shallow water table within 10 cm of the ground surface for much of the growing season between March and September (Fig. 3(b)). In comparison, water table elevations in 2008 were typically within 10 cm of the ground surface between March and May, due to a period of prolonged precipitation and high river discharge (Fig. 3(a) and (b)), and were slightly lower during the summer, averaging 33 cm below the ground surface (Fig. 3(a) and (b)).

Contrary to 2007 and 2008, the summers after the restoration were warm and dry, with total precipitation of 178 and 261 mm in 2009 and 2010, respectively. Furthermore, potential evapotranspiration was 10–19% higher, and exceeded total precipitation (Table 2). Collectively, this led to mean summer water table depths of 57 and 59 cm b.g.s. in 2009 and 2010, respectively (Fig. 3(b)). Summer river hydrographs were very similar in 2008, 2009 and 2010, all with a steady decline in discharge from May to August (Fig. 3(a)), and mean summer discharge of approx. $0.2 \text{ m}^3 \text{ s}^{-1}$ (Table 2). However, whereas summer water table height differed by less than 4 cm on

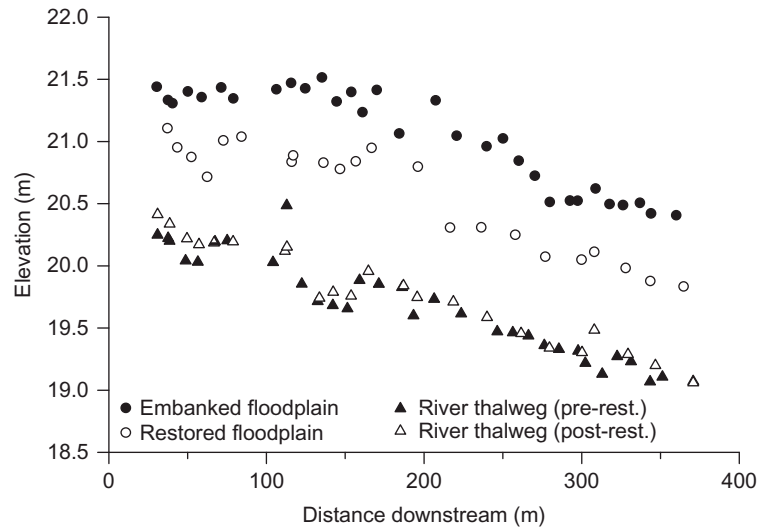


Fig. 6 Comparison of floodplain elevation adjacent to the river channel along the study reach before (embanked) and after (restored) embankment removal. The embanked floodplain data represent the highest point on the embankments, and the restored floodplain data represent the closest corresponding sample location after embankment removal. The river thalweg (pre- and post-restoration) is also plotted with distance downstream.

average between 2009 and 2010, water table height was on average 13–17 cm higher in 2008 compared to 2009 and 2010 (Fig. 3(b)).

Figure 7 shows groundwater levels on the floodplain during three different river flow conditions; high flow in autumn (October 2008), low flow in spring (March 2009) and low flow in summer (June 2008). The hydraulic gradient across the floodplain is relatively flat, averaging 6.1–9.4 mm m⁻¹ (Table 3). Groundwater levels at the upstream transect indicate complex movements of groundwater, with shifts in hydraulic gradient observed between periods of different river flow. In general, at the upstream and midstream transect, groundwater levels decreased from the river towards the ditch, which was located at the lowest point of the floodplain (Fig. 7(a) and (b)). This was most apparent at the midstream well transect, where the river thalweg was above the ditch thalweg (Fig. 7(b)). Convergence of floodplain and hillslope flowpaths in the region of the ditch would explain the saturation of surface soils in this area of the floodplain. Conversely, at the downstream transect, where the topography flattens, groundwater levels tended to flow from the base of the hillslope towards the river (Fig. 7(c)).

Groundwater levels measured in wells next to the river (wells 3.1 and 1.1) were not always lower than river stage, indicating temporal changes in hydraulic gradient (Fig. 7(a) and (c)). During peak discharge conditions, river stage was above the water table in the floodplain and flow was directed away from the

river and into the floodplain, creating a bank storage ridge (Figs 7(c) and 8). A streamward hydraulic gradient was re-established after the flood peak had passed (Fig. 8(c)). During low river stage in winter, groundwater levels on the floodplain were above that of the river (Fig. 7(a) and (b)). Conversely, during dry summers, when groundwater levels were typically low in the soil profile, river stage was often slightly above groundwater levels (Fig. 7).

Soil physical and chemical properties

Hunworth Meadow soils are predominantly sandy loams and slightly acidic (mean pH: 6.3–6.5). Soils were high in calcium, with an average of 1.7–2.7 mg Ca²⁺ g⁻¹ (Table 4), and moderately fertile, with Olsen P concentrations of 6.2–9.5 mg P kg⁻¹ on average, and mean plant available potassium concentrations of 1.0–2.8 mg K⁺ g⁻¹ (Table 4). Plant available ammonium concentration (average: 12.8–32.3 mg NH₄⁺-N kg⁻¹) was 11–26 times greater than nitrate concentration (average: 0.5–3.0 mg NO₃⁻-N kg⁻¹) (Table 4).

Topsoil (approx. 0–30 cm) on the meadow was moderately organic (range: 13–35% organic matter content; Table 4), with the highest organic matter content recorded in the wetter parts of the meadow. The sandy loam soils were underlain by alluvial gravels at depths of 0.8–2 m. The majority of hydraulic conductivity measurements ranged between 0.98 and 7.72 cm d⁻¹. However, due to

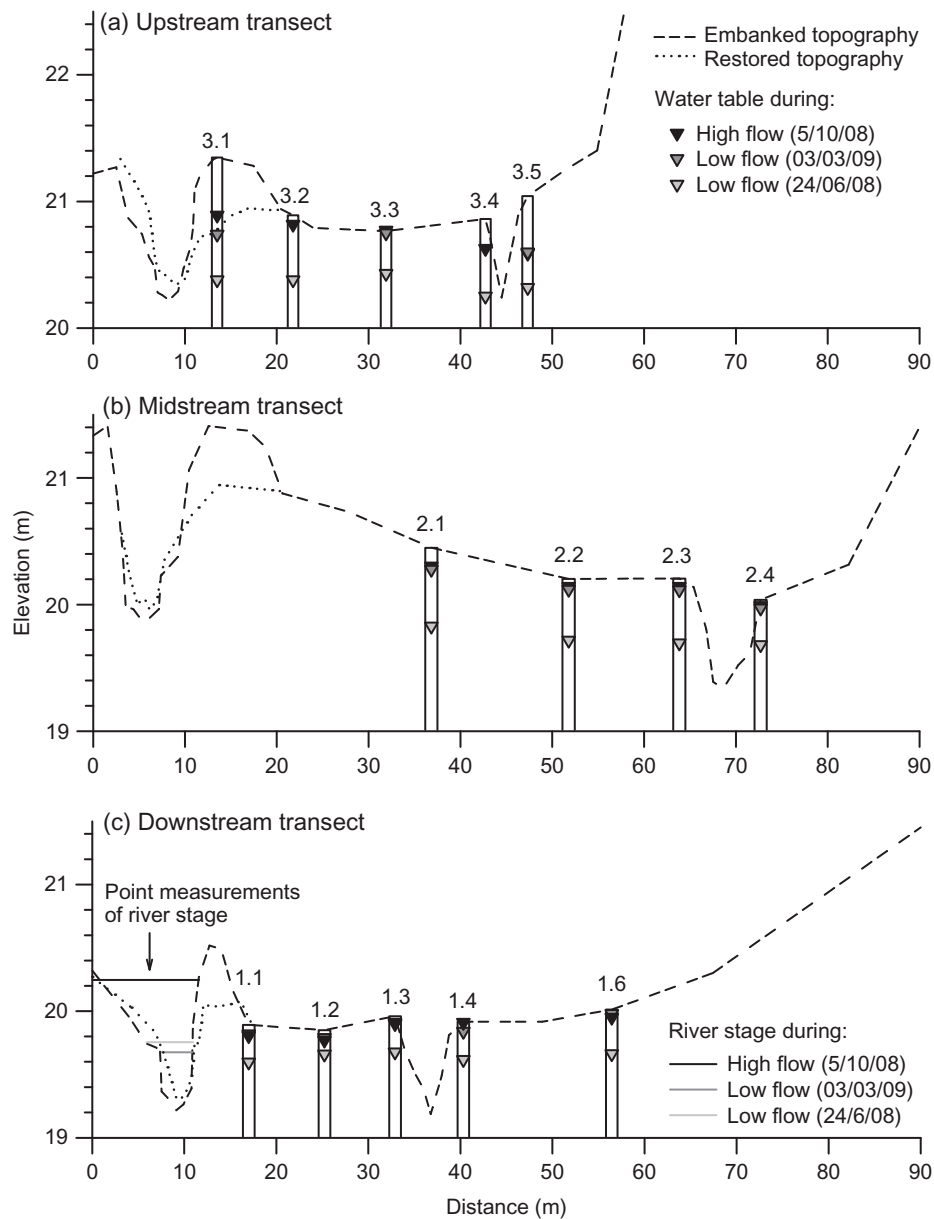


Fig. 7 Cross-sections of the meadow and river channel before (embanked) and after (restored) embankment removal. Typical mean well water levels are shown along the three transects in relation to low and high river stage. River stage measurements at the downstream transect are single point measurements.

Table 1 Mean annual river flow (range), Q10, Q95, and Q95 (as % of mean annual flow) using river discharge data from 2001–2010. Mean baseflow index (BFI) (range) using continuous river discharge data for 2007, 2008, and 2010.

Mean annual river discharge		Mean baseflow index		Q10 ($\text{m}^3 \text{s}^{-1}$)	Q95 ($\text{m}^3 \text{s}^{-1}$)	Q95 (as % mean annual flow)
($\text{m}^3 \text{s}^{-1}$)	Range	BFI	Range			
0.28	0.1–3.1	0.81	0.75–0.88	0.42	0.14	51.06

Table 2 Summer (June–September) mean ($\pm 95\%$ confidence interval) air temperature, total precipitation, total potential evapotranspiration, and mean annual river discharge ($\pm 95\%$ confidence interval).

Year	Temperature (°C)	Precipitation (mm)	Evapotranspiration (mm)	River discharge ($\text{m}^3 \text{s}^{-1}$)
2007	15.1 ± 0.3	393	248	0.38 ± 0.05
2008	15.3 ± 0.5	281	262	0.19 ± 0.01
2009	15.6 ± 0.4	178	286	$0.24 \pm 0.01^*$
2010	15.7 ± 0.5	261	295	0.19 ± 0.01

Note: *2009 mean river discharge is for 303 days.

Table 3 Hydraulic gradient, hydraulic conductivity and groundwater flow rate (mean $\pm 95\%$ confidence interval) for the upstream, midstream and downstream well transects.

Transect	Hydraulic gradient ($\delta h/\delta l$)	Hydraulic conductivity (cm d^{-1})	Groundwater flow rate (cm d^{-1})
Upstream	0.0094 ± 0.0033	17.87 ± 28.17 ($n = 4$)	0.29 ± 0.06
Midstream	0.0067 ± 0.0042	3.04 ($n = 1$)	0.03 ± 0.02
Downstream	0.0061 ± 0.0057	14.23 ± 20.93 ($n = 4$)	0.13 ± 0.15

some higher conductivity measurements, the average was $16.3 \pm 17.2 \text{ cm d}^{-1}$ (Table 3). Hydraulic conductivity measurements were relatively low, with measured rates of the order expected for silt/loess soils (see Domenico and Schwartz 1998). Such low values suggest slow hydrological exchange between the floodplain soils and river water, which is likely responsible for the poor onsite drainage and ponding of water that occurred at the downstream end of the meadow. The hydraulic conductivity of the underlying alluvial gravels on the floodplain could not be measured, but are likely to be substantially higher than the values measured in the top 2 m of sandy loam floodplain soil.

Bankfull capacity

Generally good agreement was obtained between the bankfull stage–discharge estimates and the Manning’s equation estimates for pre- and post-restoration bankfull discharge (Table 5). Bankfull capacity of the embanked river channel using the first of these methods was predicted to be $4.53 \text{ m}^3 \text{ s}^{-1}$ (Table 5 and Fig. 9). Flows above this threshold did not occur at all during the period of record of the EA gauging station (2001–2010). Similarly, the lowest of the bankfull discharge estimates using the Manning’s equation ($4.09 \text{ m}^3 \text{ s}^{-1}$) was not exceeded within the discharge record, confirming that over-bank flow onto the floodplain was infrequent (at least >10 -year intervals) (Fig. 9).

Following the removal of the embankments, bankfull capacity (evaluated using the

stage–discharge method) was reduced by 75% to $1.15 \text{ m}^3 \text{ s}^{-1}$. River discharge exceeded this bankfull threshold during one short (1-day) high-flow event in February 2010 that averaged $1.36 \text{ m}^3 \text{ s}^{-1}$ (Fig. 9). Historical river discharge data from before the restoration indicate that flows of this magnitude are fairly regular. For instance, from 2001 to 2010, river discharge was above the $1.15 \text{ m}^3 \text{ s}^{-1}$ post-restoration bankfull capacity during a minimum of 14 high-flow events, the majority of which (11 out of the 14 recorded) occurred during summer and autumn (Fig. 9). These were of short duration (1 day); and were typically separated by large time intervals, with the exception of a high river discharge period in May–June 2007, when successive high flows were above bankfull capacity within 10–18 days (Fig. 9). The post-restoration bankfull recurrence interval was predicted to be 0.8 years, on average (Table 5). A further indication that embankment removal will result in reconnection of the river and floodplain via over-bank flows is given in Fig. 7(c), which shows river stage in autumn 2008 above the restored bankfull elevation of 20.096 m (Table 5).

Groundwater response to embankment removal

After the removal of the embankments, groundwater levels at wells 3.1 and 1.1, which were located at the river–floodplain interface, generally remained higher than those within wells further from the river (Fig. 8(a) and (c)) for much of the post-removal period. This was particularly evident during the dry summer

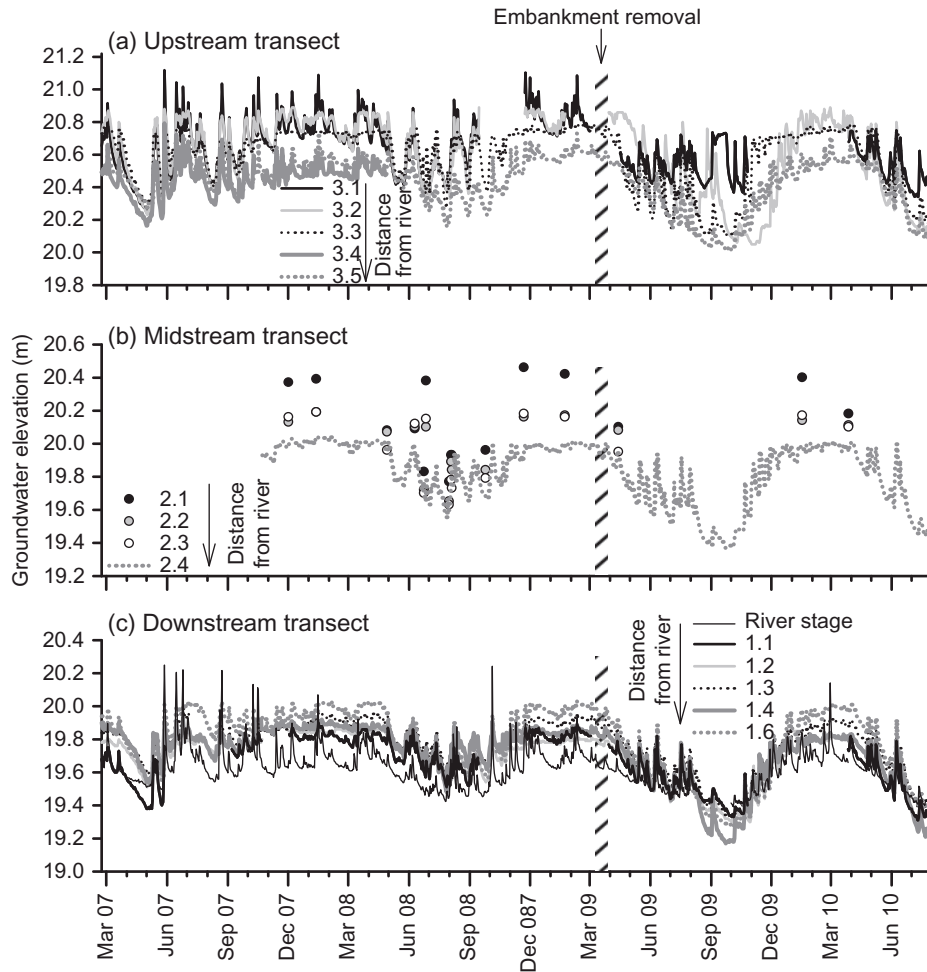


Fig. 8 Temporal variation in mean daily groundwater height above Ordnance Datum Newlyn (ODN). Well 3.1 (a) was located on the river embankment; wells 3.5 (a), 2.4 (b) and 1.6 (c) were located at the base of the hillslope (see Fig. 1). Continuous measurements of groundwater height were not available for all of the wells at the midstream transect, hence, hand measurements are also plotted (circles). River stage is plotted at the downstream transect (c).

Table 4 Soil chemistry of Hunworth Meadow along the three well transects (mean \pm 95% confidence interval). Soils were sampled in April 2008.

	Upstream transect	Midstream transect	Downstream transect
pH	6.34 \pm 0.45	6.49 \pm 0.74	6.51 \pm 0.13
Organic matter content (%)	12.16 \pm 2.62	10.98 \pm 2.14	15.38 \pm 10.37
Bulk density (g m^{-3})	0.71 \pm 0.07	0.75 \pm 0.00	0.50 \pm 0.23
Ca ²⁺ (mg g^{-1} dry soil)	2.70 \pm 0.73	1.87 \pm 1.08	1.66 \pm 0.93
Na ⁺ (mg g^{-1} dry soil)	0.12 \pm 0.09	0.08 \pm 0.04	0.04 \pm 0.02
Mg ⁺ (mg g^{-1} dry soil)	0.09 \pm 0.06	0.14 \pm 0.09	0.10 \pm 0.07
K ⁺ (mg g^{-1} dry soil)	0.96 \pm 0.39	2.81 \pm 1.36	1.25 \pm 1.19
Total iron (mg kg^{-1} dry soil)	16.50 \pm 1.91	38.84 \pm 54.78	66.90 \pm 69.95
Al ³⁺ (mg kg^{-1} dry soil)	6.49 \pm 2.02	9.99 \pm 8.94	6.14 \pm 0.85
NH ₄ ⁺ (mg N kg^{-1} dry soil)	25.31 \pm 9.99	12.81 \pm 16.48	32.33 \pm 13.21
NO ₃ ⁻ (mg N kg^{-1} dry soil)	2.96 \pm 3.41	0.47 \pm 0.92	2.22 \pm 22.36
Olsen P (mg P kg^{-1} dry soil)	7.12 \pm 4.97	6.18 \pm 3.76	9.49 \pm 3.58
TOC (mg kg^{-1} dry soil)	0.57 \pm 0.14	0.58 \pm 0.50	0.92 \pm 1.14
TN (%)	0.51 \pm 0.19	0.44 \pm 0.16	0.58 \pm 0.44
TC (%)	5.89 \pm 2.33	5.56 \pm 2.38	6.94 \pm 4.62

Table 5 Bankfull height above ODN, bankfull river discharge from the river stage–discharge relationship, and calculated using Manning’s equation, and bankfull recurrence interval (not estimated for the pre-restoration bankfull discharge due to the high uncertainty associated with extrapolating beyond the range of data).

Transect	Bankfull elevation ODN (m)	Bankfull discharge ($\text{m}^3 \text{s}^{-1}$)		Bankfull recurrence interval (years)
		Stage–discharge	Manning’s equation	
Pre-restoration	20.520	4.53	4.09–5.73	N/A
Post-restoration	20.096	1.15	1.33–1.87	0.83

Note: ODN: Ordnance Datum Newlyn.

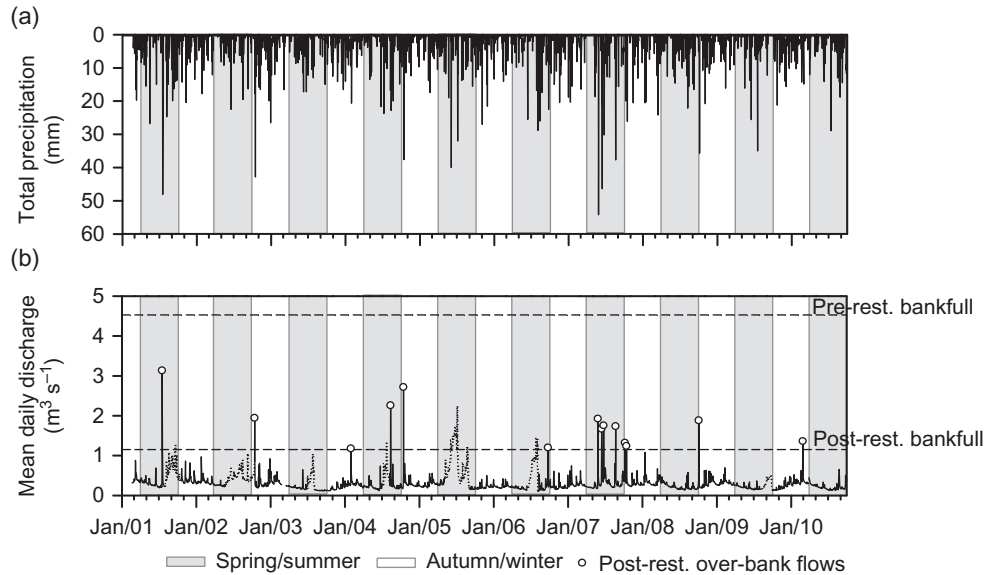


Fig. 9 Time series of (a) total precipitation, and (b) mean daily river discharge from 2001 to 2010. Pre- and post-restoration bankfull capacity at the downstream river stage is shown in (b), above which inundation of the floodplain would have occurred. River discharge data affected by aquatic macrophyte growth have been highlighted with dotted lines and were not included in the analysis of bankfull discharge.

2009 (Fig. 8(a) and (c)). In contrast to the observations close to the river, water levels in all the other wells were approximately 10–60 cm lower during the summers following the restoration (Fig. 8(a)–(c)). Winter water table elevations remained unchanged following the restoration (Fig. 8(a)–(c)), with water levels within 10 cm of the soil surface in all wells. Furthermore, embankment removal lowered the soil elevation to within 0–50 cm of the water table at Well 3.1. This resulted in increased saturation of surface soils on the restored river banks for much of the summer in 2009 and 2010 (winter 2009 data not available), which is likely to have important effects on soil physicochemistry in this region of the floodplain.

Hydrological controls on chemistry


Groundwater (in the floodplain wells and chalk borehole) and river water cation chemistry were dominated by calcium (Table 6). Anion chemistry

followed the pattern of $\text{Cl}^- > \text{SO}_4^{2-} > \text{NO}_3^-$. River water and regional groundwater (sampled in the chalk borehole) was slightly alkaline (mean pH: 7.3 and 7.4, respectively) (Table 6). In contrast, the floodplain well water was slightly acidic (mean pH: 6.5–6.7), potentially due to the sandy loam soil which overlies the chalk bedrock. The percentage composition of base cations in the floodplain well samples was mostly between the two main potential water sources: groundwater that was strongly dominated by calcium ions and river water that was characterised by higher levels of sodium ions (Table 4). However, differences in concentration between end members were quite small, particularly during baseflow conditions when a groundwater signature was evident in the river water. Hence, further analysis using an end-member mixing model was not considered appropriate.

Conservative solutes such as calcium, sodium and chloride, varied spatially along each well transect. However, there was no obvious pattern with distance

Table 6 Chemistry of the River Glaven and Hunworth Meadow groundwater wells from 2007–2008 and EA borehole from 2007–2010 (mean \pm 95% confidence interval).

	River	Transect Upstream	Midstream	Downstream	EA borehole
pH <i>in situ</i>	7.3 \pm 0.5	6.6 \pm 0.1	6.7 \pm 0.2	6.5 \pm 0.1	7.4 \pm 0.2
Conductivity ($\mu\text{s cm}^{-1}$)	953 \pm 213	676 \pm 130	775 \pm 767	812 \pm 111	519 \pm 50
Ca ²⁺ (mg L ⁻¹)	95.8 \pm 12.4	113 \pm 81	71.2 \pm 28.2	102.6 \pm 11.5	89.7 \pm 4.8
Na ⁺ (mg L ⁻¹)	25.6 \pm 5.1	13.7 \pm 3.2	24.8 \pm 10.5	17.6 \pm 1.3	16.1 \pm 0.2
Mg ⁺ (mg L ⁻¹)	5.0 \pm 0.8	3.5 \pm 0.6	5.2 \pm 2.2	4.3 \pm 0.5	5.5 \pm 0.3
K ⁺ (mg L ⁻¹)	2.6 \pm 0.4	1.0 \pm 0.7	5.5 \pm 3.0	1.9 \pm 1.0	1.8 \pm 0.1
NH ₄ ⁺ (mg N L ⁻¹)	0.6 \pm 0.1	0.8 \pm 0.3	0.6 \pm 0.3	0.5 \pm 0.1	0.0 \pm 0.0
Cl ⁻ (mg L ⁻¹)	45.4 \pm 1.0	33.9 \pm 3.7	48.6 \pm 23.0	27.5 \pm 5.3	31.7 \pm 2.5
SO ₄ ⁻ (mg S L ⁻¹)	16.1 \pm 1.4	10.2 \pm 4.2	11.2 \pm 5.9	4.8 \pm 1.5	14.6 \pm 3.4
NO ₃ ⁻ (mg N L ⁻¹)	6.2 \pm 0.5	0.2 \pm 0.1	0.4 \pm 0.4	0.1 \pm 0.03	0.2 \pm 0.0
TDN (mg L ⁻¹)	5.5 \pm 4.5	3.3 \pm 0.6	4.7 \pm 1.4	2.6 \pm 0.6	No data
DOC (mg L ⁻¹)	10.8 \pm 2.3	33.8 \pm 6.0	46.1 \pm 7.6	32.7 \pm 6.8	0.8 \pm 0.2
DO (mg L ⁻¹)	10.8 \pm 0.4	0.4 \pm 0.2	1.0 \pm 0.8	0.5 \pm 0.3	1.4 \pm 0.8

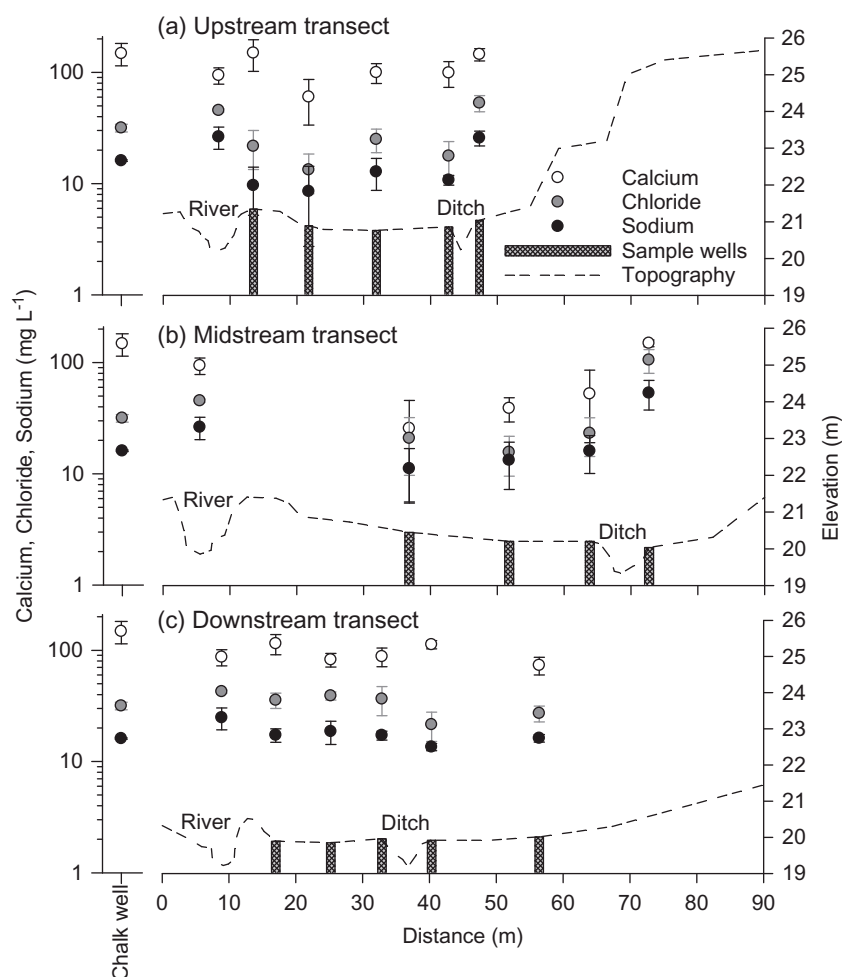**Fig. 10** Spatial variation of selected ions (mean \pm 95% confidence interval; log scale) along subsurface flowpaths at the upstream, midstream and downstream well transects for 2007–2008. Pre-restoration topography is plotted to identify the sample locations in relation to the river and hillslope.

from the river (Fig. 10). One exception was the chemistry in wells 2.4 and 3.5, located at the base of the woodland hillslope (Fig. 10(a) and (b)), which

was markedly different from other wells on the meadow. Chloride and sodium concentrations in these two wells were, respectively, on average between

1.7–4.2 and 1.8–3.8 times greater than average concentrations in the floodplain wells (Fig. 10(a) and (c)), which could indicate the provision of water to this part of the floodplain from hillslope through-flow. Chloride and sodium chemistry of wells located close to the river (within 10 m) was closer in concentration to regional groundwater chemistry than that of the river, possibly due to limited hydrological exchange between river water and groundwater on the floodplain.

Dissolved oxygen and nitrate concentrations in river water were, respectively, approximately 18- and 14-fold greater than the concentrations in groundwater wells on the meadow ($p < 0.05$) (Fig. 11). Groundwater in these wells was consistently depleted in DO (mean: $0.6 \text{ mg O}_2 \text{ L}^{-1}$) and nitrate (mean: $0.21 \text{ mg NO}_3^- \text{ N L}^{-1}$) relative to river

water (mean: $10.8 \text{ mg O}_2 \text{ L}^{-1}$ and $6.2 \text{ mg NO}_3^- \text{ N L}^{-1}$, respectively) ($p < 0.05$), and exhibited little change with distance from the river. However, nitrate concentrations at Well 3.1, which was located on the embankment, showed greater variation than that of other wells on the floodplain, possibly indicating greater connectivity with river water (Fig. 11(a)). Dissolved organic carbon, in contrast, was significantly ($p < 0.05$) higher in the floodplain wells (mean at different wells between 33 and 46 mg L^{-1}) than in river water (mean: 11 mg L^{-1}) (Table 6), likely due to the presence of organic matter on the floodplain.

Dissolved oxygen concentration in surface soils (top 10–30 cm) was strongly coupled with water table height (Fig. 12(b) and (c)). As groundwater rose vertically through the soil profile and surface soils became saturated, DO concentration decreased

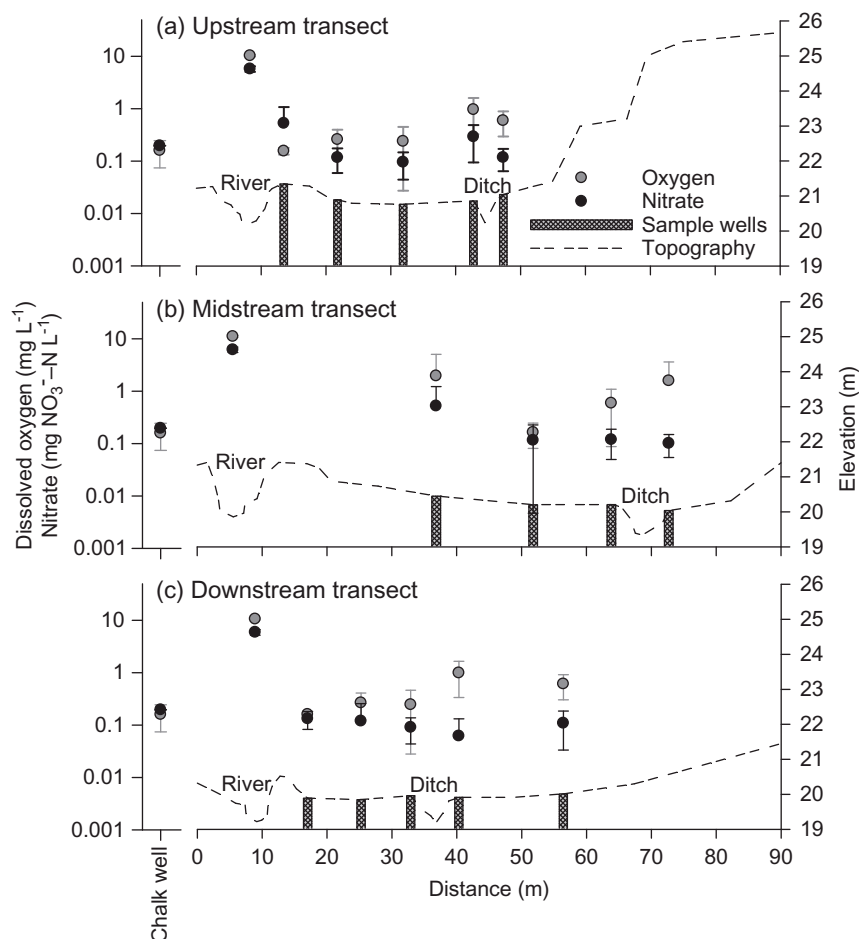


Fig. 11 Nitrate and DO concentrations (mean \pm 95% confidence interval; log scale) in river water and groundwater along subsurface flowpaths at the upstream, midstream and downstream well transects for 2007–2008. Concentrations in the EA borehole (instrumented in the chalk) are also shown. Pre-restoration topography is plotted to identify the sample locations in relation to the river and hillslope.

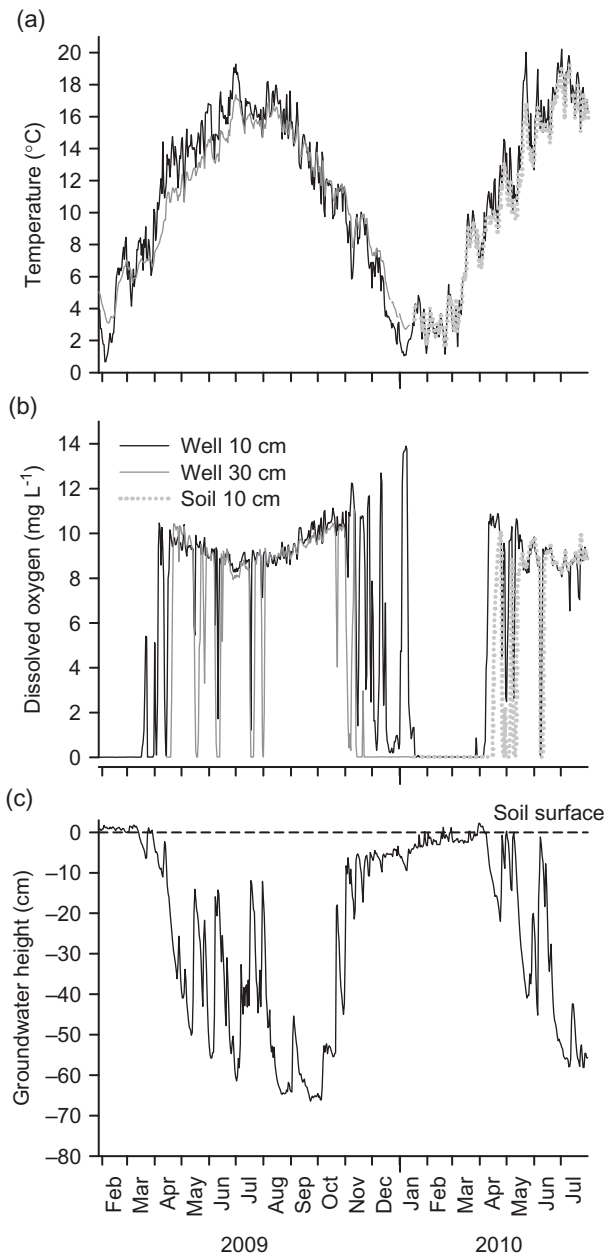


Fig. 12 Temporal variation in (a) temperature and (b) DO concentration in well water and soil in relation to (c) changes in groundwater height. When groundwater height is below the respective oxygen optode installation height (10 and 30 cm; see text for details), optode data represent atmospheric temperature and saturated DO conditions.

rapidly within a day to 0–2 mg L⁻¹, indicating reduced conditions (Fig. 12(b)). As the water table height fell once again, DO concentration increased at a rate of about 0.8–1.4 mg L⁻¹ d⁻¹ to atmospheric saturation (Fig. 12(b)). Groundwater DO did not increase at any point during periods of high river flow and elevated water table, suggesting that oxygen-rich river water did not inundate (via over-bank flow) the

upstream area of the floodplain where the DO probes were located during the study period (Fig. 12(b)). This is further supported by site observations during high-flow events. Although Fig. 9 suggests that one over-bank flow event occurred following the embankment removal, the event was of short duration (≤ 1 day) and likely only inundated the downstream, relatively lower-lying section of the floodplain.

DISCUSSION

River–floodplain hydrological linkages

As ecosystems strongly influenced by disturbances linked to flooding, floodplains are widely thought to be important for mediating the flow of water, energy, matter and organisms between aquatic and terrestrial environments (Junk *et al.* 1989, Tockner and Stanford 2002, Naiman *et al.* 2005, Mitsch and Gosselink 2007). Functioning hydrological links are key for the numerous interstitial foodwebs (see Stanford and Ward 1993) and biogeochemical processes, such as aerobic respiration, nitrification, denitrification and methanogenesis, that occur in saturated sediments beneath and adjacent to rivers and streams (Jones and Holmes 1996). The reduction or absence of over-bank inundation and the associated flood-related natural disturbance regime have drastic effects on biological and chemical conditions on floodplains. For example, over-bank flooding is important for the deposition of nutrients and sediments, the control of dominant plant species and the transport of propagules, which leads to increased species richness and flood-water storage (Brunet *et al.* 1994, Ward and Stanford 1995, Silvertown *et al.* 1999, Bullock and Acreman 2003, Nilsson *et al.* 2010).

The embankments along the River Glaven represented a substantial barrier to river–floodplain interactions. Without over-bank flow, slow horizontal subsurface flow (< 0.4 cm d⁻¹) was the primary mechanism for the exchange of water, DO and nutrients between the river and floodplain. With such low-flow velocities, it would take approximately 1 year for a molecule of water to travel a distance of 1.5 m from the river towards the floodplain. During high river flows, when river stage was above groundwater elevation on the floodplain, there was a greater potential for lateral subsurface mixing of river and groundwater. However, considering the low subsurface flow rates, groundwater movement on the floodplain is likely to be dominated by the rapid (< 1 day) vertical transfer of deeper

nitrate-depleted groundwater through the soil profile that was observed in response to precipitation. This prompt groundwater response to precipitation input, despite low hydraulic conductivity, is a phenomenon that has been reported in many small catchments and is not well understood (Kirchner 2003, Cloke *et al.* 2006).

A similar study on a chalk river in the Berkshire Downs, UK, found that the majority of surface–subsurface hydrological exchange occurred a few tens of centimetres from the river bed, and was limited to within the gravel aquifer. The underlying chalk at the site was found to be hydraulically separate from the river (Allen *et al.* 2010). Throughout the River Glaven catchment, a chalk-rich boulder clay (Lowestoft Formation) underlies the alluvium and gravels (Moorlock *et al.* 2002); this formation is reported to be variably permeable, containing groundwater only when weathered, fractured or interspersed with sand and gravel horizons (BGS 2007). The presence of this less permeable layer at the site could restrict hydrological contact between the river and chalk bedrock. However, the chemical similarity between the floodplain wells and chalk well samples, and the high baseflow index and flow exceedence values for Q95, indicate substantial interaction with the chalk aquifer.

The alluvial and glaciogenic gravels that overlie the Lowestoft Formation are likely to have substantially higher hydraulic conductivity than the overlying alluvium. While this could provide a route for more substantial mixing between river and groundwater at depth, conservative ion chemistry in the wells has a groundwater signature. The higher nitrate concentration measured in Well 3.1, which is located next to the river, suggests some connectivity between the river and groundwater on the floodplain. In general though, there was a lack of spatial and temporal variation in the conservative ion chemistry of well water across the floodplain, indicating that even in a chalk setting there are regions of limited hyporheic extent. Over-bank inundation therefore represents the only potential mechanism for substantial surface water–groundwater connectivity.

Soils at Hunworth Meadow were of intermediate fertility (i.e. within the range of 5–15 mg kg⁻¹ Olsen extractable phosphorus specified by Gowing *et al.* 2002a), likely due to the cessation of fertilizer application at the site in 1997 and the absence of floodwater and river sediment inputs. Water flowing within the River Glaven is substantially richer in nitrate and DO relative to floodplain groundwater, and thus

represents a potential source of nutrients to floodplain vegetation and microbes. The large difference in nitrate and DO concentrations between river water and groundwater <2 m away from the channel indicate that a strong redox gradient is present at the river–floodplain interface. This part of the floodplain is likely to be an important zone for reducing nitrate concentrations (e.g. Dahm *et al.* 1998, Hedin *et al.* 1998, Clilverd *et al.* 2008).

Continuous measurements of DO concentration in floodplain soils, which to our knowledge have not been measured using DO optodes before, indicate a strong coupling between water-table fluctuations and anoxia in the rooting zone. Surface soils were anoxic for much of the winter, and periodically during wetter periods through the summer that were associated with high precipitation during within-bank high-flow events, implying reducing conditions for nitrate and other redox-sensitive solutes. Episodic inundation of the floodplain with nitrate-rich river water could likely serve as a pulse of nitrate to anaerobic microbes, leading to greater potential for nitrate removal via denitrification (see Fisher and Acreman 2004). Furthermore, during high river discharge on the River Glaven, groundwater flows through an organic topsoil. These conditions can result in the intersection of nitrate-rich river water with soil water that is rich in DOC, which often promotes further substantial denitrification (e.g. Hedin *et al.* 1998, Hill *et al.* 2000).

The removal of the river embankments at the study site sufficiently reduced the channel cross-sectional area, and thus bankfull capacity, to initiate over-bank inundation and reconnect the river with its floodplain. One over-bank event was observed during the period of study, and long-term river discharge data from before the restoration indicate that river flows will regularly exceed the restored bankfull capacity. Flood events will be of short duration, as bank-full capacity was typically exceeded for only one day, and they will often occur during the summer months when surface soils are dry and have a greater capacity for water storage, which is likely to maximise floodpeak attenuation (e.g. Burt *et al.* 2002). Flooding may also persist for even longer periods, depending on the infiltration and evapotranspiration rates, and the influence of in-river macrophyte growth during the summer. Increased frequency and duration of floodplain inundation due to embankment removal is consistent with other river restoration studies (e.g. Acreman *et al.* 2003, Helfield *et al.* 2007, Hammersmark *et al.* 2008) and is seen as one of the main aims of river restoration projects.

So far, an increase in the frequency of over-bank flooding is suggested to be the most dramatic hydrological effect following the restoration of the floodplain. Increased groundwater levels at the river–floodplain interface have also been observed, possibly due to enhanced river water intrusion. The most noticeable change in soil saturation in this region of the floodplain, however, was due to a lowering of the surface elevation relative to the water table height. This occurred along a 1–2 m strip where the embankments were previously located, and is likely to promote re-colonisation by wetland plant species that can tolerate periodic waterlogging and aeration stress in the rooting zone, particularly during the growing season (e.g. Silvertown *et al.* 1999, Barber *et al.* 2004, Wheeler *et al.* 2004). However, water levels in the rest of the floodplain were lower during the summers following the restoration. This could be a result of the prevailing low summer precipitation and high evapotranspiration rates in these years. The areal extent of inundation on the floodplain could potentially be far-reaching due to the low-lying elevation of the meadow in relation to the river; however, further analysis including the continuation of hydrological monitoring and the application of hydrological/hydraulic modelling (e.g. Thompson *et al.* 2004) is required to determine flood inundation extents for a range of flows.

Floodplain ecohydrology

Prior to embankment removal, Hunworth Meadows comprised a degraded *Holcus lanatus*-*Juncus effusus* rush pasture community (Clilverd *et al.* 2009). This is classified as MG10 under the UK National Vegetation Communities system (Rodwell 1998), which is typically associated with waterlogged soils. This is congruent with the prolonged saturation of surface soils observed pre-restoration during winter and spring, and with the periodic saturation occurring during summer and autumn months, all of which occurred during within-bank river flows. Flooding, particularly during the growing season, can cause aeration stress in plants, with prolonged waterlogging leading to species-poor plant communities (Jackson and Colmer 2005). This stands in stark contrast to the effects related to low-intensity summer flooding of the floodplain with river water, which is predicted for the site following the removal of the embankments along the River Glaven. Recurrent over-bank inundation increases environmental heterogeneity and is believed to have a positive effect on floodplain

plant diversity, firstly by limiting competition by dominant plant species (e.g. Silvertown *et al.* 1999, Helfield *et al.* 2007), and secondly by opening new patches for colonization by hydrochorically deposited propagules (e.g. Auble and Scott 1998, Nilsson *et al.* 2010).

In contrast to brief summer inundation events, infrequent floods of lengthy duration during the growing season can negatively affect floodplain diversity, either by burying plants with river sediment, or by exceeding tolerance limits for anoxia in the rooting zone of sensitive species (e.g. Gowing and Youngs 1997, Friedman and Auble 1999); however, floods of this type were not observed during the 10 years of river discharge data available. Furthermore, at Hunworth Meadow there is initial evidence to suggest that reconnection will improve drainage and create drier conditions between flood events due to the easier drainage of the floodplain following the removal of the embankments, which partly moderates the effects of large floods.

Re-establishment of over-bank flooding may result in nutrient enrichment of floodplain soils from flood-deposited sediment and nutrient-rich river water (Gowing *et al.* 2002b). While this may function to protect adjacent ecosystems from nutrient loading, increased nutrient supply may pose a risk to plant species richness at the restoration site (Vermeer and Berendse 1983, Verhoeven *et al.* 1996, Janssens *et al.* 1998, Michalcová *et al.* 2011) and over-ride the ecological benefits of improved river–floodplain connections. In such instances, further management may be required. In the case of Hunworth Meadow, which is a mesotrophic wet grassland, the additional supply of nutrients could be managed with traditional hay cutting. This would help balance the input of river-derived nutrients to the floodplain with the removal of nutrients in plant biomass (Linusson *et al.* 1998, Wheeler *et al.* 2004).

In addition to the embankment removal, a second-phase in-stream restoration project was conducted on the same stretch of river in August 2010, one year after the embankment removal and after the main period of fieldwork reported in this study. This involved the creation of a new, narrower and more geomorphically diverse, meandering river channel. Continued monitoring of hydrological conditions on the floodplain alongside regular vegetation surveys (e.g. Clilverd *et al.* 2009) will be used to evaluate changes in hydrological regime following the two differing stages of restoration, and the long-term effects on plant community composition.

CONCLUSIONS

Inter-annual climate variability complicates direct comparisons of pre- and post-restoration hydrological conditions. In this study, the two cool and wet spring/summer periods observed prior to the restoration, and the significantly warmer and drier spring/summers after the restoration, render it difficult to clearly determine the effects that embankment removal had on the floodplain soil–water regime—possibly with the exception of the near-river environment. This highlights the potential of hydrological/hydraulic modelling (underway for Hunworth Meadow) to simulate floodplain hydrology before and after restoration but under identical climatic conditions (e.g. Hammersmark *et al.* 2008).

Prior to the restoration, the river and floodplain were linked primarily via slow subsurface flowpaths, with the soil water regime on the floodplain being controlled by anoxic, nutrient-poor groundwater. Removal of river embankments has re-established over-bank flow, providing opportunities for regular bidirectional surface–subsurface flow and, consequently, the floodplain is likely to shift to a more disturbance-based environment controlled by oxygen-rich river water as well as groundwater. Restoration of river–floodplain connectivity is likely to cause more frequent, short-duration inundation of the floodplain, resulting in improved flood storage and a more favourable soil–water regime that may enhance floodplain plant diversity. Furthermore, regular over-bank flow and supply of nutrient-rich river water to the floodplain during the summer months, when microbial and plant activity is high, will favour conditions for removal of nutrients from the river.

Acknowledgements Funding and support was provided by the Environment Agency, UCL Geography Department, University of London Central Research Fund Grant, and UCL Graduate School. We thank Ross Haddow and Adel MacNicol of the Study Estate for their encouragement, Richard Hey for designing the river restoration, and the River Glaven Conservation Group, Environment Agency, Wild Trout Trust and Natural England for their technical support during the embankment removal. Many thanks to Queen Mary University of London for providing the field equipment, and a special thanks to Derek Sayer, Chabungbam Rajagopal Singh, Victoria Sheppard and Helene Burningham for their assistance in the field, and Simon Dobinson, Laura Shotbolt, and Ian Patmore for their assistance in the laboratory.

REFERENCES

- Aanderaa, 2006. *TD 218 Operating manual oxygen optode 3830, 3835, 3930, 3975, 4130, 4175* [online]. Bergen, Aanderaa Data Instruments. <http://www.aadi.no> [Accessed 15 August 2010].
- Acreman, M.C., Riddington, R., and Booker, D. J., 2003. Hydrological impacts of floodplain restoration: a case study of the River Cherwell, UK. *Hydrology and Earth System Sciences*, 7 (1), 75–86.
- Acreman, M.C., *et al.*, 2007. Hydrological science and wetland restoration: some case studies from Europe. *Hydrology and Earth System Sciences*, 11 (1), 158–169.
- Allen, D.J., *et al.*, 2010. Interaction between groundwater, the hyporheic zone and a Chalk stream: a case study from the River Lambourn, UK. *Hydrogeology Journal*, 18 (5), 1125–1141.
- Allen, R.G., 2000. Using the FAO-56 dual crop coefficient method over an irrigated region as part of an evapotranspiration intercomparison study. *Journal of Hydrology*, 229 (1–2), 27–41.
- Antheunisse, A.M., *et al.*, 2006. Regional differences in nutrient limitation in floodplains of selected European rivers. *River Research and Applications*, 22, 1039–1055.
- Auble, G.T. and Scott, M.L., 1998. Fluvial disturbance patches and cottonwood recruitment along the upper Missouri River, Montana. *Wetlands*, 18 (4), 546–556.
- Baird, A.J., Surridge, B.W.J., and Money, R.P., 2004. An assessment of the piezometer method for measuring the hydraulic conductivity of a *Cladium mariscus*—*Phragmites australis* root mat in a Norfolk (UK) fen. *Hydrological Processes*, 18, 275–291.
- Baker, M.A., and Vervier P., 2004. Hydrological variability, organic matter supply and denitrification in the Garonne River ecosystem. *Freshwater Biology*, 49 (2), 181–190.
- Barber, K.R., *et al.*, 2004. Soil aeration status in a lowland wet grassland. *Hydrological Processes*, 18 (2), 329–34.
- Bernhardt, E.S., *et al.*, 2005. Synthesizing U.S. river restoration efforts. *Science*, 308 (5722), 636–637.
- Berrie, A.D., 1992. The chalk-stream environment. *Hydrobiologia*, 248 (1), 3–9.
- BGS (British Geological Survey), 2007. *Geological assessment—detailed. Georeports GR_109305_1* [online]. Keyword: British Geological Survey. Available from: <http://www.great-yarmouth.gov.uk/appendix-11.2-2007-bgs-detailed-report.pdf> [Accessed 27 July 2011].
- Billy, C., *et al.*, 2010. Nitrogen isotopic composition of leached nitrate and soil organic matter as an indicator of denitrification in a sloping drained agricultural plot and adjacent uncultivated riparian buffer strips. *Soil Biology and Biochemistry*, 42 (1), 108–117.
- Boulton, A.J., *et al.*, 1998. The functional significance of the hyporheic zone in streams and rivers. *Annual Review of Ecological Systems*, 29, 59–81.
- Brand, E.W. and Premchitt, J., 1980. Shape factors of cylindrical piezometers. *Géotechnique* 30, 369–384.
- British Atmospheric Data Centre, 2010. *Met Office—MIDAS land surface station data* [online]. Didcot: The NCAS British Atmospheric Data Centre. Available from: <http://badc.nerc.ac.uk> [Accessed 1 September 2010].
- Brunet, R.C., *et al.*, 1994. Role of the floodplain and riparian zone in suspended matter and nitrogen retention in the Adour River, south-west France. *River Research and Applications*, 9 (1), 55–63.
- Buijse, A.D., *et al.*, 2002. Restoration strategies for river floodplains along large lowland rivers in Europe. *Freshwater Biology*, 47 (4), 889–907.
- Bullock, A., and Acreman, M.C., 2003. The role of wetlands in the hydrological cycle. *Hydrology and Earth System Sciences*, 7 (3), 75–86.

