

# VIBRATION INDUCED FATIGUE FAILURE IN PIPING SYSTEM

YAP WENG SUON

A project report submitted in partial fulfilment of the  
requirements for the award of the degree of  
Master of Engineering (Mechanical)

Faculty of Mechanical Engineering  
Universiti Teknologi Malaysia

JUNE 2013

To my beloved wife and parents

## ACKNOWLEDGEMENT

In preparing this thesis, I was in contact with many people, researchers, academicians, and practitioners. They have contributed towards my understanding and thoughts. In particular, I wish to express my sincere appreciation to my project supervisor, Prof. Ir. Dr. Leong Yew Mun @ Mohd Salman, for encouragement, guidance, criticisms, advices, motivation and friendship. Without his continued support and interest, this thesis would not have been the same as presented here.

Of course, I would like to express my most sincere gratitude to my family especially to my wife, mother and father for supporting and loving me unconditionally.

My fellow postgraduate students should also be recognized for their support. My sincere appreciation also extends to all my working colleagues and others who have provided assistance at various occasions. Their views and tips are useful indeed. Unfortunately, it is not possible to list all of them in this limited space.

Thank You.

## **ABSTRACT**

Vibration induced fatigue failure in piping system is a critical yet common problem in the petrochemical industry. Root cause identification and severity assessment of these problems usually require specialist input. The objective of this study is to develop a spreadsheet based approach using guidelines published by Energy Institute to identify the likelihood of failure in a piping system. Test case for a Malaysian offshore was undertaken for the validation of the developed software. Such software allows vibration induced fatigue failure to be screened in the design of a new plant or modification of an existing plant. This software can also be used to analyze pipeline used in other industry.

## ABSTRAK

Getaran menyebabkan kegagalan lesu teraruh dalam sistem paip adalah satu masalah yang kritikal tetapi umum dalam industri petrokimia. Pengenalpastian punca dan penilaian masalah ini memerlukan kepakaran khas. Tujuan kajian ini adalah untuk menjana perisian berasaskan hampan elektronik merujuk kepada garis panduan yang diterbitkan oleh *Energy Institute* untuk mengenal pasti kemungkinan kegagalan dalam satu sistem paip. Perisian ini diuji untuk sebuah pelantar luar pantai. Dengan penggunaan perisian ini kegagalan lesu teraruh oleh getaran perlu sentiasa diambil kira semasa reka bentuk logi baru. Hampan elektronik ini boleh digunakan untuk analisis sistem paip tumbuhan dalam industri lain.

## TABLE OF CONTENTS

CHAPTER	TITLE	PAGE
	<b>DECLARATION</b>	<b>ii</b>
	<b>DEDICATION</b>	<b>iii</b>
	<b>ACKNOWLEDGEMENT</b>	<b>iv</b>
	<b>ABSTRACT</b>	<b>v</b>
	<b>ABSTRAK</b>	<b>vi</b>
	<b>TABLE OF CONTENTS</b>	<b>vii</b>
	<b>LIST OF TABLES</b>	<b>ix</b>
	<b>LIST OF FIGURES</b>	<b>x</b>
	<b>LIST OF SYMBOLS</b>	<b>xi</b>
	<b>LIST OF APPENDICES</b>	<b>xii</b>
<b>1</b>	<b>INTRODUCTION</b>	<b>1</b>
	1.1 Research Background	1
	1.2 Objective of Study	3
	1.3 Problem Statement	4
	1.4 Organization of Thesis	4
<b>2</b>	<b>LITERATURE REVIEW</b>	<b>5</b>
	2.1 Study of Vibration in Pipeline	5
	2.2 Vibration Causes Fatigue Failure of Pipe	6
	2.3 Assessment of Vibration in Pipes	7
<b>3</b>	<b>METHODOLOGY</b>	<b>11</b>
	3.1 Introduction	11

3.2	Flow Chart	12
3.3	Work Detail	14
3.4	Case Study	17
<b>4</b>	<b>RESULTS AND DISCUSSION</b>	<b>19</b>
4.1	Results	19
4.2	Discussion	26
<b>5</b>	<b>CONCLUSION</b>	<b>29</b>
	<b>REFERENCES</b>	<b>30</b>
	Appendix A	32

**LIST OF TABLES**

<b>TABLE NO.</b>	<b>TITLE</b>	<b>PAGE</b>
3.1	Excitation mechanism assessed by module T-2	14
4.1	Results of excitation factors for this plant	20
4.2	Result of likelihood classification due to conditional and operational factors of the plant	21
4.3	Total score for this plant on T-1	21
4.4	Mechanical excitation possible cause of fatigue failure in this plant	22
4.5	Summary of LoF score in T-2	25



## LIST OF FIGURES

<b>FIGURE NO.</b>	<b>TITLE</b>	<b>PAGE</b>
1.1	Pipe fretting due to vibration and no reinforcement plate at rest support	1
1.2	Fretting damage caused by clash between pipes	2
1.3	Additional support in piping system to brace the piping structure	3
1.4	Viscous damper added to reduce the vibration level of piping system	3
2.1	Experiment setup by Maq Qing <i>et al.</i>	6
2.2	rms of fluctuating pressure with respect to the measurement points near orifice plate	6
2.3	Flow chart procedure for piping vibration assessment	8
3.1	Flow Chart of thesis work	12
3.2	Detail steps to assess and predict likelihood of failure in piping system	13
3.3	SBC geometry types	15
3.4	Thermowell geometry types	16
3.5	E11P-B Platform – HP Flare System Schematic.	17
4.1	Partial input to run analysis of T2.7	23
4.2	Input and results of T2.7	24

**LIST OF SYMBOLS**

D	-	Pipe diameter
L	-	Distance
$M_w$	-	Molecular weight
PWL	-	Sound power level
P	-	Pressure
T	-	Pipe thickness
$T_e$	-	Temperature
V	-	Velocity
W	-	Mass flow rate
$\rho$	-	Density

**LIST OF APPENDICES**


<b>APPENDIX</b>	<b>TITLE</b>	<b>PAGE</b>
A	Spreadsheet for Vibration Analysis Based on Energy Institute Guidelines	32

## CHAPTER 1

### INTRODUCTION

#### 1.1 Research Background

Failure in piping system as failure due to fatigue which may lead to plant shut down is a concern in industry. There are 3 basic for vibration: mechanical induced vibration, flow induced vibration and acoustic induced vibration. Vibration could cause piping system to fret, fatigue or even transfer the vibration to the structure. Figure 1.1 and 1.2 below show examples of pipe fretting due to vibration.

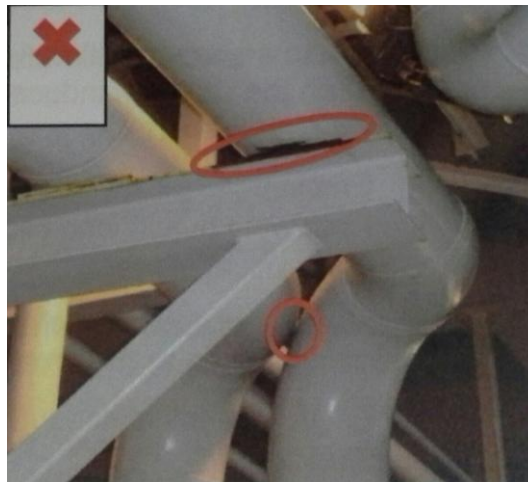

**Figure 1.1** Pipe fretting due to vibration and no reinforcement plate at rest support (Energy Institute, 2008)



**Figure 1.2** Fretting damage caused by clash between pipes (Energy Institute, 2008)

Several standards had been developed. The Norwegian petroleum industry for example had developed NORSOK standard L-002 to prevent major failure and reduce the downtime of the process plant. In year 2000, Marine Technology Directorate had published Guidelines for the Avoidance of Vibration Induced Fatigue in Process Pipework as a guideline to pipeline design. This had been adopted by the Energy Institute in 2004 for a similar guideline. The American Petroleum Institute (API) developed API 579 standard in January 2000 to define the fitness for services of pressurized equipment. Other than standards developed by the industry, finite element method is also frequently used to assess vibration problem by consultants.

These guidelines provided methodology to predict and assess the likelihood of failure of a pipe system. Whenever a likelihood of failure is predicted, additional supports such as shown in figure 1.3 shall be added to brace the pipe structure or viscous damper such as figure 1.4 shall be added to reduce the vibration level. The industry uses these standards as a basis for safeguard of piping from suffering from damages. Continuous work should however be done to improve the accuracy of these standards and to prevent any tragic incident from happening.



**Figure 1.3** Additional support in piping system to brace the piping structure (Energy Institute, 2008)



**Figure 1.4** Viscous damper added to reduce the vibration level of piping system (Energy Institute, 2008)

## 1.2 Objective of Study

The objective of this work was to review empirical predictions for the likelihood of fatigue failure in piping systems involving case studies of actual installations, and to develop a software routine for use of vibration fatigue failure screening.

### **1.3 Problem Statement**

Flow and acoustics induced vibrations are common occurrence in industrial piping systems used in petrochemical and power generation industry. These vibrations often result in fatigue failures. Root cause identifications and severity assessments are often based on elaborate computation methods involving finite element analysis, computational fluid dynamics and acoustic analysis. These methods are however not readily available to the non-specialist in the plant. The Energy Institute formulated technical guidelines based on empirical and approximations for screening and risk assessment for likelihood of failures.

This work involved developing a spreadsheet based software using the Energy Institute methods and included case studies from the industry.

### **1.4 Organization of Thesis**

Chapter 1 introduction consists of background of the research, the objective of this work, the reason conducting this work, and the hypothesis of the result of the study work. Chapter 2 literature review describes the theory used in this work. Chapter 3 methodology describes on how this work was done. Including flowchart, identification of research variable, algorithm, collection and analysis of data, and how the accuracy and correctness of this research is checked. Chapter 4 results and discussion shows the results held by this work using technical guidelines followed by discussion on the results observed from the case study and mitigation measures are suggested for high likelihood of failure pipelines.

## REFERENCES

American Petroleum Institute. *Fitness for Service, 2<sup>nd</sup> edition*, API 579-1, 2007.

Bonney Forge Ltd, *Branch Connections*, Pennsylvania: Trade Brochure, 2009

Energy Institute . *Guidelines for the Avoidance of Vibration Induced Fatigue Failure in Process Pipework, 2<sup>nd</sup> Edition*, 2008.

Environmental Resource Management, *Acoustically-induced vibration study for E11P-B*, 2004

Jae Do Kwon and Joong Cheul Park (2004). Multiaxial Fatigue Life of Duplex Stainless Steels with Thermal Aging at 450°C under Axial-Torsional Load. *Key Engineering Materials*, Vol 270-273, pp 1183-1188

K.R. Al-Asmi and A.C. Seibi (1998). Vibration-induced fatigue failure of an impulse line. *Engineering Failure Analysis*, Vol 5, No. 3, pp, 195-204.

Mao Qing, Zhang Jinghui, Luo Yushan, Wang Haijun and Duan Quan (2006). Experimental studies of orifice-induced wall pressure fluctuations and pipe vibration. *International Journal of Pressure Vessels and Piping*, 83, 505-511.

Naren Sukaih (2002), A practical, systematic and structured approach to piping vibration assessment. *International Journal of Pressure Vessels and Piping*, 79, 597-609.

Norwegian petroleum industry. *NORSOK standard L-002, edition 3*, 2009.

P.Moussou (2003), An excitation spectrum criterion for the vibration-induced fatigue of small bore pipes. *Journal of Fluids and Structures*, 18, 149-163.



Rahul Mittal, P.K. Singh, D.M. Pukazhendi, V.Bhasin, K.K. Vaze, A.K. Ghosh  
(2011). Effect of vibration loading on the fatigue life of part-through notched pipe.  
*International Journal of Pressure Vessels and Piping*, 88, 415-422.