

The Evolution of Corryong/Nariel Creek since European Settlement: Implications for On-going Management Prioritisation

Elisha A. Teo^{1,2}, Philip M. Marren¹

1. Department of Resource Management and Geography, University of Melbourne, Parkville, 3010.

2. Present address: Department of Geography, National University of Singapore, Singapore. Email: elishaanneteo@gmail.com

Key Points

- Channel change and erosion rates of Corryong Creek were measured using historic maps and aerial photographs, from 1882 to 2011.
- Climatic and anthropogenic histories were also gathered and analysed collectively with channel change data, in order to understand the dynamics of the fluvial system.
- Evidence shows that channel change is largely controlled by the ENSO-driven climate, although anthropogenic activities have intensified erosion rates.
- Based on our results, recommendations of priority are made for the aims and actions of river management. Essentially, we recommend that 1) reducing community vulnerability by promoting community adaptation be addressed first, and then 2) mitigating erosion risk.

Abstract

The relative significance of climatic and anthropogenic drivers of channel change is important to inform river management priorities. Some research have observed long-term channel change fluctuations mirroring climatic oscillations, while others have determined that human activity dominates and conceals any such climatic influence. Corryong Creek is an ideal setting to further study the interaction between climate and anthropogenic changes on channel evolution as it is known to experience significant levels of both. Catastrophic floods have been induced by high rainfall, the floodplain has been completely cleared, the riparian zone is almost entirely invaded by willows, and every reach of the channel has experienced some form of channel modification. Our analysis has found that human intervention did not conceal climatic fluctuations (which were ENSO-driven). Rather, anthropogenic variables enhanced erosive La Niña periods, or intensified reach-scale local impacts. As periodic increases in erosion are to be expected, the local community needs to first accept and adapt to some level of channel erosion in order to avoid catastrophic damage during floods. As the second priority, erosion risk can be mitigated through strengthening willow management, limiting river engineering, practicing bushfire management, and fencing the riparian zone.

Keywords

Bank erosion, sinuosity, channel change, climate influence, anthropogenic influence, systems thinking

Introduction

River management needs to be informed by a holistic understanding of the fluvial system in question. This can only be done by considering both present and past conditions of the river environment, and by doing so, the appropriate management techniques will arise (Schumm & Lichty, 1965; Wasson, 1994; Lane & Richards, 1997; Rustomji et al., 2009). This is the case with determining the relative importance of anthropogenic and climatic controls on river channel change, a question that has wide river management implications in the context of global environmental change (Macklin & Lewin, 1997; Goudie, 2006; Wohl, 2011). While erosion and channel movement naturally occurs to maintain channel stability, there is evidence of human activity causing channel instability by intensifying erosion rates (Rutherford, 2000).

This debate is especially pertinent in Australia. In various catchments in southeast Australia, factors such as land clearing, riparian willow invasions and direct channel modification are known causes of increased erosion rates (Rutherford, 2000). It has also been suggested that many southeast Australian channels are prone to a climate-driven cyclic pattern of channel change: channel enlargement during periods of large infrequent flows, followed by channel narrowing during periods of smaller and more frequent flow events (Nanson & Erskine, 1988; Nanson et al., 2008; Rustomji et al., 2009). Flood regime theory suggests that the climate in southeastern Australia is dominated by alternating periods of higher and lower flood frequencies every 30 to 50 years (Warner, 1987; Erskine & Townley-Jones, 2009). It is also possible for the ENSO-driven climate variation of southeast Australia (and its recent link to the Indian Ocean Dipole; Nicholls et al., 1996; Ummenhofer et al., 2009) to manifest in channel change.

The question now lies in how river management should respond, in terms of what levels of erosion are to be expected or can be managed. This would help with prioritising management actions, which is often difficult because of the differing concerns of stakeholders and conflicting river health factors. Geomorphological stability is a useful starting point, as it is critical to other river health parameters such as ecology and water quality (Brierley et al., 2002; Robinson et al., 2002). To determine these priorities, we need to understand the relative significance of individual factors, the interrelationships between them, and how these translate into erosion rates.

Corryong/Nariel Creek

Corryong Creek, referred to as Nariel Creek in its upper reaches, is a gravel-bed tributary of the River Murray approximately 115 km long and its catchment about 980 km². Since European settlement, the catchment has been altered extensively through land clearing, willow planting, channel straightening and channel realignment. Regional river managers and locals believe that the amount of erosion recently experienced by the river is unnaturally high, exacerbated by past river management activities. Mass bank failures and avulsions are significant problems to the local community as it removes valuable pasture, endangers livestock, damages infrastructure, disrupts farmland boundaries, and endangers the river ecosystem and its associated fishing tourism industry.

Originally, the catchment was densely vegetated by woodlands and forest (Miller, 1934; DEPI, 2012). Within a century of settlement, the entire floodplain was almost completely cleared (Mitchell, 1981), while it is presently completely so (Barrat et al., 2007). Willows were introduced for stream stabilization, to mitigate the effects of riparian vegetation loss. According to newspaper reports, it is likely that willows contributed to flooding in Corryong as early as the 1920s (Albury Banner and Wodonga Express, 1920; The Argus, 1938), before willow planting became popular throughout Victoria from the 1950s to 1990s (Pope et al., 2006). Historic photos from the 1950s and 1960s document the severe channel obstruction and subsequent bank erosion caused by willows. However, it appears that the erosion was attributed to large woody debris instead of the willows, as river works during the mid-20th century involved desnagging but not willow removal (Erskine & Webb, 2003). Willow management only began in Australia in the 1990s (Pope et al., 2006). Along Corryong, willows have been removed at a few reaches, but not extensively (Webster, 2006). As a result, the channel is still almost completely lined with willows instead of native vegetation.

The entire length of the river has been subject to stream management works of some manner (Water Victoria, 1989). Initial river engineering in the 1960s and 1970s involved major channel straightening and realignment that were meant to increase the rate of drainage (Figure 1). Unfortunately, channel instability increased and a large flood in 1972 led to avulsions through farmland. Farmers responded by fencing the channel and planting willows (Webster, 2006). Gravel was also excavated from banks to build roads during this period, leaving banks exposed and unstable (Webster, 2006). Since the establishment of the Shire's River Improvement Trust (now the North East Catchment Management Authority), attempts to radically modify channels have ceased. Projects now focus on regaining channel stability through rocking and tethered logs (Figure 1). A few reaches have also received artificial gravel deposition by NECMA to decrease stream power.

However, the channel is still believed to be unstable due to observations of significant channel deepening, channel widening from gravel accumulation, and high rates of channel movement at reaches that have been historically straightened and/or realigned. Stock trampling is another issue as the majority of the river has been unfenced since the 2002/2003 drought (Webster, 2006).

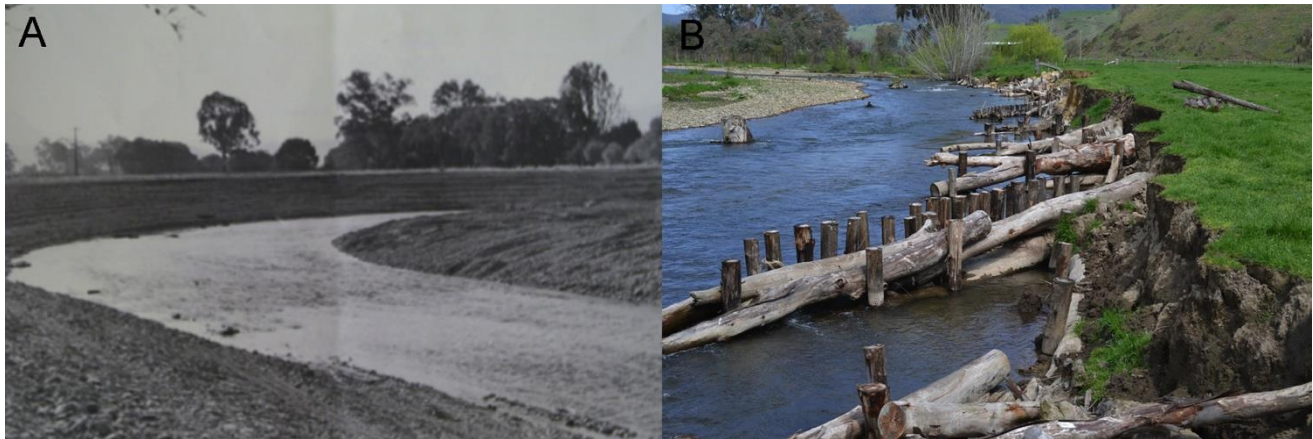


Figure 1. Different sections of the same reach in A) 1956 and B) 2012. Earlier river management works involved severe channel straightening and realignment. It is presumed that these works have caused the channel instability issues still currently faced, leading to more stabilising works being implemented since.

Relatively less is known of Corryong Creek's relationship with climate, except that several well-known floods have led to mass bank erosion and infrastructure damage. These include a very large flood in 1917, a series of floods in the 1950s, and the recent major floods from September 2010 to January 2011. It is also possible that Corryong Creek's discharge to be controlled by ENSO, since the River Murray has been found to be so (Simpson et al., 1993).

By analysing the spatiotemporal trends of channel change, anthropogenic factors and climate, one can reveal the system's dynamics. First, by measuring and analysing channel form over time, periods of higher and lower erosional activity can be identified, reflecting fluctuations in system inputs that either increase or decrease stream power. The variables that control the system inputs themselves are more prominent or only began at certain points of time. Therefore, with the histories of river management, willow growth and climate established, it is possible to observe which human influence or climate event is likely to have triggered a period of channel degradation or aggradation. Reach-scaled comparisons can also reveal the interaction between spatially variable triggers (e.g. river works) and channel change. With the anthropogenic history already known, the histories of channel evolution and climate now need to be measured and analysed.

Reconstructing channel change history

Measurements were made from the point alluvial channel began to the confluence with the Murray River (Figure 2). The study reach was divided into four zones (Zones A to D). Zone boundaries were defined at major confluences and at the margin between partially-confined and unconfined valley settings to account for the geomorphic effects of discharge volume and valley confinement. Zone A, which has a discontinuous floodplain, ends at the confluence of Corryong and Simpsons Creek. The end of Zone B marks the end of the discontinuous floodplain and the large widening of the valley downstream. Zone C continues just upstream of the confluence of Corryong and Thowgla Creek, from which Zone D extends to the River Murray. Using ArcGIS, 14 captures of channel form spanning 1883 to 2011 were digitised from parish plans, aerial photos, a geological map, and LiDAR (Figure 2). Due to the decreasing resolution of data with age, the planform centreline (and therefore sinuosity) was the only consistent channel parameter measured throughout this time series. Average channel widths and amount of sediment deposition for each reach (quantified using the surface area of exposed sediment) were only measurable for the 1985, 2004, 2010 and 2011 captures.

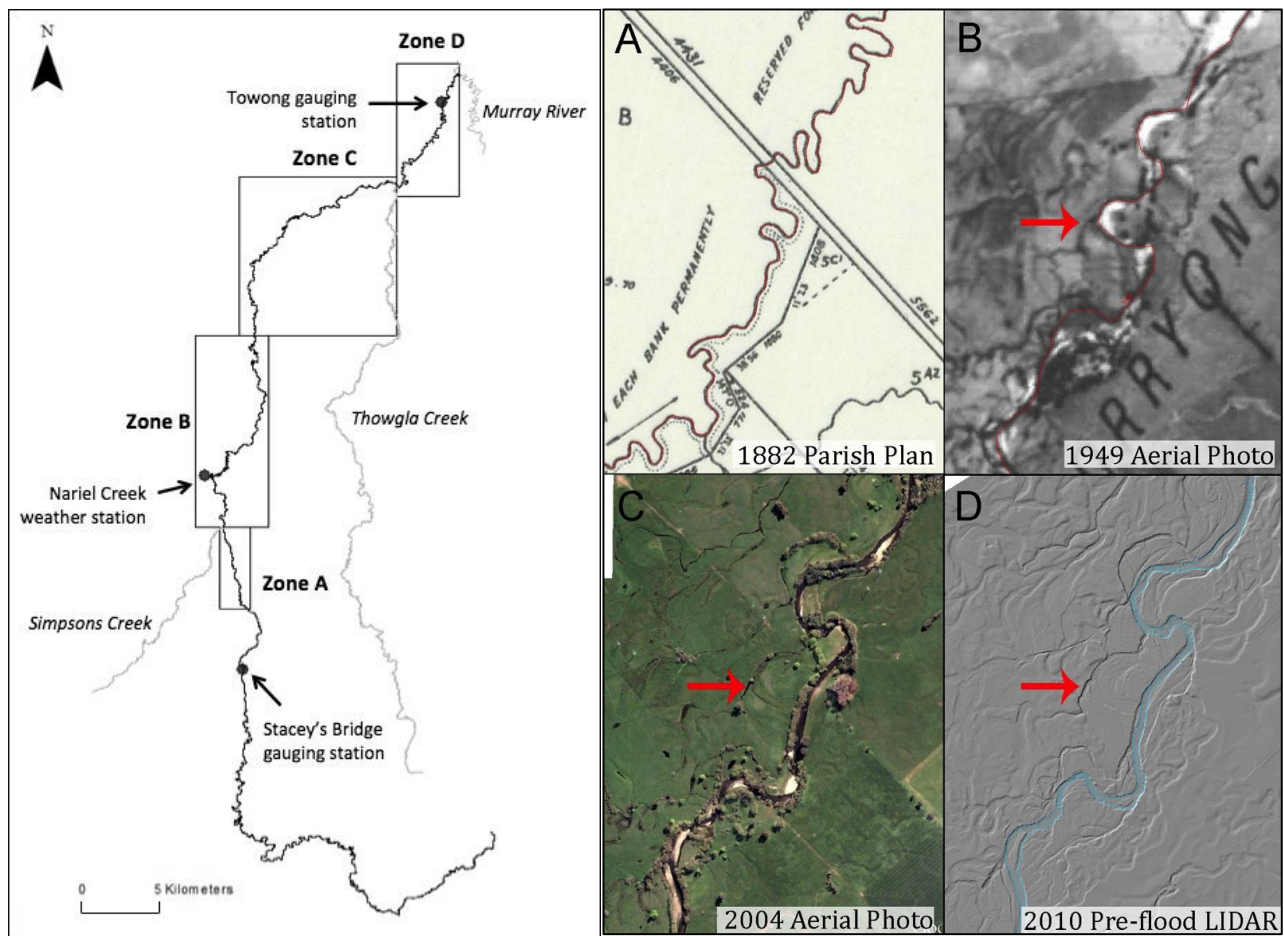


Figure 2. Map of Corryong Creek (left), depicting the separate Zones, the Nariel Creek weather station and Stacey's Bridge gauging station. Panels A to D show the same reach captured by different sources. The red arrows point out a meander that was once present but the scar of which still remains.

Changes in climate were determined using rainfall (1884 to 2013) and river flow records (1954 to 2013) obtained from Nariel Creek weather station and Stacey's Bridge gauging station (Figure 2). Post-1954, flood recurrence intervals were established using a Log Pearson III flood frequency analysis of instantaneous daily discharge data. When identifying periods of high flow, bushfire events were also noted since they have a hydrological effect of increasing discharge. Newspapers and DEPI photos confirmed major floods. The presence of cyclical flood regimes was tested by applying the statistical methods used by Riley (1981), Brooks & Brierley (2000) and Erskine & Townley-Jones (2009). A single factor analysis of variance (ANOVA) test determined significant differences between rainfalls of different climate regimes (Riley, 1981; Brierley et al., 2005). To identify and analyse temporal changes in rainfall unique to Corryong, an intervention analysis was performed using the cumulative sum technique (CUSUM). This was followed by a Wilcoxon Rank Sum test (Erskine & Townley-Jones, 2009). ENSO/IOD periods were defined using Meyers et al. (2007) and the Bureau of Meteorology. Rainfall and flow anomalies for each ENSO/IOD combination categories were gathered, as conducted by Ummenhofer et al. (2009), and tested statistically using ANOVAs.

Results

Since the 1880s, Corryong Creek has become significantly straighter throughout its length (Figure 3). The overall average sinuosity of 1.47 in 2011 is 26% lower than the 2.01 in 1882. There are three general stages to sinuosity change observed (Figure 4). From the early to mid-20th century, there is a large decrease in sinuosity. From then to the mid-1990s, there is also a decrease in sinuosity, although at a lower rate. This is followed by a slight increase in sinuosity from the mid-1990s to the present. Measurements of channel width and sediment deposition fluctuate accordingly – when channels are wider there is a decrease in deposited sediment, when channels are narrower there is an increase in deposited sediment (Figure 4). Thus, there is a clear definition of the first periods of channel aggradation (mid 1980s to mid-2000s) and degradation (mid-2000s to 2010 pre-flood) using these parameters. From before and after the late 2010 floods, there is an overall increase in both channel width and exposed sediment.

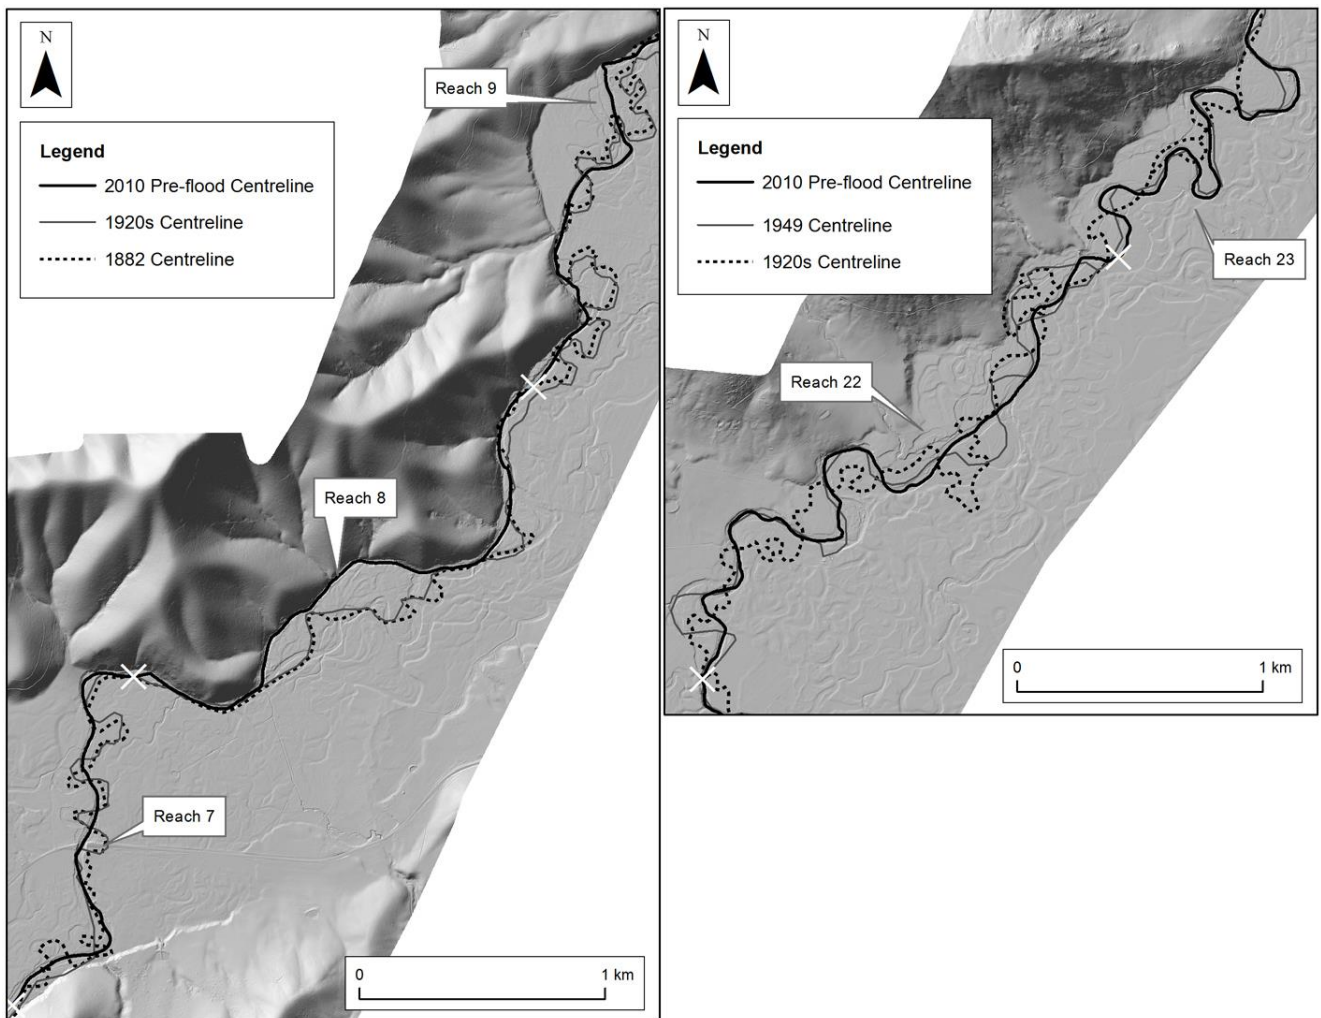


Figure 3. Examples of channel straightening. The planforms are superimposed over the LiDAR data captured in 2010.

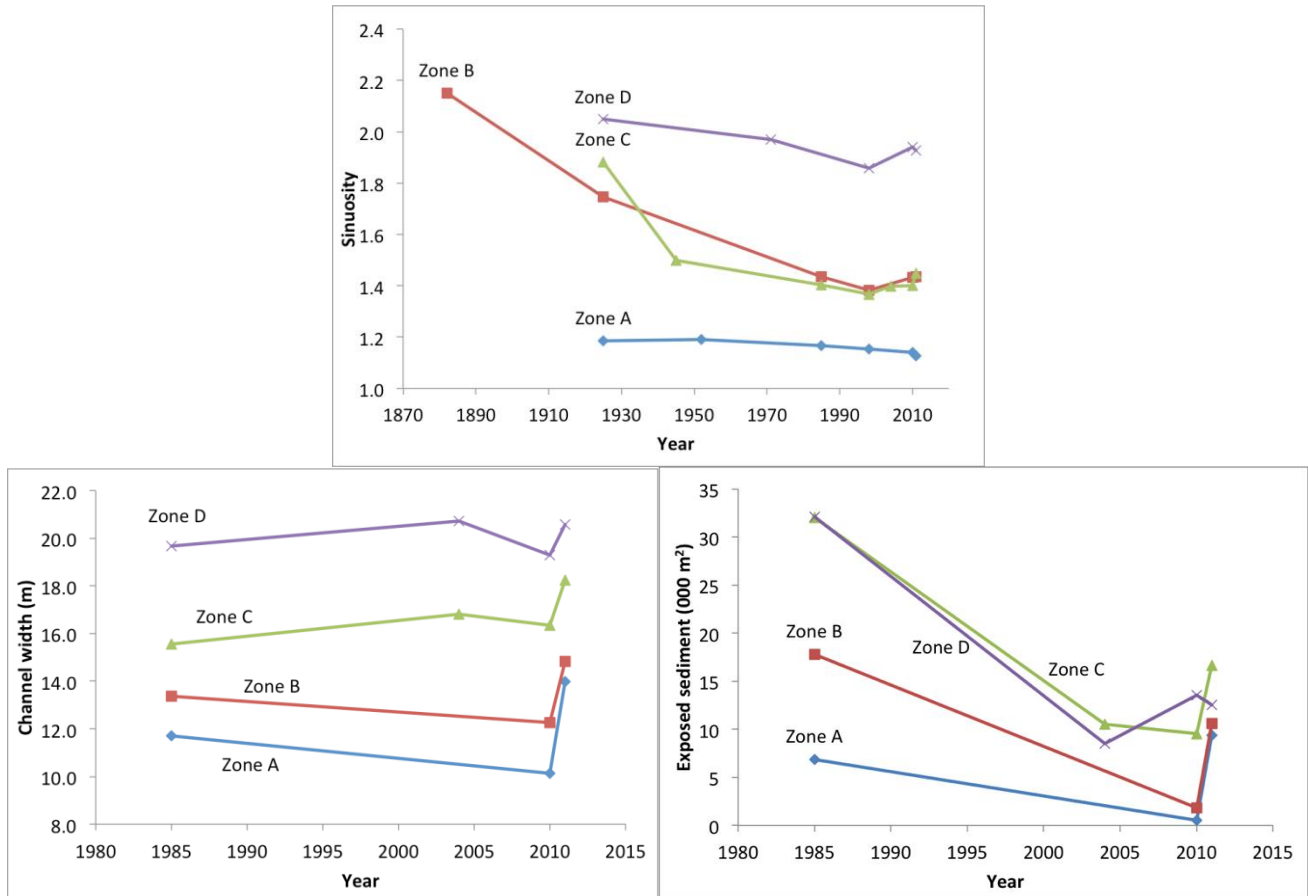


Figure 4. Sinuosity, channel width and sediment deposition measurements categorised by Zone.

The multidecadal flood regimes defined for other catchments in southeast Australia (Erskine & Townley-Jones, 2009) are not applicable to Corryong Creek (Figure 5) – an ANOVA test comparing the average annual rainfalls of each regime produced an insignificant p-value at a 95% confidence level. Repeating the methodology (CUSUM analysis) to determine a flood regime unique to Corryong’s rainfall still does not reveal multidecadal climate fluctuations. However, the influence of ENSO/IOD is statistically strong in the rainfall and flow data. Above average rainfalls and flow typically occur during years of La Nina and/or negative IOD; below average rainfalls and flow occur during years of El Nino and/or positive IOD (Figure 6).

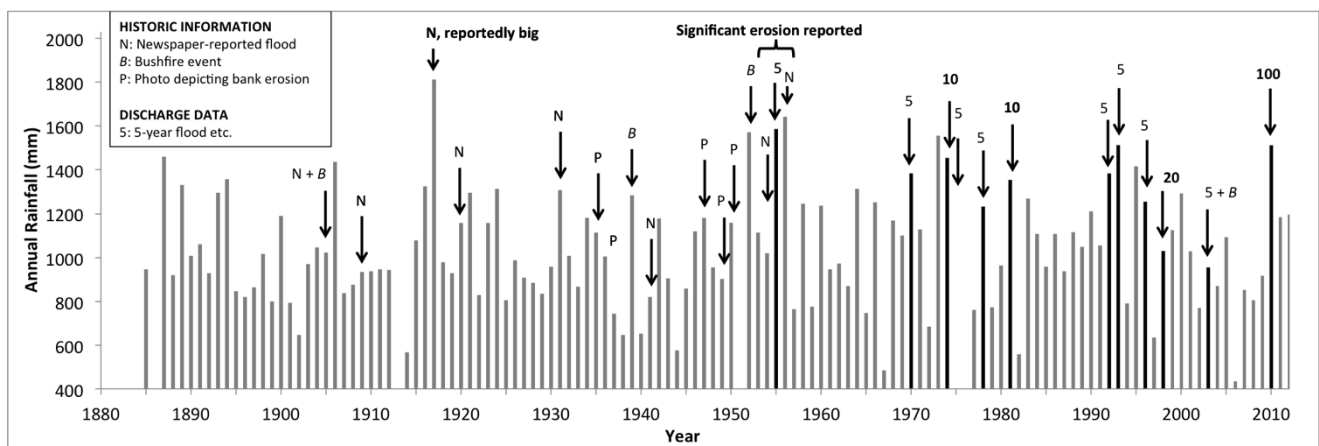


Figure 5. Average annual rainfall and major flood and fire events from 1885 to 2012.

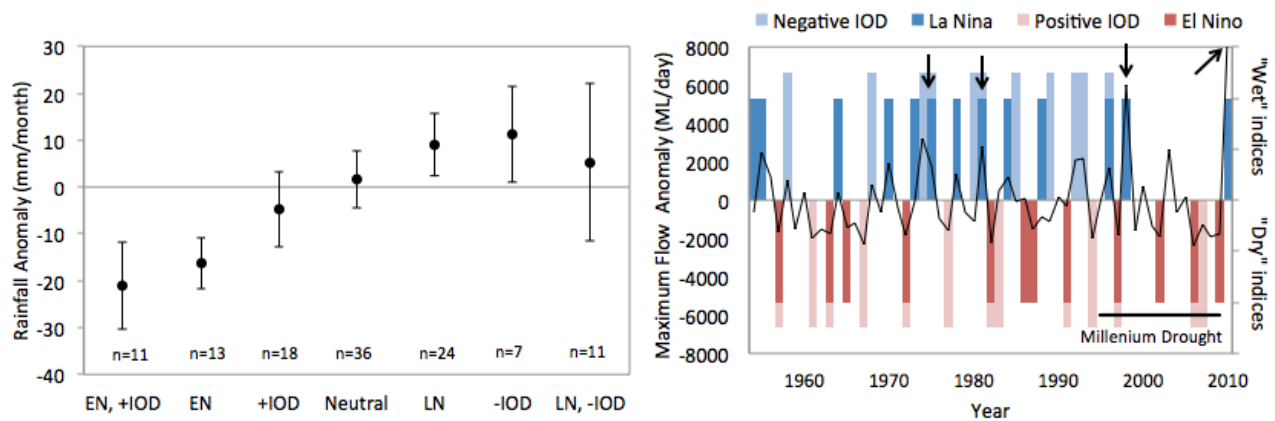


Figure 6. Mean monthly rainfall anomalies (left) and maximum flow anomalies (right) for years of different ENSO/IOD categories. Error bars (left) indicate the 90% confidence interval while the arrows (right) depict the two 5-year floods in 1974 and 1981, the 20-year flood in 1998, and the 100-year flood in late 2010.

Discussion

There are three stages to Corryong Creek's geomorphological history. The late 19th to mid-20th century is characterised by a large fall in channel sinuosity. This coincides with and is hence attributed to the almost complete clearing of the floodplain from settlement to the early 20th century. Therefore, most of the overall channel change is not due to extensive channel modification works, as it may have been expected, since they only began in the 1960s. It is likely that clearing led to larger, flashier floods that increased erosion rates during high flows and reworked the river into a straighter channel.

From the mid-20th century to the 1990s, the channel exhibited instability issues involving mass bank erosion and avulsions, which would largely stem from the vegetation clearing. In response, there were repeated attempts to straighten the channel. This period is characterised by a lesser decrease in sinuosity relative to the earlier part of the century. There are several possible reasons. First, since the channel was already significantly straightened, further straightening, deliberate or otherwise, could only be minor. It is also during the mid-20th century when willows established a stronghold on the riparian zone – they could have decreased channel capacity for change (at least in terms of planform, since willows were observed intensifying bank erosion at narrowed reaches). Since the 1990s, there has been a slight increase in channel sinuosity. This parallels the more sympathetic river management techniques that have taken over to allow the channel to achieve its more stable, sinuous state.

The recent data on channel width and sediment deposition show that channel degradation occurs during La Niña-dominated periods and channel aggradation during El Niño-dominated years. Since there is a strong ENSO signal in Corryong Creek's hydrology, it is possible for periods of less and more channel erosion to be discerned through ENSO fluctuations (longer-term flood regime cycles were not found). Flood events do not appear to affect sinuosity significantly – after the 100-year flood in 2010, the planform has remained almost exactly the same yet there was severe channel widening and release of sediment. Thus, different variables lead to different scales of channel change, which are summarised in Figure 7. This is likely to be due to the persistence and scale of these variables (Knighton, 1998). For instance, catchment clearing is expansive, usually not reversed, and able to alter catchment hydrology greatly (Siriwardena et al., 2006) – thus, it has the tenacity to affect planform. On the other hand, more periodic and spatially sporadic variables only have the potential to impact the cross-section.

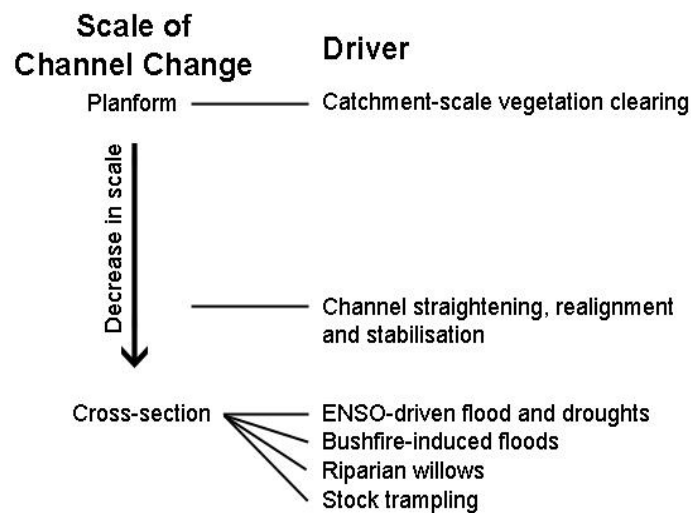


Figure 7. The type of channel change and its driving factors, as evidenced by Corryong Creek.

Implications for on-going management

Assuming that the earliest capture of Corryong Creek in 1882 is close to its pre-disturbance morphology, then the recent increase in sinuosity indicates that the river's stability is improving, at least in a geomorphological sense. As channel straightening and realignment works halted from the 1970s onward, the river has had the freedom to reconfigure to a more sinuous natural form. This explains the local community's conflicting impression that the channel is erosive and unpredictable, since there was an increase in channel migration in recent memory. The mass bank erosion that resulted from the recent 100-year flood in 2010 and 20-year flood in 1998 would have contributed to this perception. Therefore, the present approach to river management (bank stabilisation and gravel deposition only at selected banks, with no channel straightening and realignment) can continue. However, these forms of channel engineering should proceed with caution, as they only address the symptoms of channel erosion rather than the cause (i.e. the drivers in Figure 8; Spink et al., 2009).

To address the community's concerns with erosion and damage, we recommend that 1) reducing community vulnerability and 2) mitigating erosion risk should be the primary aims of managing Corryong Creek and similar catchments (Table 1). These are not new ideas for river management in the region – the frameworks of most of the management actions we identify are already in place or planned (e.g. see <http://www.necma.vic.gov.au/>). Nevertheless, as with all multivariate environmental problems, prioritisation of action is often the issue (Brierley et al., 2002) – this is where our findings could be of benefit (Table 1).

Reducing community vulnerability should be considered first because periodic increases in erosion during La Niña-dominated periods are unavoidable. There is evidence of Corryong Creek's channel evolution being largely controlled by the ENSO-driven climate. Furthermore, natural levels of erosion are necessary to avoid catastrophic flood damage such as from the 2010 floods. The duration and extent of channel degradation, as with flood impact (Costa & O'Connor, 1995), may depend on both the magnitude and frequency of high rainfall instigated by La Niña. Since ENSO cycles fluctuate every two to five years, these periods may be around the inter-decadal to decadal scale. If high levels of erosion cannot be avoided, then river management must reduce community vulnerability by promoting lifestyle adaptation (Thomalla et al., 2006). Adopting the erodible corridor concept may also be a consideration (Piégay et al., 2005).

Nonetheless, anthropogenic activity has been found to enhance erosion rates during high rainfall years (e.g. through catchment clearing), and intensify erosion at local reach scales (e.g. through channel engineering and willows). Most of these variables are theoretically changeable (with the exception of catchment clearing since

the entire floodplain is used as cattle pasture), but can only affect erosion rates to a limited extent. This is why mitigating erosion risk is prioritised second. In terms of avoiding further channel instability, limiting river engineering works should be first considered because of its large potential to induce instability, as evidenced its role in decreasing in sinuosity. Willow management should then be addressed as willows may intensify erosion rates at a reach scale. Fencing would also protect banks from weakening under stock trampling. Lastly, as bushfires are known to contribute to flooding, bushfire risk management is also important.

Table 1. Recommended prioritisation of river management aims and actions.

Primary aim	Secondary aim	Examples of actions
1. Reduce community vulnerability	1. Increase awareness of channel stability issues	1. A forum for regular discussion on river management. 2. Education to make all stakeholders aware that: <ol style="list-style-type: none"> Some level of channel migration and bank erosion is inevitable and necessary. Otherwise, floods will create catastrophic damage. Climate-driven high flow events are unavoidable. River engineering, willows, stock trampling and bushfires increase damage risk.
	2. Encourage community participation and cooperation	1. An incentive program for landholders to conduct environmental restoration works e.g. the Oven’s River Tender program.
	3. Avoid infrastructure damage	1. Wherever possible, relocate all structures away from the flood zone. 1. Otherwise, stabilise banks with the understanding of potential risks.
	4. Protect local farming and recreational fishing industries	1. Fencing to keep stock away from unsafe areas during high flows. 2. Recreational fishing management to avoid disruption.
	5. Improve flood prediction	2. Develop ENSO-based flood modelling. 2. Relay predictions to the community.
2. Mitigating erosion risk	1. Avoid further channel instability	1. Limit channel straightening, realignment and excessive bank stabilisation. 2. Strengthen willow removal works and revegetate with native vegetation. 3. Fence the riparian zone to avoid stock trampling.
	2. Reduce the impact of bushfire-induced floods	1. Bushfire risk management.

Conclusion

As indicated by the recent increase in sinuosity, Corryong Creek’s overall geomorphic stability has indeed improved since channel straightening and relocation stopped. However, mass bank erosion gave the impression that the river is still significantly unstable. The bank erosion is explained by channel migration and coincidental large flood events. Periodic high levels of bank erosion are to be expected since they are tied to the high rainfalls of La Niña-dominated years. Nevertheless, the extent of this bank erosion can be mitigated since it was found that anthropogenic influences have intensified erosion rates. Therefore, we recommend that first the local community needs to accept and adapt to some level of channel erosion in order to avoid catastrophic damage during floods. The second priority should then be to mitigate erosion risk by strengthening willow management, limiting river engineering, practicing bushfire management, and fencing the riparian zone. These recommendations are made possible by a systems understanding of Corryong Creek’s multivariate history.

Acknowledgments

This work was supported by a University of Melbourne Early Career Researcher grant to PMM. Anthony Wilson (North East Catchment Management Authority) is thanked for providing background information. LiDAR data was made available by Rick Frisina of the Victorian Department of Environment and Primary Industries. Hugh Smith, Justin Stout, Louisa Davis and Mei Yin Soh helped with fieldwork and GIS analysis.

References

- Albury Banner and Wodonga Express. (1920, 6 August 1920). TOWONG SHIRE COUNCIL, *Albury Banner and Wodonga Express (NSW : 1896 - 1939)*.
- Barrat, D., Parsons, M., Welsh, W., & Nation, E. (2007). *Water 2010 Technical Paper 5. Investigating land use-change-scenario impacts: potential effects of reforestation on water yield in the Upper Murray River Basin*. Australian Government.
- Brierley, G., Fryirs, K., Outhet, D., & Massey, C. (2002). Application of the River Styles framework as a basis for river management in New South Wales, Australia. *Applied Geography*, 22(1), 91-122.
- Brierley, G. J., Brooks, A. P., Fryirs, K., & Taylor, M. P. (2005). Did humid-temperate rivers in the Old and New Worlds respond differently to clearance of riparian vegetation and removal of woody debris? *Progress in Physical Geography*, 1, 27-49.
- Brooks, A. P., & Brierley, G. J. (2000). The role of European disturbance in the metamorphosis of the lower Bega River. In S. O. Brizga & B. L. Finlayson (Eds.), *River Management: the Australasian Experience* (pp. 221-246). Chichester: Wiley.
- Costa, J. E., & O'Connor, J. E. (1995). Geomorphologically effective floods. In J. E. Costa, A. J. Miller, K. W. Potter & P. R. Wilcock (Eds.), *Natural and anthropogenic influences in fluvial geomorphology* (pp. 45-56). Washington DC: American Geophysical Union, Geophysical Monograph.
- Department of Environment and Primary Industries. (2012). Biodiversity Interactive Map. Retrieved 29 November 2012, from <http://mapshare2.dse.vic.gov.au/MapShare2EXT/imf.jsp?site=bim>
- Erskine, W. D., & Townley-Jones, M. (2009, 30 November-3 December 2009). *Historical annual rainfall changes on the Central Coast of NSW: further evidence of alternating rainfall regimes*. Paper presented at the H2009 32nd Hydrology and Water Resources Symposium, Newcastle.
- Erskine, W. D., & Webb, A. A. (2003). Desnagging to resnagging: new directions in river rehabilitation in southeastern Australia. *River Research and Applications*, 19(3), 233-249.
- Goudie, A. S. (2006). Global warming and fluvial geomorphology. *Geomorphology*, 79(3), 384-394.
- Knighton, D. (1998). *Fluvial Forms & Processes: A New Perspective*. London: Hodder Education.
- Lane, S. N., & Richards, K. S. (1997). Linking river channel form and process: time, space and causality revisited. *Earth Surface Processes and Landforms*, 22, 249-260.
- Macklin, M. G., & Lewin, J. (1997). Channel, Floodplain and Drainage Basin Response to Environmental Change. In C. R. Thorne, R. D. Hey & M. D. Newson (Eds.), *Applied Fluvial Geomorphology for River Engineering and Management*. Chichester: John Wiley & Sons.
- Meyers, G., McIntosh, P., Pigot, L., & Pook, M. (2007). The Years of El Nino, La Nina, and Interactions with the Tropical Indian Ocean. *Journal of Climate*, 20, 2872-2880.
- Miller, R. R. (1934). *The Upper Murray: A Centenary Survey, with Special Reference to the Corryong District*. Melbourne: Spectator Publications.
- Mitchell, T. W. (1981). *Corryong and the 'Man from Snowy River' District*. Albury, New South Wales: Wilkinson Printers.
- Nanson, G. C., & Erskine, W. D. (1988). Episodic changes of channels and floodplains on coastal rivers in New South Wales. In R. F. Warner (Ed.), *Fluvial Geomorphology of Australia* (pp. 201-221). Sydney: Academic Press.
- Nanson, G. C., Price, D. M., Jones, B. G., Maroulis, J. C., Coleman, M., Bowman, H., Cohen, T. J., Pietsch, T. J., & R, L. J. (2008). Alluvial evidence for major climate and flow regime changes during the middle and late Quaternary of eastern central Australia. *Geomorphology*, 101, 109-129.
- Nicholls, N., Lavery, B., Frederiksen, C., & Drosowsky, W. (1996). Recent apparent changes in relationships between the El Nino-Southern Oscillation and Australian rainfall and temperature. *Geophysical Research Letters*, 23, 3357-3360.
- Piégay, H., Darby, S. E., Mosselman, E., & Surian, N. (2005). A review of techniques available for delimiting the erodible river corridor: a sustainable approach to managing bank erosion. *River Research and Applications*, 21(7), 773-789.

7ASM Full Paper

Teo & Marren – The evolution of Corryong/Nariel Creek since European Settlement

- Pope, L., Rutherford, I., Price, P., & Lovett, S. (2006). *Controlling willows along Australian Rivers. River Management Technical Guideline No. 6*. Canberra: Land & Water Australia.
- Riley, S. J. (1981). The relative influence of dams and secular climate change on downstream flooding, Australia. *Water Resources Bulletin*, 17, 361-366.
- Robinson, C. T., Tockner, K., & Ward, J. V. (2002). The fauna of dynamic riverine landscapes. *Freshwater Biology*, 47(4), 661-677.
- Rustomji, P., Bennett, N., & Chiew, F. (2009). Flood variability east of Australia's Great Dividing Range. *Journal of Hydrology*, 374, 196-208.
- Rutherford, I. (2000). Some Human Impacts on Australian Stream Channel Morphology. In S. O. Brizga & B. L. Finlayson (Eds.), *River Management: The Australasian Experience* (pp. 11-50). Chichester: John Wiley & Sons.
- Schumm, S. A., & Lichty, R. W. (1965). Time, space and causality in geomorphology. *American Journal of Science*, 263, 110-119.
- Simpson, H. J., Cane, M. A., Lin, S. K., Zebiak, S. E., & Herczeg, A. L. (1993). Forecasting Annual Discharge of River Murray, Australia, from a Geophysical Model of ENSO. *Journal of Climate*, 6(2), 386-390.
- Siriwardena, L., Finlayson, B. L., & McMahon, T. A. (2006). The impact of land use change on catchment hydrology in large catchments: The Comet River, Central Queensland, Australia. *Journal of Hydrology*, 326, 199-214.
- Spink, A., Fryirs, K., & Brierley, G. (2009). The relationship between geomorphic river adjustment and management actions over the last 50 years in the Upper Hunter Catchment, NSW, Australia. *River Research and Applications*, 25(7), 904-928.
- The Argus. (1938, 21 December 1938). SHORTAGE OF WATER, *The Argus (Melbourne, Vic. : 1848 - 1957)*.
- Thomalla, F., Downing, T., Spanger-Siegfried, E., Han, G., & Rockström, J. (2006). Reducing hazard vulnerability: towards a common approach between disaster risk reduction and climate adaptation. *Disasters*, 30(1), 39-48.
- Ummenhofer, C. C., England, M. H., McIntosh, P. C., Meyers, G. A., Pook, M. J., Risbey, J. S., Gupta, G. S., & Taschetto, A. S. (2009). What causes southeast Australia's worst droughts? *Geophysical Research Letters*, 36, L04706.
- Warner, R. F. (1987). The impacts of alternating flood- and drought- dominated regimes on channel morphology at Penrith, New South Wales, Australia. *International Association of Hydrological Sciences Publication*, 168, 327-338.
- Wasson, R. J. (1994). Living with the past: uses of history for understanding landscape change and degradation. *Land Degradation and Rehabilitation*, 5, 79-87.
- Water Victoria. (1989). Upper Murray: Stream Management Works. In Department of Water Resources (Ed.), *Water Victoria: and environmental handbook* (pp. 180-181). Melbourne: State of Victoria.
- Webster, M. (2006, December). A New Look for Nariel Creek. *Upper Murray Landcare Network Newsletter*.
- Wohl, E. (2011). What should these rivers look like? Historical range of variability and human impacts in the Colorado Front Range, USA. *Earth Surface Processes and Landforms*, 36, 1378-1390.